

Roofing **W**arehouse

6" Seam Tape Join



Tools Needed:

- **Batten Cover Strip/Seam Tape**
- **QuickPrime Plus**
- **QuickScrubber Handle & Pad**
- **Scissors**
- **Silicone Roller**
- **Chalk**
- **Measure Tape**


The 6" cover strip tape join should be applied as follows:-

Where two adjacent sheets of EPDM membrane meet, tailor the edges so they are straight and no more than 5mm apart along the length of the join.



Also make sure that contact adhesive is used on both the back of the membrane and deck surface to secure the edges.

With the membrane adhered to the deck, lay the tape in situ evenly across the join.

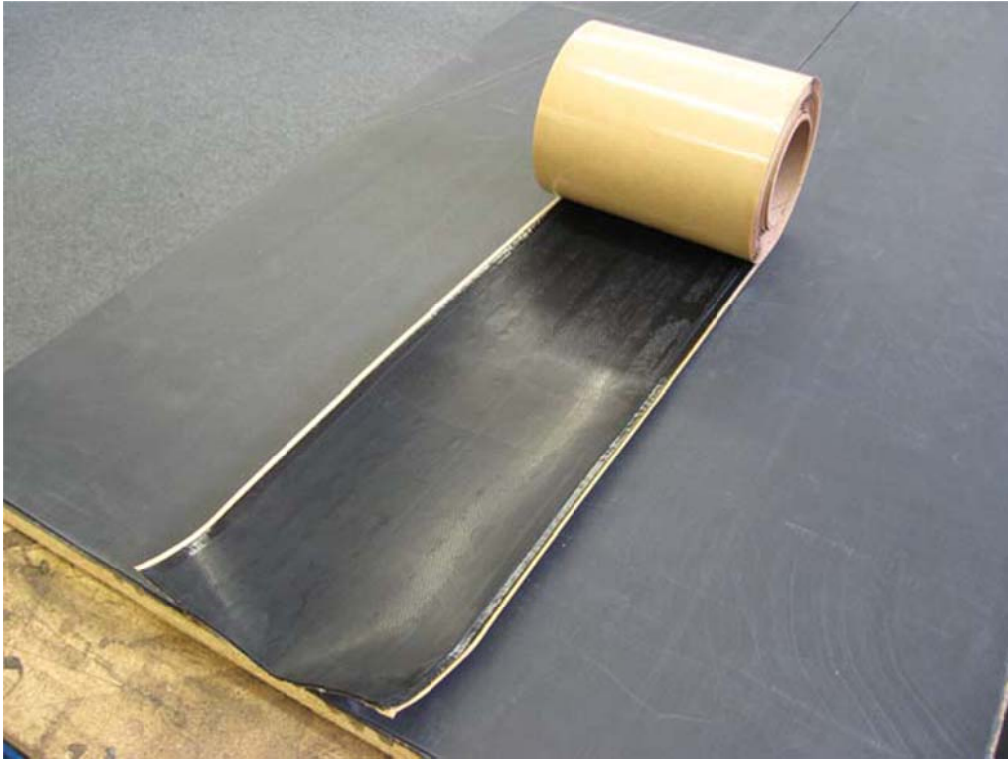

Outline with a crayon where the edges of the tape lie. This gives a guideline for you to apply Quickprime Plus. Make sure that the crayon marks extend beyond the edge of the tape around 10mm each side.







Apply Quickprime Plus with a Quickscriber pad and handle within the marked area. Apply all the way down the join, avoiding puddles by spreading it out evenly.



Wait for the Quickprime Plus to go tacky. This is especially important, as the tape will not adhere to it if it is in a wet state. Use the “pushed finger” test, and if the finger moves through the Quickprime Plus or strings in any way (as shown below), it is **NOT** ready for the tape.

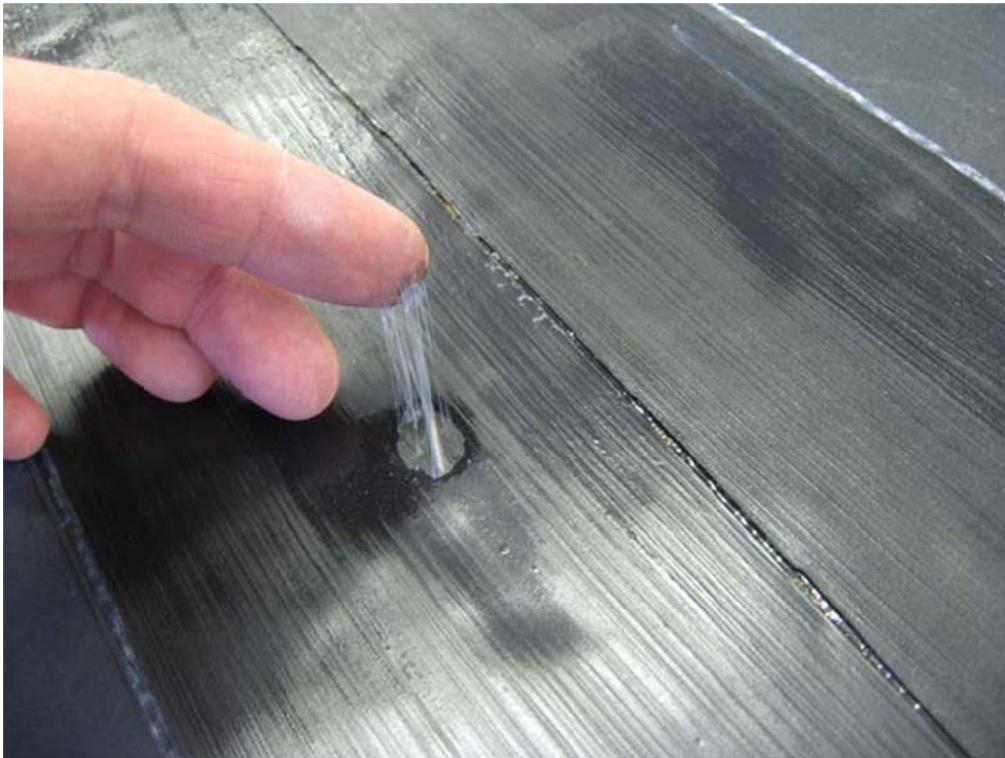


Once the Quickprime Plus is ready, apply the tape to the primed area. Lay the tape parallel to the marked line, keeping the tape taut to prevent air bubbles being caught underneath it. If you run out of tape, overlap the last 50mm with a new roll, but don't forget to apply Quickprime Plus on top. Continue to lay the tape. Once the tape is laid, remember to be overlay the joint with a 150mm x 229mm patch of Quickseam Formflash.

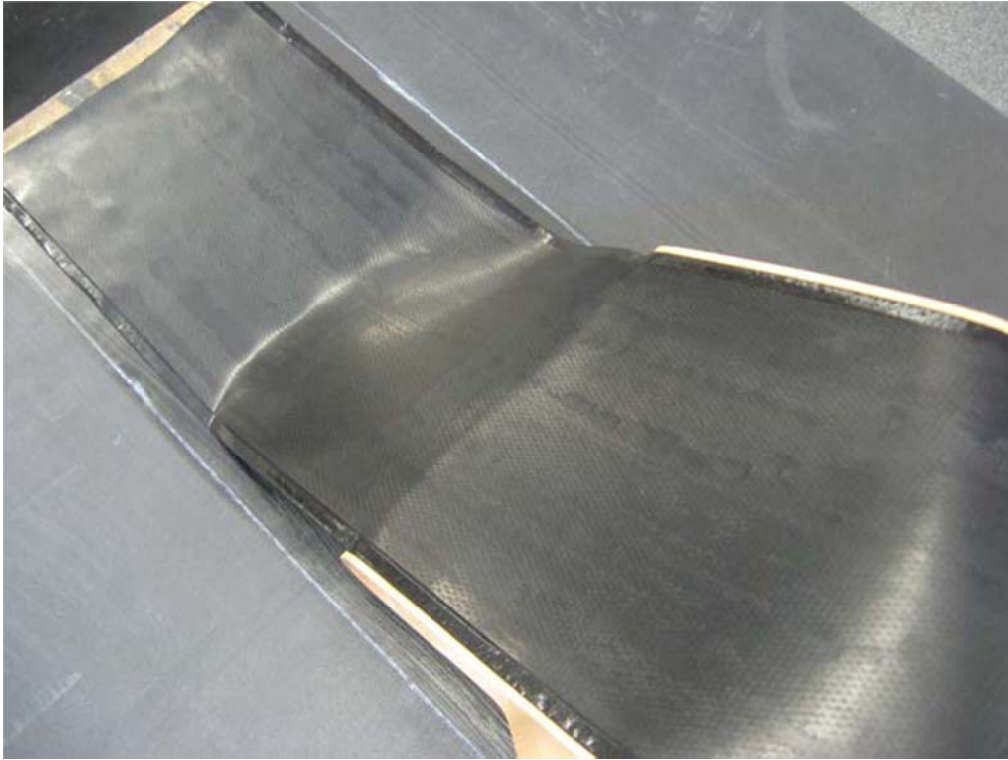

Use the silicon roller to ensure the tape has adhered properly to the membrane, firstly across the joint...



And then parallel to the joint...

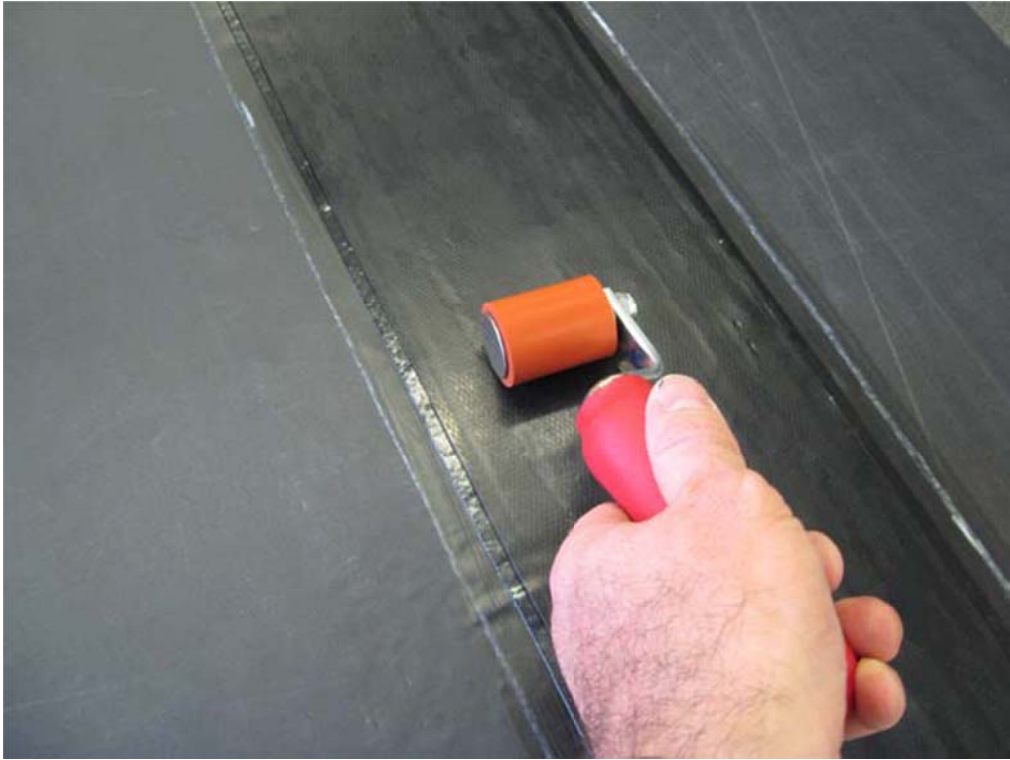

The finished detail.



Copyright