

# HOME REPORT

33A MAIN STREET  
CAIRNBULG  
FRASERBURGH  
AB43 8YJ



**DM HALL**  
CHARTERED SURVEYORS



# ENERGY PERFORMANCE CERTIFICATE



**DM HALL**  
CHARTERED SURVEYORS



# Energy Performance Certificate (EPC)

# Scotland

Dwellings

33A MAIN STREET, CAIRNBULG, FRASERBURGH, AB43 8YJ


<b>Dwelling type:</b>	Detached bungalow	<b>Reference number:</b>	0130-2359-5170-9291-8581
<b>Date of assessment:</b>	11 March 2019	<b>Type of assessment:</b>	RdSAP, existing dwelling
<b>Date of certificate:</b>	11 March 2019	<b>Approved Organisation:</b>	Elmhurst
<b>Total floor area:</b>	54 m <sup>2</sup>	<b>Main heating and fuel:</b>	Boiler and radiators, mains gas
<b>Primary Energy Indicator:</b>	465 kWh/m <sup>2</sup> /year		

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

<b>Estimated energy costs for your home for 3 years*</b>	<b>£2,757</b>	See your recommendations report for more information
<b>Over 3 years you could save*</b>	<b>£1,218</b>	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

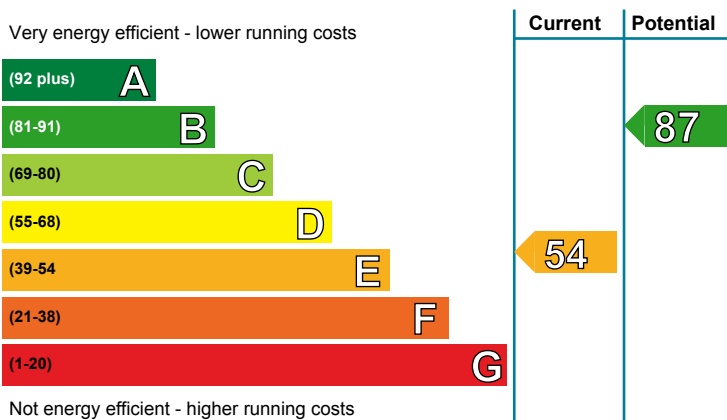


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (54)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

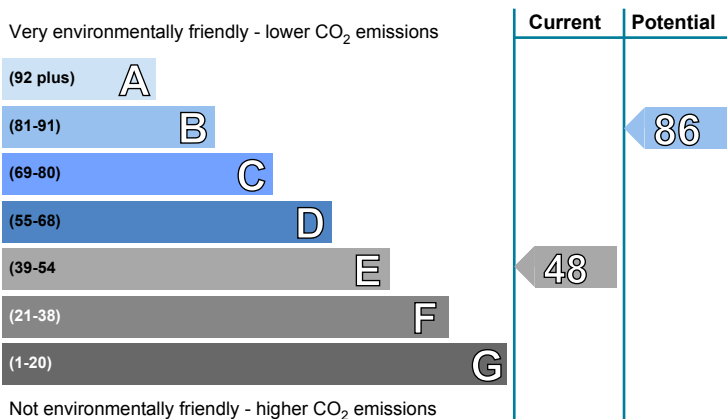

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (48)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£675.00
2 Floor insulation (suspended floor)	£800 - £1,200	£183.00
3 Floor insulation (solid floor)	£4,000 - £6,000	£93.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whinstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 150 mm loft insulation	★★★★☆	★★★★☆
	Pitched, insulated at rafters	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed)	—	—
	Solid, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in all fixed outlets	★★★★★	★★★★★

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 82 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.4 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 3.1 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.















## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,358 over 3 years	£1,287 over 3 years	
Hot water	£273 over 3 years	£126 over 3 years	
Lighting	£126 over 3 years	£126 over 3 years	
<b>Totals</b>	<b>£2,757</b>	<b>£1,539</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal or external wall insulation	£4,000 - £14,000	£225		
2 Floor insulation (suspended floor)	£800 - £1,200	£61		
3 Floor insulation (solid floor)	£4,000 - £6,000	£31		
4 Replace boiler with new condensing boiler	£2,200 - £3,000	£50		
5 Flue gas heat recovery device in conjunction with boiler	£400 - £900	£20		
6 Solar water heating	£4,000 - £6,000	£19		
7 Solar photovoltaic panels, 2.5 kWp	£5,000 - £8,000	£287		

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Micro CHP

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

### 2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 3 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

### 4 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

### 5 Flue gas heat recovery

A flue gas heat recovery system extracts heat from the boiler flue gases and transfers it to the incoming cold water so that the boiler needs to supply less heat. It is suitable for use only with modern condensing gas boiler and should be fitted when a replacement boiler is installed. You should seek advice from a qualified heating engineer.

### 6 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).



## 7 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to [www.energysavingtrust.org.uk/scotland/rhi](http://www.energysavingtrust.org.uk/scotland/rhi).

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	13,643	(407)	N/A	(4,609)
Water heating (kWh per year)	1,758			

## Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Iain Ross
Assessor membership number:	EES/009392
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	48 Marischal Street Peterhead AB42 1HS
Phone number:	01779470220
Email address:	<a href="mailto:steven.dale@dmhall.co.uk">steven.dale@dmhall.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greenerScotland.org](http://greenerScotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT





# SINGLE SURVEY



**DM HALL**  
CHARTERED SURVEYORS



# Single Survey

survey report on:

<b>Property address</b>	33A MAIN STREET CAIRNBULG FRASERBURGH AB43 8YJ
<b>Customer</b>	Mr Johnathon Jones
<b>Customer address</b>	c/o Macrae Stephen & Co 40 Broad Street Fraserburgh AB43 9AH
<b>Prepared by</b>	DM Hall
<b>Date of inspection</b>	11th March 2019



## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.



# Terms and Conditions

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report<sup>2</sup> will be from information contained in the Report and the generic Mortgage Valuation Report.

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

### **WARNING:**

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	The property is a detached bungalow.
<b>Accommodation</b>	Ground floor:-Entrance porch, hall, living room, dining kitchen and bathroom with WC and bedroom.
<b>Gross internal floor area (m<sup>2</sup>)</b>	Approximately 54 square metres.
<b>Neighbourhood and location</b>	The property is located in the coastal village of Cairnbulg. Locally amenities are somewhat limited however a wide range of facilities are available nearby in Fraserburgh.  The property is similar to others in the area.
<b>Age</b>	The original property is in excess of 119 years old with subsequent additions.
<b>Weather</b>	Clear and dry following mixed weather.
<b>Chimney stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b>  There are two chimney stacks of rendered stone construction. The bases are sealed with cement fillet pointing. The chimneys have clay chimney pots.
<b>Roofing including roof space</b>	<b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b>  <b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b>  <b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b>

# Single Survey

	<p>The roof is constructed of pitched timber trusses overlaid with timber sarking and slates. The ridge is finished with clay ridge tiles. The roof incorporates cement skew pointing.</p> <p>Access to the roof space was possible from a hatch in the kitchen and a hatch in the bedroom. Insulation to varying depths has been laid between ceiling joists / rafters in those parts of the roof space to which I had access.</p> <p>It was not possible to access the roof space above the sun porch.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>The rainwater conductors are formed in PVC.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The external walls of the original property are 620mm solid stone externally rendered and internally strapped and lined. There is limited provision for sub floor ventilation.</p> <p>The sun porch and kitchen / bathroom extension have walls which are assumed to be rendered concrete block or brick work. Also internally strapped and lined.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>The windows are timber casement and double glazed.</p> <p>The external doors are solid timber.</p> <p>There is a timber fascia on the rear projection.</p>
<b>External decorations</b>	<p><b>Visually inspected.</b></p> <p>External joinery is paint finished.</p>
<b>Conservatories / porches</b>	<p><b>Visually inspected.</b></p> <p>A sun porch has been added to the front elevation. The sun porch has rendered concrete block / brick walls under a pitch slate roof. The sun porch is double glazed.</p>

# Single Survey

<b>Communal areas</b>	<b>Circulation areas visually inspected.</b>  There appears to be shared access with adjoining properties.
<b>Garages and permanent outbuildings</b>	<b>Visually inspected.</b>  There is no garage. There is a concrete block / corrugated asbestos store attached to the property.  A short distance away, on the beach, there is an additional area of ground which is presently undefined. There is a timber shed located on this separate area.
<b>Outside areas and boundaries</b>	<b>Visually inspected.</b>  There is garden ground to the rear of the property. The boundaries are defined by concrete block walls. The footpaths are surfaced with stones / concrete flag stones. As stated above there is a small area of ground a short distance away and on the beach. This area is undefined at present.
<b>Ceilings</b>	<b>Visually inspected from floor level.</b>  The ceilings are partly plasterboard and partly plaster on lath.
<b>Internal walls</b>	<b>Visually inspected from floor level.</b>  <b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b>  The internal walls are partly plaster on lath and partly timber stud lined with plasterboard. The walls in the kitchen and bathroom are partly lined. There is a timber dado lining in the dining area.
<b>Floors including sub floors</b>	<b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b>  <b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b>  <b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b>  The floors in the original property are suspended timber joists overlaid with floorboards. At the time of my inspection all floors were covered and it was not possible to access sub floor areas.  The floors in the kitchen / bathroom and sun porch extension are solid concrete.



<p><b>Internal joinery and kitchen fittings</b></p>	<p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>The kitchen is fitted with a range of modern floor and wall mounted units incorporating a stainless steel sink unit.</p> <p>The internal doors are solid timber and timber / glazed types.</p> <p>The skirting boards and door frames are timber.</p> <p>There are timber tread and riser steps between the kitchen and dining area.</p>
<p><b>Chimney breasts and fireplaces</b></p>	<p><b>Visually inspected.</b></p> <p><b>No testing of the flues or fittings was carried out.</b></p> <p>The chimney breasts are plasterboard / plaster and lath lined. The fireplaces have been boarded over.</p>
<p><b>Internal decorations</b></p>	<p><b>Visually inspected.</b></p> <p>The majority of wall surfaces are paint finished.</p>
<p><b>Cellars</b></p>	<p>There are no cellars.</p>
<p><b>Electricity</b></p>	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>The property is connected to the mains electricity supply. The meter is located in an external box on the front elevation. The consumer units are located in a cabinet in the hall. The visible wiring is PVC coated cabling with 13 amp power outlets.</p>
<p><b>Gas</b></p>	<p><b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>The property is connected to the mains gas supply. The meter is located in an external box attached to the attached store.</p>


# Single Survey

<b>Water, plumbing, bathroom fittings</b>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>The property is connected to the mains water supply. The visible plumbing is formed in copper and PVC.</p> <p>The sanitary fittings comprise a white three piece suite with electric shower above the bath.</p>
<b>Heating and hot water</b>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>The property is centrally heated by a wall mounted gas fire Worcester Junior 28i combination boiler connected to steel panelled radiators equipped with thermostatic radiator valves. Hot water is provided from the central heating boiler which is located within the roof space above the kitchen / bathroom.</p>
<b>Drainage</b>	<p><b>Drainage covers etc. were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>The property is connected to the mains drainage system.</p>
<b>Fire, smoke and burglar alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Smoke alarms have been fitted in the hall and dining area.</p>
<b>Any additional limits to inspection</b>	<p><b>For flats / maisonettes</b></p> <p><b>Only the subject flat and internal communal areas giving access to the flat were inspected.</b></p> <p><b>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</b></p> <p><b>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</b></p> <p>At the time of my inspection the property was unoccupied but was furnished and all floors covered. The inspection of the roof space was limited by partial flooring and insulating materials.</p> <p>I have not disturbed insulation in accordance with Health and</p>

# Single Survey

	<p>Safety Guidelines and floor coverings have not been lifted.</p> <p>It was not possible to access sub floor areas.</p> <p>An inspection for Japanese Knotweed has not been carried out, and unless otherwise stated, it is assumed that there is no Japanese Knotweed present within the boundaries of the property, or within neighbouring properties.</p>
--	---

## Sectional Diagram showing elements of a typical house

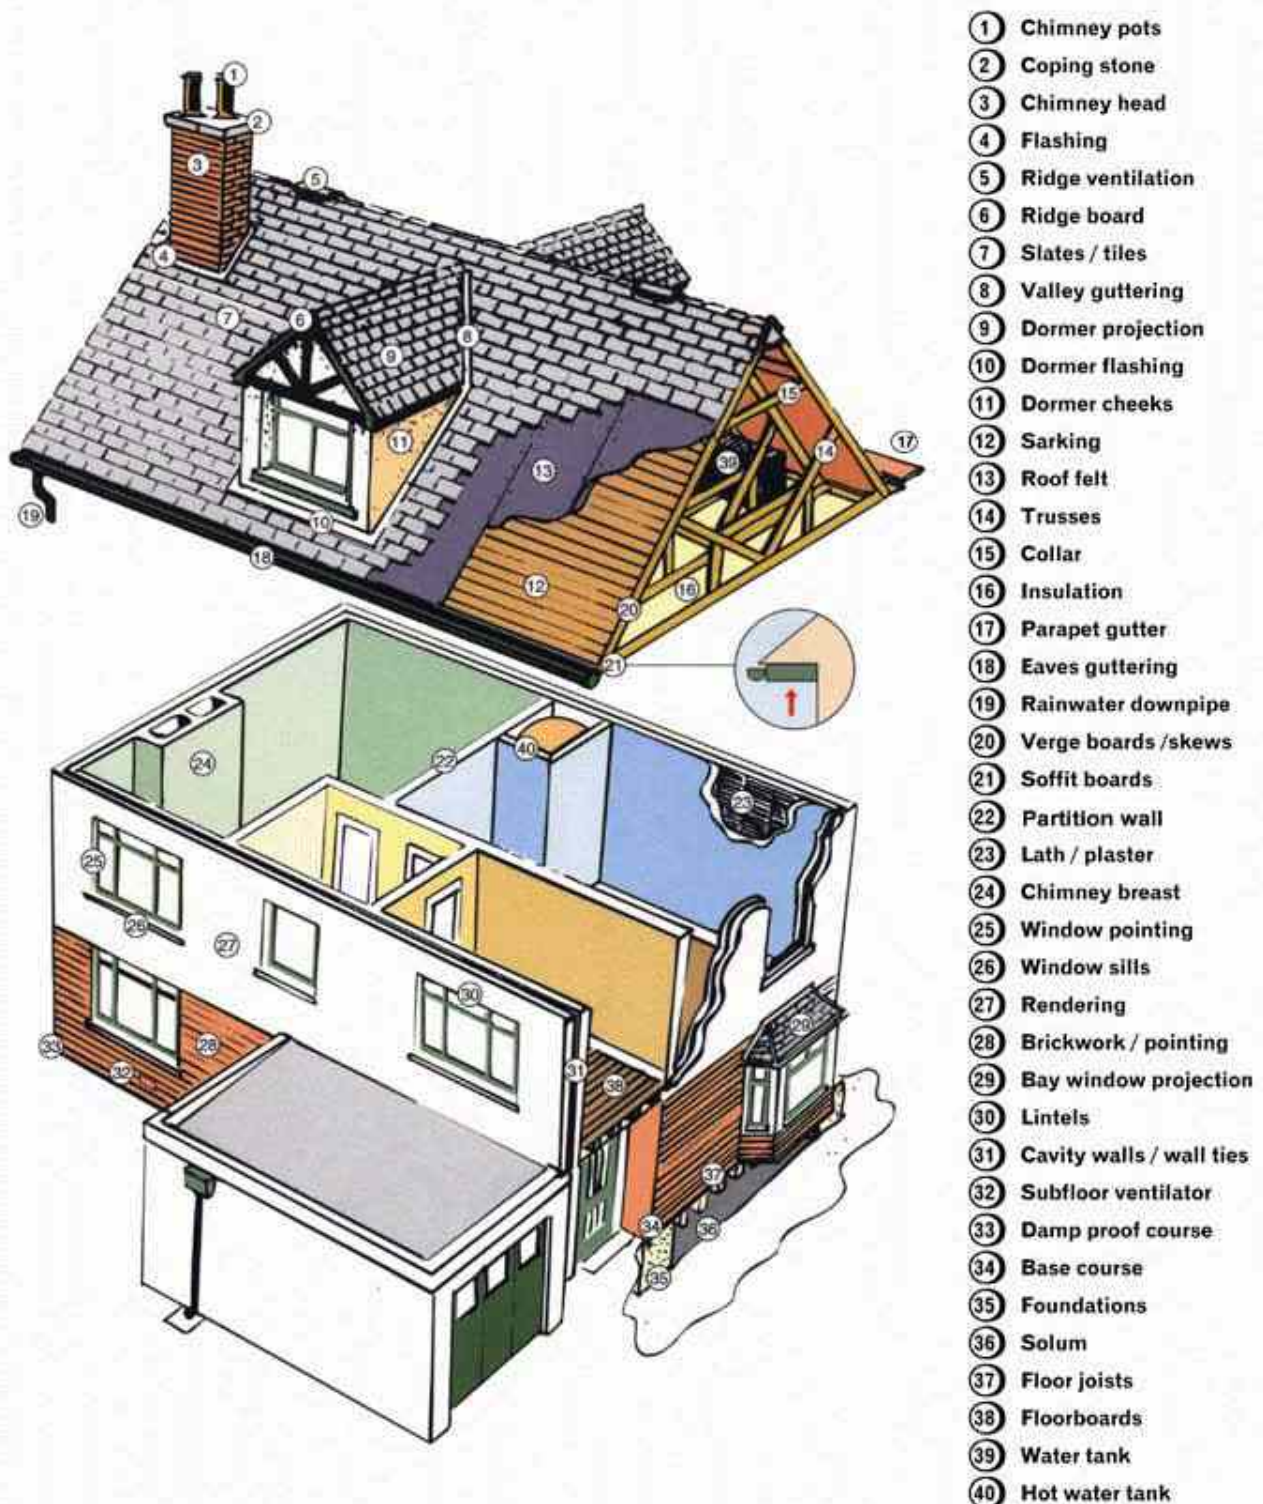


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


# Single Survey


## 2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	There is evidence of previous movement indicated by hairline cracking to rendering, This is longstanding with no evidence of recent or continuing movement and will not affect future marketability.

 Dampness, rot and infestation	
Repair category	2
Notes	Woodworm was noted to timbers within the roof space. At the time of inspection no evidence of activity was noted.  Elevated damp meter readings were noted to floors / wall linings. The seller has conducted some remedial works, removing rubble from a section of wall cavity and finishing with plasterboard. Timbers in contact with dampness are at risk from rot. The eradication of rot and insect infestation will require a specialist repair / treatment under long term guarantee.  A timber and damp proofing specialist can provide further advice following a comprehensive inspection.

 Chimney stacks	
Repair category	1
Notes	A roofing contractor can confirm that any redundant chimneys have been properly capped and vented to prevent the build up of moisture in the flue linings.

 Roofing including roof space	
Repair category	2
Notes	The roof is original and of relatively complex design. The seller has advised that recent skew repairs have taken place. Having regard to the age, condition and complexity an ongoing liability for future maintenance and repair can be

# Single Survey

	anticipated.
--	--------------



## Rainwater fittings

<b>Repair category</b>	1
<b>Notes</b>	The rain water conductors could be examined during a period of heavy rain and be realigned / repaired if necessary.



## Main walls

<b>Repair category</b>	1
<b>Notes</b>	There are small areas of bossed (hollow) rendering which, with time, may require repair. A general builder can provide further advice.



## Windows, external doors and joinery

<b>Repair category</b>	1
<b>Notes</b>	No reportable defects.



## External decorations

<b>Repair category</b>	1
<b>Notes</b>	No reportable defects. Regular re-painting of external joinery, will prolong its lifespan and retain a maintained appearance.



## Conservatories/porches

<b>Repair category</b>	1
<b>Notes</b>	No reportable defects.



## Communal areas

<b>Repair category</b>	1
<b>Notes</b>	No reportable defects.



## Garages and permanent outbuildings

<b>Repair category</b>	1
<b>Notes</b>	<p>The attached store has a corrugated asbestos roof which is a hazardous material. If this roof is to be altered or removed specialist advice and handling will be required which may prove expensive. A specialist contractor can provide further advice.</p> <p>Timber sheds require regular maintenance.</p>



## Outside areas and boundaries

<b>Repair category</b>	1
<b>Notes</b>	No reportable defects.



## Ceilings

<b>Repair category</b>	1
<b>Notes</b>	The ceilings are affected by a degree of shrinkage cracking which is not considered serious. Cosmetic repairs can be carried out when the property is next re-decorated.



## Internal walls

<b>Repair category</b>	1
<b>Notes</b>	Similar to ceilings, a degree of shrinkage cracking has occurred, and the same comments apply.



## Floors including sub-floors

<b>Repair category</b>	1
<b>Notes</b>	<p>The flooring is found to be level and firm under foot.</p> <p>See comments under 'Damp rot and infestation' above.</p>



## Internal joinery and kitchen fittings

<b>Repair category</b>	1
<b>Notes</b>	<p>Internal joinery has been subjected to wear and tear commensurate with age.</p> <p>Some internal doors are glazed and safety glass has not been utilised which should be rectified in the interest of safety.</p>



# Single Survey



## Chimney breasts and fireplaces

<b>Repair category</b>	1
<b>Notes</b>	No visual defects identified.  See comments under 'Chimney Stacks' above regarding having redundant chimneys capped.



## Internal decorations

<b>Repair category</b>	1
<b>Notes</b>	Internal decoration is presently reasonable.



## Cellars

<b>Repair category</b>	-
<b>Notes</b>	N/A



## Electricity

<b>Repair category</b>	1
<b>Notes</b>	The wiring was inspected on 14 July 2018 by a qualified electrician and was deemed to be satisfactory.  The Institute of Electrical Engineers recommends that inspections and testings are undertaken at least every ten years and on change of occupancy. It should be appreciated that only the most recently constructed or rewired properties will have installations which comply with current IEE regulations.



## Gas

<b>Repair category</b>	1
<b>Notes</b>	The gas meter and associated pipe work, where visible, is modern.



## Water, plumbing and bathroom fittings

<b>Repair category</b>	2
<b>Notes</b>	The sanitary fitments, whilst serviceable, show evidence of wear and tear and it is likely an incoming purchaser will wish to have them replaced.  The sealant / grouting about the sanitary fitments and plumbing in the vicinity of the kitchen should be examined regularly together with adjacent floor and walls, as such areas are prone to damage by hidden leakage.



# Single Survey



## Heating and hot water

<b>Repair category</b>	1
<b>Notes</b>	<p>It is good practice to have the central heating system serviced immediately upon taking entry. Annual servicing is recommended to ensure to ensure safe and efficient operation.</p> <p>I have assumed all gas appliances were installed in compliance with regulations in force at the time of installation.</p>



## Drainage

<b>Repair category</b>	1
<b>Notes</b>	There is no obvious surface evidence of choking or leakage.

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	1
Communal areas	1
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

# Single Survey

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor.
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

I have assumed that the property will be sold with a vacant possession and that the tenure is absolute ownership.

The property has been extended however this was done a number of years ago and it is likely that these alterations pre date the period for which Local Authorities now hold records.

It would appear that the property has accesses shared with adjacent properties. I have assumed adequate rights of access are available.

### Estimated reinstatement cost for insurance purposes

£200,000 (TWO HUNDRED THOUSAND POUNDS).

### Valuation and market comments

Market value with vacant possession:- £80,000 (EIGHTY THOUSAND POUNDS).

There has been a downturn in the local property market due to regional economic factors however transactions are still taking place.

<b>Signed</b>	Security Print Code [463212 = 6690 ] Electronically signed
<b>Report author</b>	Iain C Ross
<b>Company name</b>	DM Hall
<b>Address</b>	48 Marischal Street, Peterhead, Aberdeenshire, AB42 1HS
<b>Date of report</b>	28th May 2019

# Mortgage Valuation Report



## Property Address

Address 33A MAIN STREET, CAIRNBULG, FRASERBURGH, AB43 8YJ  
Seller's Name Mr Johnathon Jones  
Date of Inspection 11th March 2019

## Property Details

Property Type  House  Bungalow  Purpose built maisonette  Converted maisonette  
 Purpose built flat  Converted flat  Tenement flat  Flat over non-residential use  
 Other (specify in General Remarks)

Property Style  Detached  Semi detached  Mid terrace  End terrace  
 Back to back  High rise block  Low rise block  Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?  Yes  No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided?  Yes  No  
No. of units in block

Approximate Year of Construction

## Tenure

Absolute Ownership  Leasehold Ground rent £  Unexpired years

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%)  Yes  No

## Garage / Parking / Outbuildings

Single garage  Double garage  Parking space  No garage / garage space / parking space  
Available on site?  Yes  No

Permanent outbuildings:

Attached concrete block / corrugated asbestos store. Timber shed on ground outwith the feu.

# Mortgage Valuation Report

## Construction

Walls  Brick  Stone  Concrete  Timber frame  Other (specify in General Remarks)  
Roof  Tile  Slate  Asphalt  Felt  Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement?  Yes  No

If Yes, is this recent or progressive?  Yes  No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?  Yes  No

If Yes to any of the above, provide details in General Remarks.

## Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage  Mains  Private  None Water  Mains  Private  None  
Electricity  Mains  Private  None Gas  Mains  Private  None  
Central Heating  Yes  Partial  None

Brief description of Central Heating:

Full gas / radiator central heating.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way  Shared drives / access  Garage or other amenities on separate site  Shared service connections  
 Ill-defined boundaries  Agricultural land included with property  Other (specify in General Remarks)

## Location

Residential suburb  Residential within town / city  Mixed residential / commercial  Mainly commercial  
 Commuter village  Remote village  Isolated rural property  Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered?  Yes  No

If Yes provide details in General Remarks.

## Roads

Made up road  Unmade road  Partly completed new road  Pedestrian access only  Adopted  Unadopted

# Mortgage Valuation Report

## General Remarks

The property is found to be in a serviceable condition both internally and externally consistent with age and type. Any defects noted are capable of remedy by routine maintenance.

High damp meter readings were noted to floors / lower wall linings and it is possible hidden timbers are affected by rot. Instruct a competent firm of timber and damp proofing specialists to carry out a thorough examination of the property and carry out any required remedial works and treatments under guarantee.

Evidence of previous movement was noted in the form of hairline cracking to rendering. This appears longstanding with no evidence of recent or continuing movement and will not affect future marketability. The slate roof is original and may give rise to a periodic liability for repair.

On the date of inspection the property was unoccupied, and all floors covered. Inspection of the roof space was restricted by insulation materials and partial flooring.

There is a small plot of ground with a timber shed a short distance away from the property.

There appear to be shared access with adjacent properties. We have assumed that adequate rights of access are available.

The property is located in the coastal village of Cairnbulg. Locally amenities are somewhat limited however a wide range of facilities are available nearby in Fraserburgh.

The property is similar to others in the area.

## Essential Repairs

None apparent.

Estimated cost of essential repairs £  Retention recommended?  Yes  No Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

The property is considered suitable security for normal loan purposes subject to the lending criteria of the individual lender.

## Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £   
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary?  Yes  No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type?  Yes  No

## Declaration

Signed Security Print Code [463212 = 6690 ]  
Electronically signed by:-

Surveyor's name Iain C Ross

Professional qualifications BSc BLE MRICS

Company name DM Hall

Address 48 Marischal Street, Peterhead, Aberdeenshire, AB42 1HS

Telephone 01779 470 220

Fax 01779 472 022

Report date 28th May 2019



# PROPERTY QUESTIONNAIRE



**DM HALL**  
CHARTERED SURVEYORS



# Property Questionnaire

<b>Property address</b>	33A, MAIN STREET, CAIRNBULG, FRASERBURGH, AB43 8YJ
<b>Seller(s)</b>	Jonathan jones
<b>Completion date of property questionnaire</b>	08/03/2019

# Property Questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

1.	<b>Length of ownership</b>	
	How long have you owned the property?	Approximately 3 years
2.	<b>Council tax</b>	
	Which Council Tax band is your property in? (Please circle)	
	A B C D E F G H	
3.	<b>Parking</b>	
	What are the arrangements for parking at your property? (Please tick all that apply)	
	<ul style="list-style-type: none"><li>• Garage <input type="checkbox"/></li><li>• Allocated parking space <input type="checkbox"/></li><li>• Driveway <input type="checkbox"/></li><li>• Shared parking <input type="checkbox"/></li><li>• On street <input checked="" type="checkbox"/></li><li>• Resident permit <input type="checkbox"/></li><li>• Metered parking <input type="checkbox"/></li><li>• Other (please specify): <input type="text"/></li></ul>	
4.	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes / No / Don't know

# Property Questionnaire

<b>5. Listed buildings</b>		
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	<b>Yes / No</b>
<b>6. Alterations/additions/extensions</b>		
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  If you have answered <u>yes</u> , please describe below the changes which you have made:	<b>Yes / No</b>
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?  If you have answered <u>yes</u> , the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.  If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	<b>Yes / No</b>
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?  If you have answered <u>yes</u> , please answer the three questions below:	<b>Yes / No</b>
	(i) Were the replacements the same shape and type as the ones you replaced?	<b>Yes / No</b>
	(ii) Did this work involve any changes to the window or door openings?	<b>Yes / No</b>
	(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed):  Please give any guarantees which you received for this work to your solicitor or estate agent.	

# Property Questionnaire

<b>7. Central heating</b>		
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</p> <p>If you have answered <u>yes / partial</u> - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p>GAS</p> <p>If you have answered <u>yes</u>, please answer the three questions below:</p>	Yes / <del>No</del> / <del>Partial</del>
b.	When was your central heating system or partial central heating system installed?	Don't know. It was in place when I purchased the prope
c.	<p>Do you have a maintenance contract for the central heating system?</p> <p>If you have answered <u>yes</u>, please give details of the company with which you have a maintenance contract:</p>	<del>Yes</del> / No
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
<b>8. Energy Performance Certificate</b>		
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / <del>No</del>
<b>9. Issues that may have affected your property</b>		
a.	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p>If you have answered <u>yes</u>, is the damage the subject of any outstanding insurance claim?</p>	<p><del>Yes</del> / No</p> <p><del>Yes</del> / <del>No</del></p>
b.	<p>Are you aware of the existence of asbestos in your property?</p> <p>If you have answered <u>yes</u>, please give details:</p> <p>Corrugated cement roof to external lean-to storage shed.</p>	Yes / <del>No</del>

# Property Questionnaire

10.	Services																									
a.	<p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="1" data-bbox="309 383 1374 1077"> <thead> <tr> <th data-bbox="309 383 651 443">Services</th> <th data-bbox="651 383 879 443">Connected</th> <th data-bbox="879 383 1374 443">Supplier</th> </tr> </thead> <tbody> <tr> <td data-bbox="309 443 651 533">Gas / liquid petroleum gas</td> <td data-bbox="651 443 879 533">✓</td> <td data-bbox="879 443 1374 533">SSE</td> </tr> <tr> <td data-bbox="309 533 651 622">Water mains / private water supply</td> <td data-bbox="651 533 879 622">✓</td> <td data-bbox="879 533 1374 622">SCOTTISH WATER</td> </tr> <tr> <td data-bbox="309 622 651 712">Electricity</td> <td data-bbox="651 622 879 712">✓</td> <td data-bbox="879 622 1374 712">SSE</td> </tr> <tr> <td data-bbox="309 712 651 801">Mains drainage</td> <td data-bbox="651 712 879 801">✓</td> <td data-bbox="879 712 1374 801">SCOTTISH WATER</td> </tr> <tr> <td data-bbox="309 801 651 891">Telephone</td> <td data-bbox="651 801 879 891">✓</td> <td data-bbox="879 801 1374 891">BT</td> </tr> <tr> <td data-bbox="309 891 651 981">Cable TV / satellite</td> <td data-bbox="651 891 879 981">—</td> <td data-bbox="879 891 1374 981"></td> </tr> <tr> <td data-bbox="309 981 651 1077">Broadband</td> <td data-bbox="651 981 879 1077">✓</td> <td data-bbox="879 981 1374 1077">CURRENTLY NO SUPPLIER</td> </tr> </tbody> </table>		Services	Connected	Supplier	Gas / liquid petroleum gas	✓	SSE	Water mains / private water supply	✓	SCOTTISH WATER	Electricity	✓	SSE	Mains drainage	✓	SCOTTISH WATER	Telephone	✓	BT	Cable TV / satellite	—		Broadband	✓	CURRENTLY NO SUPPLIER
Services	Connected	Supplier																								
Gas / liquid petroleum gas	✓	SSE																								
Water mains / private water supply	✓	SCOTTISH WATER																								
Electricity	✓	SSE																								
Mains drainage	✓	SCOTTISH WATER																								
Telephone	✓	BT																								
Cable TV / satellite	—																									
Broadband	✓	CURRENTLY NO SUPPLIER																								
b.	<p>Is there a septic tank system at your property?            If you have answered yes, please answer the two questions below:</p>	<p><del>Yes / No</del></p>																								
c.	<p>(i) Do you have appropriate consents for the discharge from your septic tank?</p>	<p><del>Yes / No / Don't know</del></p>																								
d.	<p>(ii) Do you have a maintenance contract for your septic tank?            If you have answered yes, please give details of the company with which you have a maintenance contract:</p>	<p><del>Yes / No</del></p>																								

# Property Questionnaire

<b>11.</b>	<b>Responsibilities for Shared or Common Areas</b>	
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes / No / Don't Know</del>
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes / No / Not applicable</del>
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	<del>Yes / No</del>
d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes / No</del>
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes / No</del>
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes / No</del>
<b>12.</b>	<b>Charges associated with your property</b>	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>	<del>Yes / No</del>



# Property Questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p><del>Yes / No / Don't Know</del></p> <p><del>Yes / No / Don't Know</del></p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
<p><b>13. Specialist works</b></p>		
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p>	<p><del>Yes / No</del></p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details:</p>	<p><del>Yes / No</del></p>
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<p><del>Yes / No</del></p>

# Property Questionnaire

<b>14.</b>	<b>Guarantees</b>						
<b>a.</b>	<b>Are there any guarantees or warranties for any of the following:</b>						
<b>(i)</b>	<b>Electrical work</b>	<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>	<b>Cannot Answer*</b>
<b>(ii)</b>	<b>Roofing</b>	<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>	<b>Cannot Answer*</b>
<b>(iii)</b>	<b>Central heating</b>	<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>	<b>Cannot Answer*</b>
<b>(iv)</b>	<b>NHBC</b>	<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>	<b>Cannot Answer*</b>
<b>(v)</b>	<b>Damp course</b>	<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>	<b>Cannot Answer*</b>
<b>(vi)</b>	<b>Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)</b>	<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>	<b>Cannot Answer*</b>
<b>b.</b>	<b>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</b>						
<b>c.</b>	<b>Are there any outstanding claims under any of the guarantees listed above?</b> <b>If you have answered yes, please give details:</b>					<b>Yes / No</b>	
<b>15.</b>	<b>Boundaries</b>						
	<b>So far as you are aware, has any boundary of your property been moved in the last 10 years?</b> <b>If you have answered yes, please give details:</b>					<b>Yes / No / Don't know</b>	

# Property Questionnaire

<b>16.</b>	<b>Notices that affect your property</b>	
	<b>In the past 3 years have you ever received a notice:</b>	
<b>a.</b>	<b>advising that the owner of a neighbouring property has made a planning application?</b>	<b>Yes / No / Don't know</b>
<b>b.</b>	<b>that affects your property in some other way?</b>	<b>Yes / No / Don't know</b>
<b>c.</b>	<b>that requires you to do any maintenance, repairs or improvements to your property?</b>	<b>Yes / No / Don't know</b>
	<b>If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</b>	

**Declaration by the seller(s)/or other authorised body or person(s)**

**I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

**Signature(s):** \_\_\_\_\_

\_\_\_\_\_

**Date:** \_\_\_\_\_

\_\_\_\_\_





# DM Hall Offices

Aberdeen

01224 594172

Ayr

01292 286974

Cumbernauld

01236 618900

Cupar

01334 844826

Dumfries

01387 254318

Dundee

01382 873100

Dunfermline

01383 621262

Edinburgh

0131 477 6000

Elgin

01343 548501

Falkirk

01324 628321

Galashiels

01896 752009

Glasgow (North)

0141 332 8615

Glasgow (South)

0141 636 4141

Hamilton

01698 284939

Inverness

01463 241077

Inverurie

01467 624393

Irvine

01294 311070

Kirkcaldy

01592 598200

Livingston

01506 490404

Musselburgh

0131 665 6782

Oban

01631 564225

Paisley

0141 887 7700

Perth

01738 562100

Peterhead

01779 470220

Stirling

01786 475785

[DMHALL.CO.UK](http://DMHALL.CO.UK)

