



TIRE PRESSURE MONITORING SYSTEMS

Sensor & Service Pack Application Catalog

**OE
REPLACEMENT**



EZ-sensor[®]



**SERVICE
PACKS**



Table of Contents

TPMS Tools and Accessories	A - G
OEM Interchanges	H - K
TPMS Sensors / Transmitters & Service Packs - Alphabetical Listing.....	1 - 174
TPMS Sensors / Transmitters - Numerical Listing	175 - 203
TPMS Service Packs - Numerical Listing	104 - 230
NHTSA TREAD Act.....	Inside Back Cover

Schrader International, Inc.

Limited Warranty

Schrader Bridgeport International, Inc. ("Schrader") warrants that its products will be free from defects in materials and workmanship for a period of twelve (12) months from the date of shipment from Schrader's facility or delivery (whichever occurs first). Schrader will, at its option, replace or repair any product proved defective in materials or workmanship, or both, during the warranty period. This shall be the sole and exclusive remedy for breach of warranty. THE FOREGOING WARRANTY IS EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES EXCEPT THAT OF TITLE, WHETHER WRITTEN, ORAL OR IMPLIED, IN FACT OR IN LAW (INCLUDING ANY WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE). LIABILITY FOR SPECIAL, INDIRECT, INCIDENTAL, PUNITIVE OR CONSEQUENTIAL DAMAGES (INCLUDING, WITHOUT LIMITATION, DAMAGES FOR LOSS OF PROFITS, BUSINESS INTERRUPTION OR ANY OTHER LOSS), HEREBY ARE EXPRESSLY EXCLUDED TO THE EXTENT PERMITTED BY LAW, WHETHER BASED IN CONTRACT, NEGLIGENCE, TORT, WARRANTY OR OTHER WRONGFUL ACT OR OMISSION OF SELLER AND EVEN IF SELLER HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.

This warranty does not extend to (a) any defects or losses due to misuse, accident, abuse, neglect, or normal wear and tear; (b) any use not recommended in writing by Schrader; (c) any defects or losses relating to or caused by purchaser or a third party; or (d) any defects or losses relating to or caused by the effects of weathering, air pollution, corrosion, or exposure to harmful/caustic materials and/or chemicals.

Additionally, Schrader can not endorse the use of non-OE validated parts. Schrader has not validated testing of the compatibility of products of any supplier other than Schrader for fit and suitability of use in conjunction with Schrader parts. Therefore, use of BOTH Schrader sensors, and Schrader service packs or replacement "snap-in" stems, are required for warranty protection.

Nut Torque Tool with Sockets – 20138

Torque wrench for valve nuts on TPMS installations. Kit includes 12mm and 11mm sockets for the two nut sizes used today, plus screwdriver handle for easy use. Torque range from 4.25 N.m. to 7.5 N.m. Accuracy plus or minus 4 percent. Includes plastic storage case. (One per box)



Nut Torque Wrench Kit – 20139

Torque tool and precision quality torque wrench for installing TPMS sensor nuts. Includes 12 mm and 11 mm sockets. Torque range from 2 N.m. to 10 N.m. Accuracy plus or minus 2 percent. Includes plastic storage tray. (One per box)



T-10 Torque Tool – 20140

Installs replacement snap-in valves to Schrader® OE sensors. T-10 Torx head installs screws to recommended torque for proper sealing and secure installation. Order individually. (One per box)



Valve Core Torque Tool – 20141

Tighten valve cores to OE specifications. Helps guard against over or under-torquing. Meets Tire and Rim Association (TRA) recommended torque values of 3" to 5" lbs. on TRC1 valve cores. Serves as both a core remover and installer. Order individually. (One per box)



Universal Nut Torque Tool - 20142

Serves as a torque wrench for valve nuts on TPMS installations. Kit includes 11mm and 12mm sockets and T-handle torque wrench with ergonomic design. Torque range from 30 to 90 in/lbs. (One per plastic storage case)



Replacement 11mm Socket - 21310

Order Individually

Replacement 12mm Socket - 21315

Order Individually

Grommet Removal Tool - 20144

This hand tool is designed to safely remove the rubber grommet from the aluminum stem of a TPMS sensor. Receiving hole can be used to install a new grommet. (10 per box)



T-20 Torque Tool - 20145

A pre-set torque tool specially designed for use with TPMS sensors that use a T-20 screw to attach the aluminum valve stem to the sensor body. The T-20 Torx head installs screws to recommended torque for proper sealing and secure installation.



21280CHG

The 21280CHG replaces the charger that comes standard with the Bartec Tech400Pro TPMS scan and relearn tool. It is an inductive pad charger that plugs into a standard electrical outlet. Simply place the tool on the pad to maintain a fully charged scan tool.



21285CHG

The 21285CHG replaces the charger that comes standard with the Bartec Tech300Pro TPMS scan and relearn tool. It plugs into a standard electrical outlet, and into the tool to maintain a fully charged scan tool.



Chrome Caps and Sleeves

Make your TPMS valve stems look as good as the rest of your ride with dress-up sleeves. Chrome finish dress up kits are available for rubber snap-in sensors. Each kit includes a fully plated sleeve and sealing cap to resist galvanic corrosion of TPMS sensors.

Chrome caps and sleeves for rubber snap-in sensor

22005 Order in multiples of 50.
Bulk Packaged (50 caps and 50 sleeves per carton)



Complete snap-in valve service pack with chrome caps and sleeves

22008 Individual bags. (50 bags per carton)
Each bag contains one sleeve, one cap and one TT valve. Order in multiples of 50.



BANDED TPMS REPLACEMENT PARTS

All of the components required to repair banded TPMS systems. These parts to be used with sensor part numbers 28385, 28390 and 28395.


Replacement Clip

22100 Order individually.
Bulk Packaged. (25 per box)



Replacement Cradle

22101 Order individually. (10 per carton)

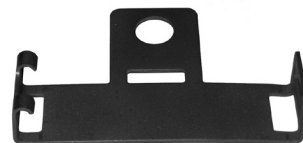

Universal band

Fits rims 14-26"
22102 Order individually. (One per bag)



ACCESSORY AND LOOSE PART ITEMS

20055 nickel-plated valve cores – 100/box _____



20395 plastic sealing valve caps – 100/box _____



20595 long black sealing valve caps for Schrader snap-in sensors

Fits EZ-sensors 33000, 33100 & 33200, replacement sensors 20153, 20398, 28203, 28206, 28308, 28362, 28434, 28461 & 28505, and Service Pack 20008 & 20018 valves – 100/box _____



20695 long green (Nitrogen) sealing valve caps for snap-in sensors – 100/box _____



20795 green (Nitrogen) sealing valve caps – 100/box _____



20895 replacement T-10 screw – 25/bag _____



20995 long black sealing valve caps for Ford snap-in sensors

Fits EZ-sensors 33000, 33100 & 33200, replacement sensor 20315 and Service Pack 20008 & 20018 valves – 100/box _____



TPMS RETROFIT KIT - SCHR4S

Schrader's OE quality TPMS solution for non-equipped vehicles

The NEW Schrader Retrofit Kit makes it quick and easy to add Schrader's OE quality TPMS to passenger vehicles that did not come equipped with TPMS from the manufacturer.

TPMS retrofit kits:

- Solar Powered & Wireless
- Convertible Units: F° / C°, PSI / BAR
- Real-Time Monitoring: Including Pressure by Location
- Audio and Visual Warnings
- Easy to Use

TPMS systems monitor proper tire pressure to maintain vehicle performance and support safety.

Properly inflated tires:

- Improve vehicle handling
- Reduce braking distances
- Lower the risk of hydroplaning
- Decrease tire wear
- Improve fuel efficiency



COMING SOON!

EZ-SENSOR TOOL COMPATIBILITY

CONTACT YOUR TOOL SUPPLIER FOR SOFTWARE UPGRADES



ATEQ VT-55	ATEQ VT-56	ATEQ VT-46**	BARTEC TECH200*	BARTEC TECH300SD	BARTEC TECH300PRO	BARTEC TECH400+	BARTEC TECH400SD	BARTEC TECH400PRO	BARTEC TECH500
------------	------------	--------------	-----------------	------------------	-------------------	-----------------	------------------	-------------------	----------------



BARTEC TPMS PAD	MAC ET 3824	MATCO TPR 3834	NAPA 92-1525*	OTC 3834	SCHRADER 21230*	SCHRADER EZ-PROGRAMMER*	SHRADER EZ-SENSOR PAD	SNAP-ON TPMS2	SNAP-ON TPMS3
-----------------	-------------	----------------	---------------	----------	-----------------	-------------------------	-----------------------	---------------	---------------

*Software not supported after 2018

** Comes in many private labels

EZ-sensor[®] PAD



- **Quick and simple** programming tool for TPMS.
- **LIVE vehicle coverage updates** are available immediately after release. No tool update required.
- **Both mobile and desktop friendly**, compatible with iOS, Android and Windows.
- **Long battery life**, 8 hours or up to 120 sensors.



Single SKU Programmable EZ-sensor® - 33500

- OE quality
- Combines 314.9, 315 and 433 MHz
- Programmable, inventory-saving solution
- Aluminum clamp-in and rubber snap-in stem options
- Future-proofed to include new and pending OE technology

Fits service kits: 20018 & 34000



High Speed Programmable EZ-sensor® - 33700

- OE quality
- Combines 314.9, 315 and 433 MHz
- Programmable, inventory-saving solution
- Adjustable clamp-in stem
- Future-proofed to include new and pending OE technology
- OE validated to 200 MPH
- 115 PSI



EZ-sensor® 90° - 33900

- OE quality
- Combines 314.9, 315 and 433 MHz
- Programmable, inventory-saving solution
- Future-proofed to include new and pending OE technology
- Straight and bent clamp-in stem options
- Stems also available in silver or black



Aluminum Clamp-In Style Valve - 34000

Aluminum stem service pack to rebuild the Schrader rubber valve snap-in sensor with an aluminum clamp-in style valve stem to match or upgrade existing look.

Fits Schrader OE replacement sensor part numbers: 29015, 28004

Fits Schrader EZ-sensor® part numbers: 33000, 33100, 33200, 33500



Rubber Snap-In Valve - 20018

Fits Schrader OE replacement sensor part numbers:

20153, 20154,, 20280, 20283, 20315, 20398, 20602, 28167, 28203, 28206, 28239, 28304, 28308, 28362, 28434, 28461, 28505, 29015,

Fits Schrader EZ-sensor® part numbers: 33000, 33100, 33200, 33500




Adjustable Clamp-In Valve - 20047

Fits Schrader OE replacement sensor part numbers:

20153, 20154,, 20280, 20283, 20315, 20398, 20602, 28167, 28203, 28206, 28239, 28304, 28308, 28362, 28434, 28461, 28505, 29015,

Fits Schrader EZ-sensor® part numbers: 33000, 33100, 33200, 33500

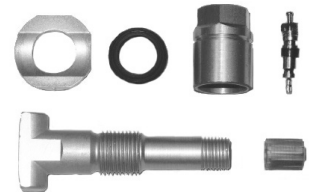

Service Pack Assortments

Schrader® offers two Service Pack Assortments that contain the most popular vehicle-specific service packs in a handy plastic box.

20798 assortment with 12 each of twelve service packs.

20898 assortment contains 12 each of the same service packs as 20798 but also contains 6 EZ-sensors®

20798 & 20898 CONTENTS:	QTY.
20004	12
20007	12
20009	12
20013	12
20014	12
20018	12
20020	12
20023	12
20030	12
20032	12
20036	12
20049	12



20798

20898 ALSO CONTAINS:	QTY.
EZ-sensor® 33500	6



20898

CAUTION: Always use new grommets, nuts, valve caps and valve cores when performing any tire service. Use nickel-plated electroless valve cores with aluminum valve stems and use rubber snap-in replacement stems when servicing snap-in sensors. Refer to manufacturer's specifications for proper torque requirements when replacing nuts and valve cores.

OEM INTERCHANGE

OEM Part No.	Schrader No.	OEM Part No.	Schrader No.
185189	20077	22853741	20153
224549	20077	22854866	28206
224551	20084	22959744	28206
282189	20103	23445327	20153
4815132	28004	24437708	28078
8223406	20079	25406817	20094
9054100	28214	25406917	20095
9057200	28214	25407917	20094
10394110	20158	25408017	20095
10438853	28006	25408617	28214
12768826	28206	25409017	28214
12825085	20159	25758220	20076
13172567	28078	25773946	20117
13227143	20159	25774006	20116
13516165	29015	25799331	20153
13581558	20153	25920615	20153
13581558	20283	31200923	20156
13581558	28206	31200923	28362
13581559	20228	31662304	28304
13581559	28206	35400217	28214
13581560	20223	42508875	28129
13586335	20153	45421518	28214
13598771	20153	86517000	20156
13598771	29015	88974915	28360
13598772	20283	307489910	20156
13598772	28206	312009230	20156
13598773	20154	312802970	20097
13598773	29015	313020960	20097
13598775	20223	670002790	20284
13598786	28423	4260702010	28365
13598787	28211	4260704010	28380
15114379	20107	4260733022	28370
15122618	20131	8257740060	20116
15136883	20115	8973271890	20028
15254101	20153	36106790054	28081
15268606	20158	36106790054	28126
15825475	20158	36106798872	28126
15921013	20158	36106798872	28081
15922396	20153	36106798872	28126
20922900	28206	36106856227	28081
20923680	20153	36106856227	28126
20925924	20158	36106856227	28081
20964159	28423	36106856872	28081

OEM INTERCHANGE

OEM Part No.	Schrader No.	OEM Part No.	Schrader No.
36106856872	28126	40700-JA01C	28204
36106874830	28126	40700-JA02B	28204
36118378682	20079	40700-JK00B	28210
36118378682	20080	4250A030	28129
36118378682	28081	4250A225	28096
36146752128	28082	4250B668	28096
36236781847	20083	4250B875	28129
36236781847	28081	4250B877	20034
36236798726	20083	4250B8975	28096
95536105300	20077	4250B975	28096
95836166100	20103	42607-06011	28360
99760602101	20077	42607-06020	28360
99760602120	28087	42607-06020 (Lo Line)	28360
000 905 00 30	20213	42607-08010	28670
002 540 6817	20094	42607-0C010	28300
05154876AB	20284	42607-0C020	28305
06421-S3V-A02	28981	42607-0C030	28670
06421-S3V-A03	28981	42607-0C040	28380
06421-S3V-A04	28981	42607-0C050	28670
06421-S9V-A01	28982	42607-0C060	28380
06421-S9V-A03	28982	42607-0E011	28370
1K0907253D	20088	42607-24010	28310
28103-AG00A	20081	42607-24020	28315
28103-AG01A	28203	42607-24030	28320
28103-AG01B	28203	42607-24040	28325
28103-AG01C	28203	42607-30030	28335
28103-AJ00A	28203	42607-30060	28370
28103-FL00A	20602	42607-30600	28370
28103-SA001	28203	42607-33011	28360
28103-SA002	28203	42607-33011	28365
28103-SG000	28203	42607-33011	28370
28103-SG010	28203	42607-33011	28365
3AA-907-275	20088	42607-33021	28370
40700-1A00D	28342	42607-35010	28345
40700-1AA0B	28204	42607-75010	28345
40700-1AA0D	28204	42607-AD020	28355
40700-1PA0A	28342	42607-CA000	28360
40700-CD001	20064	42753-AHJ-A53	28981
40700-CK001	20161	42753-SHJ-A53	28981
40700-CK002	20069	42753-SHJ-A54	28981
40700-JA00C	28204	42753-SHJ-A82	28983
40700-JA01A	28167	42753-SNA-A83	28720
40700-JA01B	28204	42753-SNA-A84	28720

OEM INTERCHANGE

OEM Part No.	Schrader No.	OEM Part No.	Schrader No.
42753-STK-A01	20098	52933-2F000	28849
42753-STK-A02	20098	52933-2F001	28849
42753-STK-A03	20098	52933-2G200	20086
42753-STK-A04	20098	52933-2G201	20086
42753-SWA-306	20099	52933-2M00	20092
42753-SWA-316	20099	52933-2M000	20092
42753-TK4-A01	20720	52933-2M001	20092
42753-TL2-A51	20098	52933-2M550	20092
42753-TL2-A52	20098	52933-2S500	28500
42753-TP6-A82	20100	52933-2V000	28505
42753-TR0-A81	28720	52933-3N000	20092
42753-TR3-A81	28720	52933-3X200	20086
42753-TR3-A83	28720	52933-3X205	28070
42753-TX4-A51	28128	52933-4D200	20085
43130-54J20	20087	52933-A5000	20092
43130-54J21	20087	52933-A5000	28849
43130-54J22	20087	52933-A7000	28070
43130-57L00	20066 (Clamp-in)	52933-B2100	20218
43130-57L00	28308 (Snap-in)	52933-C1100	20281
43130-78J10	20158	56029319AA	28154 (Clamp-in)
43130-85Z00	20153	56029319AA	28461 (Snap-in)
43130-86Z20	20082	56029319AB	28154 (Clamp-in)
43211-82Z10	28204	56029319AB	28461 (Snap-in)
44D0907275	20077	56029359AA	28155 (Clamp-in)
4815132AB	28004	56029359AA	28434 (Snap-in)
4D0907275	20077	56029359AB	28155 (Clamp-in)
4D0907275A	20079	56029359AB	28434 (Snap-in)
4D0907275C	20077	56029359AC	28155 (Clamp-in)
4D0907275D	20079	56029398AA	20398
4F0907275	20078	56029398AB	20398
4F0907275B	20078	56029400AB	28291
4F0907275D	20103	56029400AC	28291
4F0907275H	20077	56029400AD	28291
4L2Z-1A150-BA	20096	56029465AB	20066 (Clamp-in)
5096808AA	20028	56029465AB	28308 (Snap-in)
5127335AB	20335	56029465AC	20066 (Clamp-in)
5142340AA	20066 (Clamp-in)	56029465AC	28308 (Snap-in)
5142340AA	28308 (Snap-in)	56029479AA	20066 (Clamp-in)
5154876AA	20398	56029479AA	28308 (Snap-in)
52088990AC	20028	56029479AB	28308 (Snap-in)
52088990AD	20028	56029481AB	28434 (Snap-in)
52933-1F000	28983	56053030AB	20066 (Clamp-in)
52933-1FA00	28983	56053030AB	28308 (Snap-in)

OEM INTERCHANGE

OEM Part No.	Schrader No.	OEM Part No.	Schrader No.
56053036AA	20066 (Clamp-in)	A0009057200	28214
56053036AA	28308 (Snap-in)	A4479050500	28239
5L1Z 1A150-AA	20135	BBM2-37-140B	20093
5Q0-907-275B	20103	BH4A-37-140	20093
68001696AA	20066 (Clamp-in)	C2C25519	20090
68001696AA	28308 (Snap-in)	C2C40476	20090
68001696AB	20066 (Clamp-in)	C2C40725	20091
68001696AB	28308 (Snap-in)	C2S40710	20091
68001698AA	28155 (Clamp-in)	C2Z15016	20091
68001698AA	28434 (Snap-in)	C2Z15017	20090
68001698AB	28155 (Clamp-in)	CM5T-1A180-A	20315
68001698AB	28434 (Snap-in)	CM5T-1A180-AA	20315
68006771AA	20089	DE8T-1A180-A	20315
68038945AA	20089	DE8T-1A180-AA	20315
68078861AA	20066 (Clamp-in)	DR3V-1A180-AA	29014
68078861AA	28308 (Snap-in)	F2GT-1A180-AA	20280
68157568AA	28984	F2GT-1A180-AB	20280
68193586AA	28586	G1ET-1A180-AA	29014
68193586AB	28586	GL3T-1A180-GA	20280
68193586AC	28586	GN3A-37-140B	20093
682397208AA	28984	GS1D-37-140	20093
68239720AA	28984	LR0031713	20090
68239720AC	28984	LR010532	20091
68241067AB	20398	LR010533	20090
68249197AA	28984	LR018860	20090
68252493AB	20398	LR018861	20091
68375775AA	20093	LR021936	20090
6F2Z-1A189-A	28385	LR031713	20090
7B0-907-253	28434 (Snap-in)	LR032833	20090
7B0-907-253A	28434 (Snap-in)	LR0500461	20090
7B0-907-253B	20398	LR066378	20090
7B0-907-253C	20398	MN103033	20028
7L1Z-1A189-A	28390	MN103081	20034
7P0907275	20103	RQH500471	20091
7P0907275A	20077	SU00300754	28360
7PP907275F	20103	XR855949	20091
7PP-907-275F	20103	XR855950	20090
8C2Z-1A-189A	28395	YBD000060	28082
958 361 661 00	20103	YBD000061	28082
997 606 021 00	20077	ZZC1-37-140	28385
9L3Z-1A-189A	20315	ZZDA-37-140	20315 (Snap-in)
A0009050030	20213	ZZDA-37-140	28385 (Banded)
A0009052102	28238		

NOTES

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Acura				Acura (cont'd)			
CSX				MDX, RDX (cont'd)			
2008-2011				2016-2017			
OE Sensor: Honda - 42753SNAA83				Service Pack	20050		
EZ-Sensor	33000 A	11.5	1.3		20050V	71	8
	33500 A, DB	11.5	1.3	NSX			
	33700	11.5	1.3	2016			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack	20050		
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		20050V		
Sensor	28720	35	4	RL			
Service Pack	20019	35	4	2005-2013			
2012				OE Sensor: Honda - 06421S3VA02, 06421S3VA03, 06421S3VA04, 42753SHJA53			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
ILX				Sensor	28981	35	4
2013-2015				Service Pack; Includes Valve	20036	35	4
Service Pack; exc Hybrid	20051			RLX			
Service Pack; Hybrid	20050V			2014-2017			
2016-2017				OE Sensor: Honda - 42753-TX4A51, 42753TX4A51			
Service Pack	20050			Sensor	28128	71	8
	20050V			Service Pack	20050		
MDX, RDX					20050V		
2004-2006					20051	71	8
OE Sensor: Honda - 06421S3VA02				2016-2017			
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack	20050V	71	8
	33700	11.5	1.3	2018			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Honda - 42753TX4A51			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28128	71	8
Sensor	28981	35	4	Service Pack	20050		
Service Pack; Includes Valve	20036	35	4		20050V		
2007-2012					20051	71	8
OE Sensor: Honda - 42753STKA01, 42753STKA02, 42753STKA04				TL			
EZ-Sensor	33500 A, DB	11.5	1.3	2005			
	33700	11.5	1.3	OE Sensor: Honda - 06421S3VA02			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor	28981	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; Includes Valve	20036	35	4
Sensor	20098	35	4	2006-2008			
2013				OE Sensor: Honda - 06421S3VA02, 06421S3VA04			
OE Sensor: Honda - 42753STKA04, 42753TX4A51				EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28981	35	4
Sensor	20098	35	4	Service Pack; Includes Valve	20036	35	4
Service Pack	20050V	71	8	2009-2013			
	20051	71	8	OE Sensor: Honda - 42753TK4A01			
2014-2015				Sensor	20720	35	4
OE Sensor: Honda - 42753TX4A51				Service Pack	20019	35	4
Sensor	28128	71	8	2014-2015			
Service Pack	20050V	71	8	Service Pack	20050		
	20051	71	8		20050V		

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Acura (cont'd)				Aston Martin (cont'd)			
TSX				DB11 (cont'd)			
2007-2014				2017			
OE Sensor: Honda - 42753STKA02, 42753TL2A51, 42753TL2A52				OE Sensor: Original Equipment Manufacturer - 7PP-907-275F			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20098	35	4	Sensor.....	20103		
ZDX				DB9			
2010-2013				2017-2018			
OE Sensor: Honda - 42753TK4A01				Sensor.....			
Sensor.....	20720	35	4	Service Pack.....	20023	31	3.5
Service Pack.....	20019	35	4	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
				Service Pack; W/48mm Green Insert.....	20038	31	3.5
				Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Alfa Romeo				Audi			
4C				A3, A4, A5 & Quattro			
2012-2016				2002-2005			
OE Sensor: Chrysler - 56029398AB				OE Sensor: Volkswagen - 4F0907275B			
EZ-Sensor.....	33500 A, DB	11.5	1.3	Sensor; Includes Transmitter Only.....	20078	35	4
	33700	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/43mm Silver Insert.....	20037	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	35	4
Sensor.....	20398	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	35	4
				2006-2007			
2017				OE Sensor: Volkswagen - 4F0907275B			
OE Sensor: Original Equipment Manufacturer - 05154876AB				EZ-Sensor.....			
Sensor.....	20284				33500 A, DB	11.5	1.3
Service Pack.....	20047 O	71	8		33700	11.5	1.3
	20049 U	71	8	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor; Includes Transmitter Only.....	20078	35	4
				Service Pack; Does Not Include Valve.....	20023	35	4
				Service Pack; W/43mm Silver Insert.....	20037	35	4
				Service Pack; W/48mm Green Insert.....	20038	35	4
				Service Pack; W/49mm Black Insert.....	20039	35	4
				Service Pack; W/51mm Orange Insert.....	20040	35	4
8C				2008			
2007-2009				OE Sensor: Volkswagen - 1K0907253D, 4F0907275B			
EZ-Sensor.....				EZ-Sensor.....			
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Giulia							
2016-2017							
Service Pack.....							
	20050						
	20050V						
Aston Martin							
DB11							
2016							
EZ-Sensor.....							
	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 O-Use until depleted, replaced by 20049
T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Audi (cont'd)				Audi (cont'd)			
A3, A4, A5 & Quattro (cont'd)				A6 (cont'd)			
2009-2012				2011			
OE Sensor: Volkswagen - 1K0907253D				OE Sensor: Volkswagen - 4F0907275H			
EZ-Sensor	33500 A, DB	11.5	1.3	Sensor; Includes Transmitter Only	20077	35	4
	33700	11.5	1.3	Service Pack; Does Not Include Valve	20023	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/43mm Silver Insert	20037	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; W/48mm Green Insert	20038	35	4
Sensor	20088	71	8	Service Pack; W/49mm Black Insert	20039	35	4
Service Pack	20017	71	8	Service Pack; W/51mm Orange Insert	20040	35	4
2013-2018				2013-2018			
Sensor	INDIRECT ^D			Sensor	INDIRECT ^D		
A4 allroad				A6 Quattro			
2013-2018				2006-2008			
Sensor	INDIRECT ^D			OE Sensor: Volkswagen - 4F0907275B			
A6				Sensor; Includes Transmitter Only	20078	35	4
2002-2004				Service Pack; Does Not Include Valve	20023	35	4
OE Sensor: Volkswagen - 4D0907275D				Service Pack; W/43mm Silver Insert	20037	35	4
EZ-Sensor	33000 A	11.5	1.3	Service Pack; W/48mm Green Insert	20038	35	4
	33500 A, DB	11.5	1.3	Service Pack; W/49mm Black Insert	20039	35	4
	33700	11.5	1.3	Service Pack; W/51mm Orange Insert	20040	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2010			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	OE Sensor: Volkswagen - 4F0907275D			
Sensor; Includes Transmitter Only	20079	35	4	Sensor; Includes Transmitter Only	20103	35	4
Service Pack; Does Not Include Valve	20023	35	4	Service Pack; Does Not Include Valve	20023	35	4
Service Pack; W/43mm Silver Insert	20037	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; W/48mm Green Insert	20038	35	4
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; W/49mm Black Insert	20039	35	4
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/51mm Orange Insert	20040	35	4
2006-2008				2011			
OE Sensor: Volkswagen - 4F0907275B				OE Sensor: Volkswagen - 4F0907275H			
Sensor; Includes Transmitter Only	20078	35	4	Sensor; Includes Transmitter Only	20077	35	4
Service Pack; Does Not Include Valve	20023	35	4	Service Pack; Does Not Include Valve	20023	35	4
Service Pack; W/43mm Silver Insert	20037	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; W/48mm Green Insert	20038	35	4
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; W/49mm Black Insert	20039	35	4
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/51mm Orange Insert	20040	35	4
2009				2015-2017			
OE Sensor: Volkswagen - 4F0907275D				Sensor	INDIRECT ^D		
Sensor; Includes Transmitter Only; Quattro	20103	35	4	A7 Quattro			
Service Pack; Does Not Include Valve	20023	35	4	2013-2018			
Service Pack; W/43mm Silver Insert	20037	35	4	Sensor	INDIRECT ^D		
Service Pack; W/48mm Green Insert	20038	35	4	A8			
Service Pack; W/49mm Black Insert	20039	35	4	2000-2003			
Service Pack; W/51mm Orange Insert	20040	35	4	OE Sensor: Volkswagen - 4D0907275A			
2010				EZ-Sensor	33500 A, DB	11.5	1.3
OE Sensor: Volkswagen - 4F0907275D					33700	11.5	1.3
Sensor; Includes Transmitter Only	20103	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Does Not Include Valve	20023	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	35	4	Sensor; Includes Transmitter Only	20079	35	4
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; Does Not Include Valve	20023	35	4
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/48mm Green Insert	20038	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000, 33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.				
Audi (cont'd)				Audi (cont'd)							
A8 (cont'd)				A8 Quattro (cont'd)							
2004-2005				2004-2011							
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Volkswagen - 4D0907275C							
	33700	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3				
Service Pack; Does Not Include Valve.....	20023	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
Service Pack; W/43mm Silver Insert.....	20037	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Service Pack; W/48mm Green Insert.....	20038	35	4	Sensor; Includes Transmitter Only.....	20077	35	4				
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; Does Not Include Valve.....	20023	35	4				
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4				
2006-2011				Service Pack; W/48mm Green Insert.....	20038	35	4				
OE Sensor: Volkswagen - 4D0907275				Service Pack; W/49mm Black Insert.....	20039	35	4				
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	35	4				
	33700	11.5	1.3	Allroad							
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2001-2005							
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3				
Sensor; Includes Transmitter Only.....	20077	35	4		33700	11.5	1.3				
Service Pack; Does Not Include Valve.....	20023	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
Service Pack; W/43mm Silver Insert.....	20037	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Service Pack; W/48mm Green Insert.....	20038	35	4	Allroad Quattro							
Service Pack; W/49mm Black Insert.....	20039	35	4	2001-2005							
Service Pack; W/51mm Orange Insert.....	20040	35	4	OE Sensor: Volkswagen - 4D0907275D							
2013-2018				EZ-Sensor.....	33000 A	11.5	1.3				
Sensor.....	INDIRECT D				33500 A, DB	11.5	1.3				
A8 Quattro					33700	11.5	1.3				
2000-2002				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
OE Sensor: Volkswagen - 4D0907275D				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
EZ-Sensor.....	33000 A	11.5	1.3	Sensor; Includes Transmitter Only.....	20079	35	4				
	33500 A, DB	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	35	4				
	33700	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/48mm Green Insert.....	20038	35	4				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4				
Sensor; Includes Transmitter Only.....	20079	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4				
Service Pack; Does Not Include Valve.....	20023	35	4	Q3							
Service Pack; W/43mm Silver Insert.....	20037	35	4	2013-2018							
Service Pack; W/48mm Green Insert.....	20038	35	4	Sensor.....	INDIRECT D						
Service Pack; W/49mm Black Insert.....	20039	35	4	Q3 Quattro							
Service Pack; W/51mm Orange Insert.....	20040	35	4	2015-2018							
2003				Sensor.....	INDIRECT D						
OE Sensor: Volkswagen - 4D0907275, 4D0907275D				Q5							
EZ-Sensor.....	33000 A	11.5	1.3	2009-2012							
	33200 A	11.5	1.3	OE Sensor: Volkswagen - 1K0907253D							
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3				
	33700	11.5	1.3		33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Sensor; Includes Transmitter Only; Chassis No. 4D3004999 & Before.....	20079	35	4	Sensor.....	20088	71	8				
Sensor; Includes Transmitter Only; Chassis No. 4E3000001 & After.....	20077	35	4	Service Pack.....	20017	71	8				
Service Pack; Does Not Include Valve.....	20023	35	4	2013-2018							
Service Pack; W/43mm Silver Insert.....	20037	35	4	Sensor.....	INDIRECT D						
Service Pack; W/48mm Green Insert.....	20038	35	4								
Service Pack; W/49mm Black Insert.....	20039	35	4								
Service Pack; W/51mm Orange Insert.....	20040	35	4								

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Audi (cont'd)				Audi (cont'd)			
Q7				R8 (cont'd)			
2007-2009				2011			
OE Sensor: Volkswagen - 4F0907275B				OE Sensor: Volkswagen - 4F0907275D			
Sensor; Includes Transmitter Only.	20078	35	4	Sensor.	20103	35	4
Service Pack; Does Not Include Valve.	20023	35	4	Service Pack; Does Not Include Valve.	20023	35	4
Service Pack; W/43mm Silver Insert.	20037	35	4	Service Pack; W/43mm Silver Insert.	20037	35	4
Service Pack; W/48mm Green Insert.	20038	35	4	Service Pack; W/48mm Green Insert.	20038	35	4
Service Pack; W/49mm Black Insert.	20039	35	4	Service Pack; W/49mm Black Insert.	20039	35	4
Service Pack; W/51mm Orange Insert.	20040	35	4	Service Pack; W/51mm Orange Insert.	20040	35	4
2010				2012			
OE Sensor: Volkswagen - 4F0907275D				OE Sensor: Volkswagen - 4F0907275D			
Sensor; Includes Transmitter Only.	20103	35	4	Sensor; Includes Transmitter Only.	20103	35	4
Service Pack; Does Not Include Valve.	20023	35	4	Service Pack; Does Not Include Valve.	20023	35	4
Service Pack; W/43mm Silver Insert.	20037	35	4	Service Pack; W/43mm Silver Insert.	20037	35	4
Service Pack; W/48mm Green Insert.	20038	35	4	Service Pack; W/48mm Green Insert.	20038	35	4
Service Pack; W/49mm Black Insert.	20039	35	4	Service Pack; W/49mm Black Insert.	20039	35	4
Service Pack; W/51mm Orange Insert.	20040	35	4	Service Pack; W/51mm Orange Insert.	20040	35	4
2011				2014-2015			
OE Sensor: Volkswagen - 4F0907275H				OE Sensor: Volkswagen - 4F0907275D			
Sensor; Includes Transmitter Only.	20077	35	4	Sensor; Includes Transmitter Only.	20103	35	4
Service Pack; Does Not Include Valve.	20023	35	4	Service Pack; Does Not Include Valve.	20023	35	4
Service Pack; W/43mm Silver Insert.	20037	35	4	Service Pack; W/43mm Silver Insert.	20037	35	4
Service Pack; W/48mm Green Insert.	20038	35	4	Service Pack; W/48mm Green Insert.	20038	35	4
Service Pack; W/49mm Black Insert.	20039	35	4	Service Pack; W/49mm Black Insert.	20039	35	4
Service Pack; W/51mm Orange Insert.	20040	35	4	Service Pack; W/51mm Orange Insert.	20040	35	4
2012				2017-2018			
OE Sensor: Volkswagen - 4F0907275D				OE Sensor: Volkswagen - 4F0907275D			
Sensor; Includes Transmitter Only.	20103	35	4	Sensor; Includes Transmitter Only.	20103	35	4
Service Pack; Does Not Include Valve.	20023	35	4	Service Pack; Does Not Include Valve.	20023	35	4
Service Pack; W/43mm Silver Insert.	20037	35	4	Service Pack; W/43mm Silver Insert.	20037	35	4
Service Pack; W/48mm Green Insert.	20038	35	4	Service Pack; W/48mm Green Insert.	20038	35	4
Service Pack; W/49mm Black Insert.	20039	35	4	Service Pack; W/49mm Black Insert.	20039	35	4
Service Pack; W/51mm Orange Insert.	20040	35	4	Service Pack; W/51mm Orange Insert.	20040	35	4
2013-2018				RS4			
Sensor.				INDIRECT ^D			
R8				2007-2008			
2008-2009				OE Sensor: Volkswagen - 4F0907275B			
OE Sensor: Volkswagen - 4F0907275B				Sensor; Includes Transmitter Only.			
Sensor; Includes Transmitter Only.	20078	35	4	Service Pack; Does Not Include Valve.	20023	35	4
Service Pack; Does Not Include Valve.	20023	35	4	Service Pack; W/43mm Silver Insert.	20037	35	4
Service Pack; W/43mm Silver Insert.	20037	35	4	Service Pack; W/48mm Green Insert.	20038	35	4
Service Pack; W/48mm Green Insert.	20038	35	4	Service Pack; W/49mm Black Insert.	20039	35	4
Service Pack; W/49mm Black Insert.	20039	35	4	Service Pack; W/51mm Orange Insert.	20040	35	4
Service Pack; W/51mm Orange Insert.	20040	35	4	RS5			
2010				2013-2017			
OE Sensor: Volkswagen - 4F0907275D				Sensor.			
Sensor; Includes Transmitter Only.	20103	35	4	INDIRECT ^D			
Service Pack; Does Not Include Valve.	20023	35	4				
Service Pack; W/43mm Silver Insert.	20037	35	4				
Service Pack; W/48mm Green Insert.	20038	35	4				
Service Pack; W/49mm Black Insert.	20039	35	4				
Service Pack; W/51mm Orange Insert.	20040	35	4				

D-Indirect TPMS system. No sensor in wheel

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Audi (cont'd)				Audi (cont'd)			
RS6				S4 (cont'd)			
2003				2013-2018			
OE Sensor: Volkswagen - 4F0907275H				Sensor.....	INDIRECT ^D		
EZ-Sensor.....	33200 ^A	11.5	1.3	S5			
	33500 ^{A, DB}	11.5	1.3	2008-2012			
	33700	11.5	1.3	OE Sensor: Volkswagen - 1K0907253D			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3		33700	11.5	1.3
Sensor; Includes Transmitter Only.....	20077	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Does Not Include Valve.....	20023	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Service Pack; W/43mm Silver Insert.....	20037	35	4	Sensor.....	20088	71	8
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack.....	20017	71	8
Service Pack; W/49mm Black Insert.....	20039	35	4	2013-2018			
Service Pack; W/51mm Orange Insert.....	20040	35	4	Sensor.....	INDIRECT ^D		
RS7				S6			
2014-2018				2007-2009			
OE Sensor: Volkswagen - 7PP-907-275F				OE Sensor: Volkswagen - 4F0907275B			
Sensor.....	20103	35	4	Sensor; Includes Transmitter Only.....	20078	35	4
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack; Does Not Include Valve.....	20023	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
S3				2010			
2015-2018				OE Sensor: Volkswagen - 4F0907275D			
Sensor.....	INDIRECT ^D			Sensor; Includes Transmitter Only.....	20103	35	4
S4				Service Pack; Does Not Include Valve.....			
2002-2003				Service Pack; W/43mm Silver Insert.....			
OE Sensor: Volkswagen - 4D0907275D				Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor.....	33000 ^A	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
	33500 ^{A, DB}	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	35	4
	33700	11.5	1.3	2011			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Volkswagen - 4F0907275H			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Sensor; Includes Transmitter Only.....	20077	35	4
Sensor; Includes Transmitter Only.....	20079	35	4	Service Pack; Does Not Include Valve.....	20023	35	4
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	2013-2018			
2004-2009				Sensor.....			
OE Sensor: Volkswagen - 4F0907275B				INDIRECT ^D			
Sensor; Includes Transmitter Only.....	20078	35	4	S7			
Service Pack; Does Not Include Valve.....	20023	35	4	2013-2018			
Service Pack; W/43mm Silver Insert.....	20037	35	4	Sensor.....			
Service Pack; W/48mm Green Insert.....	20038	35	4	INDIRECT ^D			
Service Pack; W/49mm Black Insert.....	20039	35	4				
Service Pack; W/51mm Orange Insert.....	20040	35	4				
2010-2011							
OE Sensor: Volkswagen - 1K0907253D							
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3				
Sensor.....	20088	71	8				
Service Pack.....	20017	71	8				

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Audi (cont'd)				Audi (cont'd)			
S8				S8 (cont'd)			
2000				2007-2008			
OE Sensor: Volkswagen - 4D0907275D				OE Sensor: Volkswagen - 4D0907275C			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor; Includes Transmitter Only	20079	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; Does Not Include Valve	20023	35	4	Sensor; Includes Transmitter Only	20077	35	4
Service Pack; W/43mm Silver Insert	20037	35	4	Service Pack; Does Not Include Valve	20023	35	4
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; W/48mm Green Insert	20038	35	4
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/49mm Black Insert	20039	35	4
				Service Pack; W/51mm Orange Insert	20040	35	4
2001-2002				2009			
OE Sensor: Volkswagen - 4D0907275D				OE Sensor: Volkswagen - 4D0907275			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only	20079	35	4	Sensor; Includes Transmitter Only; Chassis No.			
Service Pack; Does Not Include Valve	20023	35	4	4E3000001 & After	20077	35	4
Service Pack; W/43mm Silver Insert	20037	35	4	Service Pack; Does Not Include Valve	20023	35	4
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; W/48mm Green Insert	20038	35	4
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/49mm Black Insert	20039	35	4
				Service Pack; W/51mm Orange Insert	20040	35	4
2003				2013-2014			
OE Sensor: Volkswagen - 4D0907275, 4D0907275D				Sensor	INDIRECT D		
EZ-Sensor	33000 A	11.5	1.3	2015			
	33500 A, DB	11.5	1.3	OE Sensor: Volkswagen - 4D0907275			
	33700	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor; Includes Transmitter Only; Chassis No.				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
4D3004999 & Before	20079	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only; Chassis No.				Sensor	INDIRECT D		
4E3000001 & After	20077	35	4	Sensor; Includes Transmitter Only; Chassis No.			
Service Pack; Does Not Include Valve	20023	35	4	4E3000001 & After	20077	35	4
Service Pack; W/43mm Silver Insert	20037	35	4	Service Pack; Does Not Include Valve	20023	35	4
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; W/48mm Green Insert	20038	35	4
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/49mm Black Insert	20039	35	4
				Service Pack; W/51mm Orange Insert	20040	35	4
2004-2006				2016-2018			
OE Sensor: Volkswagen - 4D0907275				Sensor	INDIRECT D		
EZ-Sensor	33000 A	11.5	1.3	SQ5			
	33500 A, DB	11.5	1.3	2013-2014			
	33700	11.5	1.3	Sensor	INDIRECT D		
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2015			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
Sensor; Includes Transmitter Only; Chassis No.					33700	11.5	1.3
4E3000001 & After	20077	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Does Not Include Valve	20023	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	35	4	Sensor	INDIRECT D		
Service Pack; W/48mm Green Insert	20038	35	4				
Service Pack; W/49mm Black Insert	20039	35	4				
Service Pack; W/51mm Orange Insert	20040	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000, 33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Audi (cont'd)				Bentley (cont'd)			
SQ5 (cont'd)				Azure			
2016-2018				2007-2009			
Sensor.....	INDIRECT ^D			OE Sensor: Volkswagen - 4F0907275D			
TT				Sensor; Includes Transmitter Only.....	20103	35	4
2007				Service Pack; Does Not Include Valve.....	20023	35	4
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
	33700	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/49mm Black Insert.....	20039	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	35	4
2008-2009				Bentayga			
OE Sensor: Volkswagen - 1K0907253D				2017-2018			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	OE Sensor: Volkswagen - 5Q0-907-275B			
	33700	11.5	1.3	Sensor; Includes Transmitter Only.....	20103	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Does Not Include Valve.....	20023	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
Sensor.....	20088	71	8	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack.....	20017	71	8	Service Pack; W/49mm Black Insert.....	20039	35	4
2010-2011				Service Pack; W/51mm Orange Insert.....	20040	35	4
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	Brooklands			
	33700	11.5	1.3	2008			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Original Equipment Manufacturer - 4F0 907 275			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Sensor; Includes Transmitter Only.....	20078	35	4
2013-2018				Service Pack; Does Not Include Valve.....	20023	35	4
Sensor.....	INDIRECT ^D			Service Pack; W/43mm Silver Insert.....	20037	35	4
TT Quattro				Service Pack; W/48mm Green Insert.....	20038	35	4
2008-2009				Service Pack; W/49mm Black Insert.....	20039	35	4
OE Sensor: Volkswagen - 1K0907253D				Service Pack; W/51mm Orange Insert.....	20040	35	4
Sensor.....	20088	71	8	Continental			
Service Pack.....	20017	71	8	2003-2005			
2013-2017				OE Sensor: Volkswagen - 4D0907275C			
Sensor.....	INDIRECT ^D			EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
TT RS					33700	11.5	1.3
2018				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: Volkswagen - 7PP-907-275F				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	20103	35	4	Sensor; Includes Transmitter Only.....	20077	35	4
	INDIRECT ^D			Service Pack; Does Not Include Valve.....	20023	35	4
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	2006-2010			
Bentley				OE Sensor: Volkswagen - 4F0907275B			
Arnage				Sensor; Includes Transmitter Only.....	20078	35	4
2008				Service Pack; Does Not Include Valve.....	20023	35	4
OE Sensor: Original Equipment Manufacturer - 4F0 907 275				Service Pack; W/43mm Silver Insert.....	20037	35	4
Sensor; Includes Transmitter Only.....	20078	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
				Service Pack; W/49mm Black Insert.....	20039	35	4
				Service Pack; W/51mm Orange Insert.....	20040	35	4
				2012-2017			
				OE Sensor: Volkswagen - 4F0907275D, 7PP907275F			
				Sensor; Includes Transmitter Only.....	20103	35	4
				Service Pack; Does Not Include Valve.....	20023	35	4
				Service Pack; W/43mm Silver Insert.....	20037	35	4
				Service Pack; W/48mm Green Insert.....	20038	35	4
				Service Pack; W/49mm Black Insert.....	20039	35	4
				Service Pack; W/51mm Orange Insert.....	20040	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Bentley (cont'd)				BMW (cont'd)			
Continental (cont'd)				1 Series (cont'd)			
2018				2009-2010			
OE Sensor: Volkswagen - 7PP907275F				OE Sensor: BMW - 36236781847			
Sensor; Includes Transmitter Only.	20103	35	4	Sensor; Includes Transmitter Only.	20083	31	3.5
Service Pack; Does Not Include Valve.	20023	35	4	Service Pack; Does Not Include Valve.	20023	31	3.5
Service Pack; W/48mm Green Insert.	20038	35	4	Service Pack; W/43mm Silver Insert.	20037	31	3.5
Service Pack; W/49mm Black Insert.	20039	35	4	Service Pack; W/48mm Green Insert.	20038	31	3.5
Service Pack; W/51mm Orange Insert.	20040	35	4	Service Pack; W/49mm Black Insert.	20039	31	3.5
Flying Spur				2011-2013			
2014-2018				OE Sensor: BMW - 36 10 6 790 054			
OE Sensor: Volkswagen - 4F0907275D				EZ-Sensor:			
Sensor.	20103			33500 A, DB	11.5	1.3	
Service Pack; Does Not Include Valve.	20023	35	4	33700	11.5	1.3	
Service Pack; W/43mm Silver Insert.	20037	35	4	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Service Pack; W/48mm Green Insert.	20038	35	4	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Service Pack; W/49mm Black Insert.	20039	35	4	Sensor; Includes Transmitter Only.	28081	40	4.5
Service Pack; W/51mm Orange Insert.	20040	35	4	Service Pack; Does Not Include Valve.	20023	31	3.5
Mulsanne				Service Pack; W/43mm Silver Insert.			
2009				20037			
OE Sensor: Original Equipment Manufacturer - 4F0 907 275				Service Pack; W/48mm Green Insert.			
Sensor; Includes Transmitter Only.	20078	35	4	20038	31	3.5	
Service Pack; Does Not Include Valve.	20023	35	4	Service Pack; W/49mm Black Insert.	20039	31	3.5
Service Pack; W/43mm Silver Insert.	20037	35	4	Service Pack; W/51mm Orange Insert.	20040	31	3.5
Service Pack; W/48mm Green Insert.	20038	35	4	228i			
Service Pack; W/49mm Black Insert.	20039	35	4	2014			
Service Pack; W/51mm Orange Insert.	20040	35	4	OE Sensor: BMW - 36 10 6 798 872			
2010				EZ-Sensor:			
Service Pack; Does Not Include Valve.				33500 A, DB			
20023				33700			
Service Pack; W/43mm Silver Insert.				EZ-Sensor Service Pack; Aluminium Valve.			
20037				34000			
Service Pack; W/48mm Green Insert.				EZ-Sensor Service Pack; Rubber Valve.			
20038				20018 C, T			
Service Pack; W/51mm Orange Insert.				Sensor.			
20040				28126			
2011-2017				Service Pack; W/43mm Silver Insert.			
OE Sensor: Volkswagen - 4F0907275D, 7PP907275F				20037			
Sensor; Includes Transmitter Only.	20103	35	4	Service Pack; W/48mm Green Insert.	20038	31	3.5
Service Pack; Does Not Include Valve.	20023	35	4	Service Pack; W/49mm Black Insert.	20039	31	3.5
Service Pack; W/43mm Silver Insert.	20037	35	4	Service Pack; W/51mm Orange Insert.	20040	31	3.5
Service Pack; W/48mm Green Insert.	20038	35	4	2015			
Service Pack; W/49mm Black Insert.	20039	35	4	OE Sensor: BMW - 36 10 6 798 872			
Service Pack; W/51mm Orange Insert.	20040	35	4	EZ-Sensor:			
BMW				33500 A, DB			
1 Series				33700			
2008				EZ-Sensor Service Pack; Aluminium Valve.			
OE Sensor: BMW - 36 10 6 790 054, 36236781847				34000			
Sensor; Includes Transmitter Only.	20083	31	3.5	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
	28081	40	4.5	Sensor.	28126	40	4.5
Service Pack; Does Not Include Valve.	20023	31	3.5	Service Pack.	20023	31	3.5
Service Pack; W/43mm Silver Insert.	20037	31	3.5	Service Pack; W/43mm Silver Insert.	20037	31	3.5
Service Pack; W/48mm Green Insert.	20038	31	3.5	Service Pack; W/48mm Green Insert.	20038	31	3.5
Service Pack; W/49mm Black Insert.	20039	31	3.5	Service Pack; W/49mm Black Insert.	20039	31	3.5
Service Pack; W/51mm Orange Insert.	20040	31	3.5	Service Pack; W/51mm Orange Insert.	20040	31	3.5
				2016			
				EZ-Sensor:			
				33500 A, DB			
				33700			
				EZ-Sensor Service Pack; Aluminium Valve.			
				34000			
				EZ-Sensor Service Pack; Rubber Valve.			
				20018 C, T			
				Service Pack.			
				20023			
				Service Pack; W/43mm Silver Insert.			
				20037			
				Service Pack; W/48mm Green Insert.			
				20038			
				Service Pack; W/49mm Black Insert.			
				20039			
				Service Pack; W/51mm Orange Insert.			
				20040			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
228i xDrive				320i (cont'd)			
2014-2016				2014			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: BMW - 36 10 6 798 872			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
230i				EZ-Sensor Service Pack; Rubber Valve.....			
2014-2017				2015-2017			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
230i xDrive				320i xDrive			
2017				2014			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: BMW - 36 10 6 798 872			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
320i				EZ-Sensor Service Pack; Rubber Valve.....			
2000				2015-2017			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2001-2002				2015-2017			
OE Sensor: BMW - 36118378682				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33700	11.5	1.3
	33200 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor; Includes Transmitter Only; W/433 MHz			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20080	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
Sensor; Includes Transmitter Only; W/433 MHz				Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Sensor.....	20080	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	2003-2005			
Service Pack; W/49mm Black Insert.....	20039	31	3.5	OE Sensor: BMW - 36118378682			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	EZ-Sensor.....	33000 A	11.5	1.3
2003-2005				EZ-Sensor.....			
OE Sensor: BMW - 36118378682					33500 A, DB	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; Includes Transmitter Only.....	20080	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
Sensor; Includes Transmitter Only.....	20080	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5				
Service Pack; W/51mm Orange Insert.....	20040	31	3.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
323i				323i (cont'd)			
2000				2007-2010			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36236781847			
EZ-Sensor.....	33000 A	11.5	1.3	Sensor; Includes Transmitter Only.....	20083	31	3.5
	33500 A, DB	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
	33700	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/48mm Green Insert.....	20038	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Sensor; Includes Transmitter Only.....	20080	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5				
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	2014-2017			
Service Pack; W/48mm Green Insert.....	20038	31	3.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	31	3.5		33700	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2001-2002							
EZ-Sensor.....	33500 A, DB	11.5	1.3				
	33700	11.5	1.3	325			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2001-2002			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: BMW - 36118378682			
				EZ-Sensor.....	33000 A	11.5	1.3
2003					33200 A	11.5	1.3
OE Sensor: BMW - 36118378682					33500 A, DB	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor; Includes Transmitter Only; W/433 MHz			
Sensor; Includes Transmitter Only.....	20080	31	3.5	Sensor.....	20079	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
				2003-2006			
2004-2005				OE Sensor: BMW - 36118378682			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2006				Sensor; Includes Transmitter Only.....	20079	31	3.5
OE Sensor: BMW - 36118378682				Service Pack; Does Not Include Valve.....	20023	31	3.5
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
	33700	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/49mm Black Insert.....	20039	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Sensor; Includes Transmitter Only.....	20080	31	3.5				
Service Pack; Does Not Include Valve; Jun. & Newer.....	20023	31	3.5	2007			
Service Pack; W/43mm Silver Insert; Jun. & Newer.....	20037	31	3.5	OE Sensor: BMW - 36236781847			
Service Pack; W/48mm Green Insert; Jun. & Newer.....	20038	31	3.5	Sensor; Includes Transmitter Only.....	20083	31	3.5
Service Pack; W/49mm Black Insert; Jun. & Newer.....	20039	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/51mm Orange Insert; Jun. & Newer.....	20040	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
				Service Pack; W/48mm Green Insert.....	20038	31	3.5
				Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
				2014-2017			
				EZ-Sensor.....	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
328Ci				328i			
2000				2000			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36118378682			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor; Includes Transmitter Only.....	20080	31	3.5	Sensor; Includes Transmitter Only; W/433 MHz			
Service Pack; Does Not Include Valve.....	20023	31	3.5	Sensor.....	20080	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
328d				2007-2008			
2014				2007-2008			
OE Sensor: BMW - 36 10 6 798 872				OE Sensor: BMW - 36236781847			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	Sensor; Includes Transmitter Only.....	20083	31	3.5
	33700	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Sensor.....	28126	40	4.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5				
Service Pack; W/49mm Black Insert.....	20039	31	3.5	2009			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	OE Sensor: BMW - 36236781847			
				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
2015-2017					33700	11.5	1.3
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; Includes Transmitter Only.....	28081	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
				Service Pack; W/43mm Silver Insert.....	20037	31	3.5
328d xDrive				Service Pack; W/48mm Green Insert.....	20038	31	3.5
2014				Service Pack; W/49mm Black Insert.....	20039	31	3.5
OE Sensor: BMW - 36 10 6 798 872				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	2010-2013			
	33700	11.5	1.3	OE Sensor: BMW - 36 10 6 790 054			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3		33700	11.5	1.3
Sensor.....	28126	40	4.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Sensor; Includes Transmitter Only.....	28081	40	4.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
				Service Pack; W/48mm Green Insert.....	20038	31	3.5
2015-2017				Service Pack; W/49mm Black Insert.....	20039	31	3.5
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
	33700	11.5	1.3	2014-2016			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: BMW - 36 10 6 798 872			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Sensor; Includes Transmitter Only.....	28126	40	4.5
				Service Pack; Does Not Include Valve.....	20023	31	3.5
				Service Pack; W/43mm Silver Insert.....	20037	31	3.5
				Service Pack; W/48mm Green Insert.....	20038	31	3.5
				Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
328i (cont'd)				328i xDrive (cont'd)			
2017				2014-2015			
EZ-Sensor	33500 A, DB	11.5	1.3	OE Sensor: BMW - 36 10 6 798 872			
	33700	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
328i GT xDrive				EZ-Sensor Service Pack; Rubber Valve			
2014-2016				Sensor; Includes Transmitter Only			
OE Sensor: BMW - 36 10 6 798 872				Service Pack; Does Not Include Valve	20023	31	3.5
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack; W/43mm Silver Insert	20037	31	3.5
	33700	11.5	1.3	Service Pack; W/48mm Green Insert	20038	31	3.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/49mm Black Insert	20039	31	3.5
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; W/51mm Orange Insert	20040	31	3.5
Sensor; Includes Transmitter Only	28126	40	4.5	2016-2017			
Service Pack; Does Not Include Valve	20023	31	3.5	EZ-Sensor	33500 A, DB	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	31	3.5		33700	11.5	1.3
Service Pack; W/48mm Green Insert	20038	31	3.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; W/49mm Black Insert	20039	31	3.5	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; W/51mm Orange Insert	20040	31	3.5	328xi			
2017				2007-2008			
EZ-Sensor	33500 A, DB	11.5	1.3	OE Sensor: BMW - 36236781847			
	33700	11.5	1.3	Sensor; Includes Transmitter Only	20083	31	3.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; Does Not Include Valve	20023	31	3.5
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; W/43mm Silver Insert	20037	31	3.5
328i xDrive				Service Pack; W/48mm Green Insert			
2009				Service Pack; W/49mm Black Insert			
OE Sensor: BMW - 36236781847				Service Pack; W/51mm Orange Insert	20040	31	3.5
EZ-Sensor	33500 A, DB	11.5	1.3	330			
	33700	11.5	1.3	2001-2002			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: BMW - 36118378682			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
Sensor; Includes Transmitter Only	28081	31	3.5		33200 A	11.5	1.3
Service Pack; Does Not Include Valve	20023	31	3.5		33500 A, DB	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	31	3.5		33700	11.5	1.3
Service Pack; W/48mm Green Insert	20038	31	3.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; W/49mm Black Insert	20039	31	3.5	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; W/51mm Orange Insert	20040	31	3.5	Sensor; Includes Transmitter Only; W/433 MHz			
2010-2013				Sensor			
OE Sensor: BMW - 36 10 6 790 054				Service Pack; Does Not Include Valve	20023	31	3.5
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack; W/43mm Silver Insert	20037	31	3.5
	33700	11.5	1.3	Service Pack; W/48mm Green Insert	20038	31	3.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/49mm Black Insert	20039	31	3.5
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; W/51mm Orange Insert	20040	31	3.5
Sensor; Includes Transmitter Only	28081	40	4.5	2003-2006			
Service Pack; Does Not Include Valve	20023	31	3.5	OE Sensor: BMW - 36118378682			
Service Pack; W/43mm Silver Insert	20037	31	3.5	EZ-Sensor	33200 A	11.5	1.3
Service Pack; W/48mm Green Insert	20038	31	3.5		33500 A, DB	11.5	1.3
Service Pack; W/49mm Black Insert	20039	31	3.5		33700	11.5	1.3
Service Pack; W/51mm Orange Insert	20040	31	3.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve			
				Sensor; Includes Transmitter Only			
				Service Pack; Does Not Include Valve			
				Service Pack; W/43mm Silver Insert			
				Service Pack; W/48mm Green Insert			
				Service Pack; W/49mm Black Insert			
				Service Pack; W/51mm Orange Insert			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
335d				335i (cont'd)			
2009				2013-2014			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36 10 6 790 054, 36 10 6 798 872			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only.....	20083	31	3.5	Sensor; Includes Transmitter Only.....	28126	40	4.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
2010-2011				335i GT xDrive			
OE Sensor: BMW - 36 10 6 790 054				2014-2015			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: BMW - 36 10 6 798 872			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; Includes Transmitter Only.....	28081	40	4.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5	Sensor; Includes Transmitter Only.....	28126	40	4.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
335i				2016-2017			
2007-2008				EZ-Sensor.....			
OE Sensor: BMW - 36236781847					33500 A, DB	11.5	1.3
Sensor; Includes Transmitter Only.....	20083	31	3.5		33700	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	31	3.5				
Service Pack; W/49mm Black Insert.....	20039	31	3.5	335i xDrive			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	2009			
2009				OE Sensor: BMW - 36236781847			
OE Sensor: BMW - 36236781847				EZ-Sensor.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only.....	28081	31	3.5	Sensor; Includes Transmitter Only.....	28081	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
2010-2012				2010-2012			
OE Sensor: BMW - 36 10 6 790 054				OE Sensor: BMW - 36 10 6 790 054			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only.....	28081	40	4.5	Sensor; Includes Transmitter Only.....	28081	40	4.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
335i xDrive (cont'd)				340i GT xDrive			
2013-2015				2017			
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 798 872				EZ-Sensor: 33500 A, DB 11.5 1.3			
EZ-Sensor: 33700 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7			
EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7				EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3				340i xDrive			
Sensor; Includes Transmitter Only. 28126 40 4.5				2016-2017			
Service Pack; Does Not Include Valve. 20023 31 3.5				EZ-Sensor: 33500 A, DB 11.5 1.3			
Service Pack; W/43mm Silver Insert. 20037 31 3.5				EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7			
Service Pack; W/48mm Green Insert. 20038 31 3.5				EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3			
Service Pack; W/49mm Black Insert. 20039 31 3.5				428i			
Service Pack; W/51mm Orange Insert. 20040 31 3.5				2014			
2016-2017				OE Sensor: BMW - 36 10 6 798 872			
EZ-Sensor: 33500 A, DB 11.5 1.3				Sensor; Includes Transmitter Only. 28126 40 4.5			
EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7				Service Pack. 20050			
EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3				Service Pack; Does Not Include Valve. 20023 31 3.5			
335is				Service Pack; W/43mm Silver Insert. 20037 31 3.5			
2012-2013				Service Pack; W/48mm Green Insert. 20038 31 3.5			
OE Sensor: BMW - 36 10 6 790 054				Service Pack; W/49mm Black Insert. 20039 31 3.5			
EZ-Sensor: 33500 A, DB 11.5 1.3				Service Pack; W/51mm Orange Insert. 20040 31 3.5			
EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7				2015			
EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3				OE Sensor: BMW - 36 10 6 798 872			
335xi				EZ-Sensor; Programmable sensor. Programming tool required. 33500 A, DB 11.5 1.3			
2007-2008				EZ-Sensor Service Pack; Aluminum valve. 34000 62 7			
OE Sensor: BMW - 36236781847				EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3			
Sensor; Includes Transmitter Only. 20083 31 3.5				Sensor. 28126 35 4			
Service Pack; Does Not Include Valve. 20023 31 3.5				Service Pack. 20050			
Service Pack; W/43mm Silver Insert. 20037 31 3.5				Service Pack; Does Not Include Valve. 20023 31 3.5			
Service Pack; W/48mm Green Insert. 20038 31 3.5				2016			
Service Pack; W/49mm Black Insert. 20039 31 3.5				OE Sensor: BMW - 36 10 6 798 872			
Service Pack; W/51mm Orange Insert. 20040 31 3.5				EZ-Sensor: 33500 A, DB 11.5 1.3			
2014-2017				EZ-Sensor Service Pack; Aluminum valve. 34000 62 7			
EZ-Sensor: 33500 A, DB 11.5 1.3				EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7				Sensor. 28126 35 4			
EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3				Service Pack. 20050			
340i				Service Pack; Does Not Include Valve. 20023 31 3.5			
2016-2017				2017			
EZ-Sensor: 33500 A, DB 11.5 1.3				EZ-Sensor: 33500 A, DB 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7				EZ-Sensor Service Pack; Aluminum valve. 34000 62 7			
EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3				EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3			
				Service Pack. 20050			
				Service Pack. 20050V			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
428i Gran Coupe				430i Gran Coupe			
2015-2017				2017			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
428i xDrive				430i xDrive			
2014				2017			
OE Sensor: BMW - 36 10 6 798 872				EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3
Sensor.....	28126	40	4.5		33700	11.5	1.3
Service Pack.....	20050			EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
	20050V			EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5	430i xDrive Gran Coupe			
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	2017			
Service Pack; W/48mm Green Insert.....	20038	31	3.5	EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	31	3.5		33700	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
2015				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
OE Sensor: BMW - 36 10 6 798 872				435i			
EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3	2014			
	33700	11.5	1.3	OE Sensor: BMW - 36 10 6 798 872			
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	Sensor.....	28126	40	4.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
Sensor.....	28126	35	4	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack.....	20050			Service Pack; W/48mm Green Insert.....	20038	31	3.5
	20050V			Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	2015			
Service Pack; W/48mm Green Insert.....	20038	31	3.5	OE Sensor: BMW - 36 10 6 798 872			
Service Pack; W/49mm Black Insert.....	20039	31	3.5	EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	31	3.5		33700	11.5	1.3
2016-2017				EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Service Pack.....	20050		
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7		20050V		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack.....	20050			Service Pack; W/43mm Silver Insert.....	20037	31	3.5
	20050V			Service Pack; W/48mm Green Insert.....	20038	31	3.5
428i xDrive Gran Coupe				Service Pack; W/49mm Black Insert.....	20039	31	3.5
2015-2017				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3	430i			
	33700	11.5	1.3	2017			
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
430i				EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
2017				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3	Sensor.....	28126	35	4
	33700	11.5	1.3	Service Pack.....	20050		
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7		20050V		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
435i (cont'd)				435i xDrive (cont'd)			
2016				2016-2017			
OE Sensor: BMW - 36 10 6 798 872				EZ-Sensor; Programmable sensor. Programming			
EZ-Sensor; Programmable sensor. Programming				tool required.....			
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....				EZ-Sensor Service Pack; Aluminum valve.....			
	34000	62	7		34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Sensor.....				Sensor.....			
	28126	35	4		28126	35	4
Service Pack.....				Service Pack.....			
	20050				20050		
	20050V				20050V		
Service Pack; Does Not Include Valve.....				Service Pack; Does Not Include Valve.....			
	20023	31	3.5		20023	31	3.5
Service Pack; W/43mm Silver Insert.....				Service Pack; W/43mm Silver Insert.....			
	20037	31	3.5		20037	31	3.5
Service Pack; W/48mm Green Insert.....				Service Pack; W/48mm Green Insert.....			
	20038	31	3.5		20038	31	3.5
Service Pack; W/49mm Black Insert.....				Service Pack; W/49mm Black Insert.....			
	20039	31	3.5		20039	31	3.5
Service Pack; W/51mm Orange Insert.....				Service Pack; W/51mm Orange Insert.....			
	20040	31	3.5		20040	31	3.5
2017				2015-2017			
EZ-Sensor; Programmable sensor. Programming				EZ-Sensor; Programmable sensor. Programming			
tool required.....				tool required.....			
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....				EZ-Sensor Service Pack; Aluminum valve.....			
	34000	62	7		34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Service Pack.....				Service Pack.....			
	20050				20050		
	20050V				20050V		
435i Gran Coupe				435i xDrive Gran Coupe			
2015-2017				2015-2017			
EZ-Sensor; Programmable sensor. Programming				EZ-Sensor; Programmable sensor. Programming			
tool required.....				tool required.....			
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....				EZ-Sensor Service Pack; Aluminum valve.....			
	34000	62	7		34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
440i				440i Gran Coupe			
2017				2017			
EZ-Sensor; Programmable sensor. Programming				EZ-Sensor; Programmable sensor. Programming			
tool required.....				tool required.....			
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....				EZ-Sensor Service Pack; Aluminum valve.....			
	34000	62	7		34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
440i xDrive				440i xDrive Gran Coupe			
2017				2017			
EZ-Sensor; Programmable sensor. Programming				EZ-Sensor; Programmable sensor. Programming			
tool required.....				tool required.....			
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....				EZ-Sensor Service Pack; Aluminum valve.....			
	34000	62	7		34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
525i				525i			
2001				2001			
Service Pack; Does Not Include Valve.....				Service Pack; Does Not Include Valve.....			
	20023	31	3.5		20023	31	3.5
Service Pack; W/43mm Silver Insert.....				Service Pack; W/43mm Silver Insert.....			
	20037	31	3.5		20037	31	3.5
Service Pack; W/48mm Green Insert.....				Service Pack; W/48mm Green Insert.....			
	20038	31	3.5		20038	31	3.5
Service Pack; W/49mm Black Insert.....				Service Pack; W/49mm Black Insert.....			
	20039	31	3.5		20039	31	3.5
Service Pack; W/51mm Orange Insert.....				Service Pack; W/51mm Orange Insert.....			
	20040	31	3.5		20040	31	3.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
525i (cont'd)				528 (cont'd)			
2002				1999-2000			
OE Sensor: BMW - 36118378682				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
EZ-Sensor.....	33000 ^A	11.5	1.3		33700	11.5	1.3
	33200 ^A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
	33700	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Sensor; Includes Transmitter Only.....	20079	35	4	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Sensor; Includes Transmitter Only; W/433 MHz				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Sensor.....	20080	31	3.5	2008			
Service Pack; Does Not Include Valve.....	20023	31	3.5	OE Sensor: BMW - 36236781847			
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Sensor; Includes Transmitter Only.....	20083	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
2003-2005				Service Pack; W/49mm Black Insert.....	20039	31	3.5
OE Sensor: BMW - 36118378682				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
EZ-Sensor.....	33200 ^A	11.5	1.3	2009-2011			
	33500 ^{A, DB}	11.5	1.3	OE Sensor: BMW - 36236781847			
	33700	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; Includes Transmitter Only.....	20080	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5	Sensor; Includes Transmitter Only.....	20083	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
2006-2007				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
OE Sensor: BMW - 36236781847				2012-2014			
Sensor; Includes Transmitter Only.....	20083	31	3.5	OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
Service Pack; Does Not Include Valve.....	20023	31	3.5	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
Service Pack; W/43mm Silver Insert.....	20037	31	3.5		33700	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/49mm Black Insert.....	20039	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Sensor; Includes Transmitter Only.....	28081	40	4.5
525xi				Service Pack; Does Not Include Valve.....	20023	31	3.5
2006-2007				Service Pack; W/43mm Silver Insert.....	20037	31	3.5
OE Sensor: BMW - 36236781847				Service Pack; W/48mm Green Insert.....	20038	31	3.5
Sensor; Includes Transmitter Only.....	20083	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	2015-2016			
Service Pack; W/48mm Green Insert.....	20038	31	3.5	OE Sensor: BMW - 36 10 6 856 872			
Service Pack; W/49mm Black Insert.....	20039	31	3.5	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	31	3.5		33700	11.5	1.3
528				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
1997-1998				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5	Sensor.....	28081	40	4.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5		28126	40	4.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
				Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
528 (cont'd)				530 (cont'd)			
2017-2018				2003-2005			
EZ-Sensor	33500 A, DB	11.5	1.3	OE Sensor: BMW - 36118378682			
	33700	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
528xi				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
2008				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
OE Sensor: BMW - 36236781847				Sensor; Includes Transmitter Only	20080	31	3.5
Sensor; Includes Transmitter Only	20083	31	3.5	Service Pack; Does Not Include Valve	20023	31	3.5
Service Pack; Does Not Include Valve	20023	31	3.5	Service Pack; W/43mm Silver Insert	20037	31	3.5
Service Pack; W/43mm Silver Insert	20037	31	3.5	Service Pack; W/48mm Green Insert	20038	31	3.5
Service Pack; W/48mm Green Insert	20038	31	3.5	Service Pack; W/49mm Black Insert	20039	31	3.5
Service Pack; W/49mm Black Insert	20039	31	3.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
Service Pack; W/51mm Orange Insert	20040	31	3.5	2006-2007			
530				OE Sensor: BMW - 36236781847			
2001				Sensor; Includes Transmitter Only	20083	31	3.5
OE Sensor: BMW - 36118378682				Service Pack; Does Not Include Valve	20023	31	3.5
EZ-Sensor	33200 A	11.5	1.3	Service Pack; W/43mm Silver Insert	20037	31	3.5
	33500 A, DB	11.5	1.3	Service Pack; W/48mm Green Insert	20038	31	3.5
	33700	11.5	1.3	Service Pack; W/49mm Black Insert	20039	31	3.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/51mm Orange Insert	20040	31	3.5
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2017-2018			
Sensor; Includes Transmitter Only	20079	35	4	EZ-Sensor	33500 A, DB	11.5	1.3
Service Pack; Does Not Include Valve	20023	31	3.5		33700	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	31	3.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; W/48mm Green Insert	20038	31	3.5	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; W/49mm Black Insert	20039	31	3.5	530i xDrive			
Service Pack; W/51mm Orange Insert	20040	31	3.5	2017-2018			
2002				EZ-Sensor	33500 A, DB	11.5	1.3
OE Sensor: BMW - 36118378682					33700	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33200 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	535			
	33700	11.5	1.3	2008-2010			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: BMW - 36236781847			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor; Includes Transmitter Only	20083	31	3.5
Sensor; Includes Transmitter Only	20079	35	4	Service Pack; Does Not Include Valve	20023	31	3.5
Sensor; Includes Transmitter Only; W/433 MHz				Service Pack; W/43mm Silver Insert	20037	31	3.5
Sensor	20080	31	3.5	Service Pack; W/48mm Green Insert	20038	31	3.5
Service Pack; Does Not Include Valve	20023	31	3.5	Service Pack; W/49mm Black Insert	20039	31	3.5
Service Pack; W/43mm Silver Insert	20037	31	3.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
Service Pack; W/48mm Green Insert	20038	31	3.5	2011			
Service Pack; W/49mm Black Insert	20039	31	3.5	OE Sensor: BMW - 36 10 6 790 054, 36236781847			
Service Pack; W/51mm Orange Insert	20040	31	3.5	EZ-Sensor	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor; Includes Transmitter Only	20083	31	3.5
					28081	40	4.5
				Service Pack; Does Not Include Valve	20023	31	3.5
				Service Pack; W/43mm Silver Insert	20037	31	3.5
				Service Pack; W/48mm Green Insert	20038	31	3.5
				Service Pack; W/49mm Black Insert	20039	31	3.5
				Service Pack; W/51mm Orange Insert	20040	31	3.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
535 (cont'd)				535d (cont'd)			
2012-2014				2017-2018			
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227				EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3			
EZ-Sensor..... 33700 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				Sensor; Includes Transmitter Only..... 28081 40 4.5			
Sensor; Includes Transmitter Only..... 28081 40 4.5				Service Pack; Does Not Include Valve..... 20023 31 3.5			
Service Pack; Does Not Include Valve..... 20023 31 3.5				Service Pack; W/43mm Silver Insert..... 20037 31 3.5			
Service Pack; W/43mm Silver Insert..... 20037 31 3.5				Service Pack; W/48mm Green Insert..... 20038 31 3.5			
Service Pack; W/48mm Green Insert..... 20038 31 3.5				Service Pack; W/49mm Black Insert..... 20039 31 3.5			
Service Pack; W/49mm Black Insert..... 20039 31 3.5				Service Pack; W/51mm Orange Insert..... 20040 31 3.5			
Service Pack; W/51mm Orange Insert..... 20040 31 3.5							
2015-2016				535d xDrive			
OE Sensor: BMW - 36 10 6 856 872				2014			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				OE Sensor: BMW - 36 10 6 856 227			
EZ-Sensor..... 33700 11.5 1.3				EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				EZ-Sensor..... 33700 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
Sensor..... 28126 40 4.5				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
Sensor..... 28126 40 4.5				Sensor; Includes Transmitter Only..... 28081 40 4.5			
Service Pack; Does Not Include Valve..... 20023 31 3.5				Service Pack; Does Not Include Valve..... 20023 31 3.5			
Service Pack; Does Not Include Valve..... 20023 31 3.5				Service Pack; W/43mm Silver Insert..... 20037 31 3.5			
Service Pack; W/43mm Silver Insert..... 20037 31 3.5				Service Pack; W/48mm Green Insert..... 20038 31 3.5			
Service Pack; W/48mm Green Insert..... 20038 31 3.5				Service Pack; W/49mm Black Insert..... 20039 31 3.5			
Service Pack; W/49mm Black Insert..... 20039 31 3.5				Service Pack; W/51mm Orange Insert..... 20040 31 3.5			
Service Pack; W/51mm Orange Insert..... 20040 31 3.5							
2017-2018				2015-2016			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				OE Sensor: BMW - 36 10 6 856 872			
EZ-Sensor..... 33700 11.5 1.3				EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				EZ-Sensor..... 33700 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
Sensor..... 28126 40 4.5				Sensor..... 28126 40 4.5			
Sensor..... 28126 40 4.5				Service Pack; Does Not Include Valve..... 20023 31 3.5			
Service Pack; Does Not Include Valve..... 20023 31 3.5				Service Pack; W/43mm Silver Insert..... 20037 31 3.5			
Service Pack; W/43mm Silver Insert..... 20037 31 3.5				Service Pack; W/48mm Green Insert..... 20038 31 3.5			
Service Pack; W/48mm Green Insert..... 20038 31 3.5				Service Pack; W/49mm Black Insert..... 20039 31 3.5			
Service Pack; W/49mm Black Insert..... 20039 31 3.5				Service Pack; W/51mm Orange Insert..... 20040 31 3.5			
Service Pack; W/51mm Orange Insert..... 20040 31 3.5							
535d				2017-2018			
2014				EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3			
OE Sensor: BMW - 36 10 6 856 227				EZ-Sensor..... 33700 11.5 1.3			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
EZ-Sensor..... 33700 11.5 1.3				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				Sensor..... 28126 40 4.5			
Sensor; Includes Transmitter Only..... 28081 40 4.5				Sensor..... 28126 40 4.5			
Sensor; Includes Transmitter Only..... 28081 40 4.5				Service Pack; Does Not Include Valve..... 20023 31 3.5			
Service Pack; Does Not Include Valve..... 20023 31 3.5				Service Pack; W/43mm Silver Insert..... 20037 31 3.5			
Service Pack; Does Not Include Valve..... 20023 31 3.5				Service Pack; W/48mm Green Insert..... 20038 31 3.5			
Service Pack; W/43mm Silver Insert..... 20037 31 3.5				Service Pack; W/49mm Black Insert..... 20039 31 3.5			
Service Pack; W/48mm Green Insert..... 20038 31 3.5				Service Pack; W/51mm Orange Insert..... 20040 31 3.5			
Service Pack; W/49mm Black Insert..... 20039 31 3.5							
Service Pack; W/51mm Orange Insert..... 20040 31 3.5							
2015-2016				535xi			
OE Sensor: BMW - 36 10 6 856 872				2008			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				OE Sensor: BMW - 36236781847			
EZ-Sensor..... 33700 11.5 1.3				Sensor; Includes Transmitter Only..... 20083 31 3.5			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				Service Pack; Does Not Include Valve..... 20023 31 3.5			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				Service Pack; Does Not Include Valve..... 20023 31 3.5			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				Service Pack; W/43mm Silver Insert..... 20037 31 3.5			
Sensor..... 28126 40 4.5				Service Pack; W/43mm Silver Insert..... 20037 31 3.5			
Sensor..... 28126 40 4.5				Service Pack; W/48mm Green Insert..... 20038 31 3.5			
Service Pack; Does Not Include Valve..... 20023 31 3.5				Service Pack; W/48mm Green Insert..... 20038 31 3.5			
Service Pack; Does Not Include Valve..... 20023 31 3.5				Service Pack; W/49mm Black Insert..... 20039 31 3.5			
Service Pack; W/43mm Silver Insert..... 20037 31 3.5				Service Pack; W/49mm Black Insert..... 20039 31 3.5			
Service Pack; W/48mm Green Insert..... 20038 31 3.5				Service Pack; W/51mm Orange Insert..... 20040 31 3.5			
Service Pack; W/49mm Black Insert..... 20039 31 3.5							
Service Pack; W/51mm Orange Insert..... 20040 31 3.5							
540i				1997-1998			
1997-1998				Service Pack; Does Not Include Valve..... 20023 31 3.5			
Service Pack; Does Not Include Valve..... 20023 31 3.5				Service Pack; W/43mm Silver Insert..... 20037 31 3.5			
Service Pack; W/43mm Silver Insert..... 20037 31 3.5				Service Pack; W/48mm Green Insert..... 20038 31 3.5			
Service Pack; W/48mm Green Insert..... 20038 31 3.5				Service Pack; W/49mm Black Insert..... 20039 31 3.5			
Service Pack; W/49mm Black Insert..... 20039 31 3.5				Service Pack; W/51mm Orange Insert..... 20040 31 3.5			
Service Pack; W/51mm Orange Insert..... 20040 31 3.5							

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
540i (cont'd)				540i (cont'd)			
1999-2000				2012-2016			
EZ-Sensor.	33500 A, DB	11.5	1.3	EZ-Sensor.	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Service Pack; Does Not Include Valve.	20023	31	3.5	Service Pack; Does Not Include Valve.	20023	31	3.5
Service Pack; W/43mm Silver Insert.	20037	31	3.5	Service Pack; W/43mm Silver Insert.	20037	31	3.5
Service Pack; W/48mm Green Insert.	20038	31	3.5	Service Pack; W/48mm Green Insert.	20038	31	3.5
Service Pack; W/49mm Black Insert.	20039	31	3.5	Service Pack; W/49mm Black Insert.	20039	31	3.5
Service Pack; W/51mm Orange Insert.	20040	31	3.5	Service Pack; W/51mm Orange Insert.	20040	31	3.5
2000				2017-2018			
EZ-Sensor.	33000 A	11.5	1.3	EZ-Sensor.	33500 A, DB	11.5	1.3
2001							
Service Pack; Does Not Include Valve.	20023	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Service Pack; W/43mm Silver Insert.	20037	31	3.5	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Service Pack; W/48mm Green Insert.	20038	31	3.5	540i xDrive			
Service Pack; W/49mm Black Insert.	20039	31	3.5	2017-2018			
Service Pack; W/51mm Orange Insert.	20040	31	3.5	EZ-Sensor.	33500 A, DB	11.5	1.3
2002							
OE Sensor: BMW - 36118378682					33700	11.5	1.3
EZ-Sensor.	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
	33200 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	545i			
	33700	11.5	1.3	2004-2005			
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	OE Sensor: BMW - 36118378682			
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor.	33200 A	11.5	1.3
Sensor; Includes Transmitter Only; W/433 MHz					33500 A, DB	11.5	1.3
Sensor.	20080	31	3.5		33700	11.5	1.3
Service Pack; Does Not Include Valve.	20023	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Service Pack; W/43mm Silver Insert.	20037	31	3.5	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Service Pack; W/48mm Green Insert.	20038	31	3.5	Sensor; Includes Transmitter Only.	20080	31	3.5
Service Pack; W/49mm Black Insert.	20039	31	3.5	Service Pack; Does Not Include Valve.	20023	31	3.5
Service Pack; W/51mm Orange Insert.	20040	31	3.5	Service Pack; W/43mm Silver Insert.	20037	31	3.5
2003							
OE Sensor: BMW - 36118378682				Service Pack; W/48mm Green Insert.	20038	31	3.5
EZ-Sensor.	33200 A	11.5	1.3	Service Pack; W/49mm Black Insert.	20039	31	3.5
	33500 A, DB	11.5	1.3	Service Pack; W/51mm Orange Insert.	20040	31	3.5
	33700	11.5	1.3	550			
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	2006-2010			
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	OE Sensor: BMW - 36236781847			
Sensor; Includes Transmitter Only.	20080	31	3.5	Sensor; Includes Transmitter Only.	20083	31	3.5
Service Pack; Does Not Include Valve.	20023	31	3.5	Service Pack; Does Not Include Valve.	20023	31	3.5
Service Pack; W/43mm Silver Insert.	20037	31	3.5	Service Pack; W/43mm Silver Insert.	20037	31	3.5
Service Pack; W/48mm Green Insert.	20038	31	3.5	Service Pack; W/48mm Green Insert.	20038	31	3.5
Service Pack; W/49mm Black Insert.	20039	31	3.5	Service Pack; W/49mm Black Insert.	20039	31	3.5
Service Pack; W/51mm Orange Insert.	20040	31	3.5	Service Pack; W/51mm Orange Insert.	20040	31	3.5
2008-2011							
OE Sensor: BMW - 36236781847							
Sensor.	20083						
Service Pack; Does Not Include Valve.	20023	31	3.5				
Service Pack; W/43mm Silver Insert.	20037	31	3.5				
Service Pack; W/48mm Green Insert.	20038	31	3.5				
Service Pack; W/49mm Black Insert.	20039	31	3.5				
Service Pack; W/51mm Orange Insert.	20040	31	3.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
550 (cont'd)				640 (cont'd)			
2011				2016			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36 10 6 798 872, 36 10 6 856 872			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only.....	20083	31	3.5	Sensor.....	28081	40	4.5
Service Pack; Does Not Include Valve.....	20023	31	3.5		28126	40	4.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5		20037		
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
2012-2014							
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227				Service Pack; W/49mm Black Insert.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3		20039	31	3.5
	33700	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20040		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2017			
Sensor; Includes Transmitter Only.....	28081	40	4.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5		33700	11.5	1.3
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/48mm Green Insert.....	20038	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	31	3.5	645Ci			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	2004-2005			
2015-2016				OE Sensor: BMW - 36118378682			
OE Sensor: BMW - 36 10 6 856 872				Sensor; Includes Transmitter Only.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3		20080	31	3.5
	33700	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Sensor.....	28126	40	4.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	650			
Service Pack; W/48mm Green Insert.....	20038	31	3.5	2006-2010			
Service Pack; W/49mm Black Insert.....	20039	31	3.5	OE Sensor: BMW - 36236781847			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Sensor; Includes Transmitter Only.....			
2017-2018							
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; Does Not Include Valve.....			
	33700	11.5	1.3	Service Pack; W/43mm Silver Insert.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/48mm Green Insert.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/49mm Black Insert.....			
640				Service Pack; W/51mm Orange Insert.....			
2012-2015				2012-2015			
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227				OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only.....	28081	40	4.5	Sensor; Includes Transmitter Only.....	28081	40	4.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
650 (cont'd)				740i (cont'd)			
2016				1999-2001			
OE Sensor: BMW - 36 10 6 798 872				OE Sensor: BMW - 36118378682			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33700	11.5	1.3		33200 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor	28081	40	4.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	28126	40	4.5	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; Does Not Include Valve	20023	31	3.5	Sensor	20080		
Service Pack; W/43mm Silver Insert	20037	31	3.5	Sensor; Includes Transmitter Only	20079	35	4
	20037			Service Pack; Does Not Include Valve	20023	31	3.5
Service Pack; W/48mm Green Insert	20038	31	3.5	Service Pack; W/43mm Silver Insert	20037	31	3.5
	20038			Service Pack; W/48mm Green Insert	20038	31	3.5
Service Pack; W/49mm Black Insert	20039	31	3.5	Service Pack; W/49mm Black Insert	20039	31	3.5
Service Pack; W/51mm Orange Insert	20040	31	3.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
	20040			2002-2003			
2017				EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2011			
650i Gran Coupe xDrive				OE Sensor: BMW - 36236781847			
2016				EZ-Sensor			
OE Sensor: BMW - 36 10 6 798 872				33500 A, DB			
EZ-Sensor	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor; Includes Transmitter Only	28081	31	3.5
Sensor	28126	40	4.5	Service Pack; Does Not Include Valve	20023	31	3.5
Service Pack; Does Not Include Valve	20023	31	3.5	Service Pack; W/43mm Silver Insert	20037	31	3.5
Service Pack; W/43mm Silver Insert	20037			Service Pack; W/48mm Green Insert	20038	31	3.5
Service Pack; W/48mm Green Insert	20038			Service Pack; W/49mm Black Insert	20039	31	3.5
Service Pack; W/49mm Black Insert	20039	31	3.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
Service Pack; W/51mm Orange Insert	20040			2012-2014			
2017				OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
EZ-Sensor	33500 A, DB	11.5	1.3	Sensor; Includes Transmitter Only			
	33700	11.5	1.3	28081			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; Does Not Include Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	20023			
740e xDrive				Service Pack; W/43mm Silver Insert			
2017				20037			
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack; W/48mm Green Insert			
	33700	11.5	1.3	20038			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/49mm Black Insert			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	20039			
740i				Service Pack; W/51mm Orange Insert			
1997-1998				20040			
Service Pack; Does Not Include Valve	20023	31	3.5	2015-2016			
Service Pack; W/43mm Silver Insert	20037	31	3.5	OE Sensor: BMW - 36 10 6 856 227			
Service Pack; W/48mm Green Insert	20038	31	3.5	EZ-Sensor			
Service Pack; W/49mm Black Insert	20039	31	3.5	33500 A, DB			
Service Pack; W/51mm Orange Insert	20040	31	3.5	33700			
				EZ-Sensor Service Pack; Aluminium Valve			
				34000			
				EZ-Sensor Service Pack; Rubber Valve			
				20018 C, T			
				Sensor; Includes Transmitter Only			
				28081			
				Service Pack; Does Not Include Valve			
				20023			
				Service Pack; W/43mm Silver Insert			
				20037			
				Service Pack; W/48mm Green Insert			
				20038			
				Service Pack; W/49mm Black Insert			
				20039			
				Service Pack; W/51mm Orange Insert			
				20040			
				2017			
				EZ-Sensor			
				33500 A, DB			
				33700			
				EZ-Sensor Service Pack; Aluminium Valve			
				34000			
				EZ-Sensor Service Pack; Rubber Valve			
				20018 C, T			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
740i xDrive				740Li			
2017				2011			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: BMW - 36236781847			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
740iL				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
1997-1998				Sensor; Includes Transmitter Only.....	28081	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
1999-2000				2012-2016			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33200 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; Includes Transmitter Only.....	28081	40	4.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
Sensor.....	20080			Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Sensor; Includes Transmitter Only.....	20079	35	4	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	2017			
Service Pack; W/49mm Black Insert.....	20039	31	3.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	31	3.5		33700	11.5	1.3
2001				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: BMW - 36118378682				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3	740Li xDrive			
	33500 A, DB	11.5	1.3	2011-2012			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20080			EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only.....	20079	35	4	2013-2016			
Service Pack; Does Not Include Valve.....	20023	31	3.5	OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	31	3.5		33700	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2002				Sensor; Includes Transmitter Only.....	28081	40	4.5
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
	33700	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/48mm Green Insert.....	20038	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	31	3.5
2007				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
EZ-Sensor.....				2017			
				EZ-Sensor.....	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
745				750 (cont'd)			
2002				2012-2016			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor; Includes Transmitter Only.....	28081	40	4.5
Sensor; Includes Transmitter Only; W/433 MHz				Service Pack; Does Not Include Valve.....	20023	31	3.5
Sensor.....	20080	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5				
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	2015-2016			
2003				OE Sensor: BMW - 36 10 6 856 227			
OE Sensor: BMW - 36118378682				Sensor; Includes Transmitter Only.....	28126	40	4.5
EZ-Sensor.....	33200 A	11.5	1.3	2017			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only.....	20080	31	3.5				
Service Pack; Does Not Include Valve.....	20023	31	3.5	750iL			
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	1997-1998			
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
2004-2005				Service Pack; W/49mm Black Insert.....	20039	31	3.5
OE Sensor: BMW - 36118378682				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Sensor; Includes Transmitter Only.....	20080	31	3.5	1999-2000			
Service Pack; Does Not Include Valve.....	20023	31	3.5	OE Sensor: BMW - 36118378682			
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	EZ-Sensor.....	33200 A	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	31	3.5		33500 A, DB	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	31	3.5		33700	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
750				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2006-2010				Sensor.....	20080		
OE Sensor: BMW - 36236781847				Sensor; Includes Transmitter Only.....	20079	35	4
Sensor; Includes Transmitter Only.....	20083	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	2000			
2011				EZ-Sensor.....	33000 A	11.5	1.3
OE Sensor: BMW - 36236781847							
EZ-Sensor.....	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Sensor; Includes Transmitter Only.....	20083	31	3.5				
	28081	31	3.5				
Service Pack; Does Not Include Valve.....	20023	31	3.5				
Service Pack; W/43mm Silver Insert.....	20037	31	3.5				
Service Pack; W/48mm Green Insert.....	20038	31	3.5				
Service Pack; W/49mm Black Insert.....	20039	31	3.5				
Service Pack; W/51mm Orange Insert.....	20040	31	3.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
750iL (cont'd)				760Li			
2001-2002				2003			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36118378682			
EZ-Sensor.....	33200 ^A	11.5	1.3	EZ-Sensor.....	33200 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	20080			Sensor; Includes Transmitter Only.....	20080	31	3.5
Sensor; Includes Transmitter Only.....	20079	35	4	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5				
2003				2004-2008			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	OE Sensor: BMW - 36236781847			
	33700	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Sensor; Includes Transmitter Only.....	20083	31	3.5
				Service Pack; Does Not Include Valve.....	20023	31	3.5
				Service Pack; W/43mm Silver Insert.....	20037	31	3.5
				Service Pack; W/48mm Green Insert.....	20038	31	3.5
				Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
				2009			
				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				2010			
				OE Sensor: BMW - 36236781847			
				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				Sensor; Includes Transmitter Only.....	20083	31	3.5
				Service Pack; Does Not Include Valve.....	20023	31	3.5
				Service Pack; W/43mm Silver Insert.....	20037	31	3.5
				Service Pack; W/48mm Green Insert.....	20038	31	3.5
				Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
				2011			
				OE Sensor: BMW - 36106856227			
				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				Sensor; Includes Transmitter Only.....	28081	31	3.5
				Service Pack; Does Not Include Valve.....	20023	31	3.5
				Service Pack; W/43mm Silver Insert.....	20037	31	3.5
				Service Pack; W/48mm Green Insert.....	20038	31	3.5
				Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
				2012-2014			
				OE Sensor: BMW - 36 10 6 856 227, 36106856227			
				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				Sensor.....	28081	40	4.5
				Service Pack; Does Not Include Valve.....	20023	31	3.5
				Service Pack; W/43mm Silver Insert.....	20037	31	3.5
				Service Pack; W/48mm Green Insert.....	20038	31	3.5
				Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
760Li (cont'd)				ActiveHybrid 5			
2015				2012-2014			
OE Sensor: BMW - 36106874830				OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
Sensor	28126	40	4.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Does Not Include Valve	20023	31	3.5	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	31	3.5	Sensor; Includes Transmitter Only	28081	40	4.5
Service Pack; W/48mm Green Insert	20038	31	3.5	Service Pack; Does Not Include Valve	20023	31	3.5
Service Pack; W/49mm Black Insert	20039	31	3.5	Service Pack; W/43mm Silver Insert	20037	31	3.5
Service Pack; W/51mm Orange Insert	20040	31	3.5	Service Pack; W/48mm Green Insert	20038	31	3.5
2016				2015			
OE Sensor: BMW - 36106874830				OE Sensor: BMW - 36 10 6 856 227			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	28126	40	4.5	Sensor	28081	40	4.5
Service Pack; Does Not Include Valve	20023	31	3.5	Service Pack; Does Not Include Valve	20023	31	3.5
Service Pack; W/43mm Silver Insert	20037	31	3.5	Service Pack; W/43mm Silver Insert	20037	31	3.5
Service Pack; W/48mm Green Insert	20038	31	3.5	Service Pack; W/48mm Green Insert	20038	31	3.5
Service Pack; W/49mm Black Insert	20039	31	3.5	Service Pack; W/49mm Black Insert	20039	31	3.5
Service Pack; W/51mm Orange Insert	20040	31	3.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
2017				ActiveHybrid 7			
EZ-Sensor	33500 A, DB	11.5	1.3	2013-2015			
	33700	11.5	1.3	OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
ActiveHybrid 3				EZ-Sensor Service Pack; Aluminium Valve			
2013-2014				EZ-Sensor Service Pack; Rubber Valve			
OE Sensor: BMW - 36 10 6 856 227				Sensor; Includes Transmitter Only			
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack; Does Not Include Valve	20023	31	3.5
	33700	11.5	1.3	Service Pack; W/43mm Silver Insert	20037	31	3.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/48mm Green Insert	20038	31	3.5
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; W/49mm Black Insert	20039	31	3.5
Sensor	28081	40	4.5	Service Pack; W/51mm Orange Insert	20040	31	3.5
Service Pack; Does Not Include Valve	20023	31	3.5	Alpina B6 Gran Coupe			
Service Pack; W/43mm Silver Insert	20037	31	3.5	2016-2017			
Service Pack; W/48mm Green Insert	20038	31	3.5	EZ-Sensor			
Service Pack; W/49mm Black Insert	20039	31	3.5		33500 A, DB	11.5	1.3
Service Pack; W/51mm Orange Insert	20040	31	3.5		33700	11.5	1.3
2015				EZ-Sensor Service Pack; Aluminium Valve			
OE Sensor: BMW - 36 10 6 856 227				EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor	33500 A, DB	11.5	1.3	Alpina B6 xDrive Gran Coupe			
	33700	11.5	1.3	2015-2017			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor	28081	40	4.5		33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve			
				EZ-Sensor Service Pack; Rubber Valve			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
Alpina B7				Alpina B7L (cont'd)			
2007-2008				2012-2017			
OE Sensor: BMW - 36236781847				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
Sensor; Includes Transmitter Only.....	20083	31	3.5		33700	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Alpina B7L xDrive			
Service Pack; W/49mm Black Insert.....	20039	31	3.5	2011			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	OE Sensor: BMW - 36118378682			
2011-2015				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
OE Sensor: BMW - 36118378682					33700	11.5	1.3
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; Includes Transmitter Only.....	28081	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
Sensor; Includes Transmitter Only.....	28081	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	2012-2017			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
2016-2017					33700	11.5	1.3
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	i3			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	2013-2017			
Alpina B7 xDrive				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
2011					33700	11.5	1.3
OE Sensor: BMW - 36118378682				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
	33700	11.5	1.3	i8			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2013-2017			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
Sensor; Includes Transmitter Only.....	28081	31	3.5		33700	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	31	3.5	M			
Service Pack; W/49mm Black Insert.....	20039	31	3.5	2000-2001			
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	OE Sensor: BMW - 36118378682			
2012-2017				Sensor; Includes Transmitter Only; W/433 MHz			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	Sensor.....	20080	31	3.5
	33700	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Alpina B7L				Service Pack; W/49mm Black Insert.....	20039	31	3.5
2011				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
OE Sensor: BMW - 36118378682							
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3				
Sensor; Includes Transmitter Only.....	20080	31	3.5				
Service Pack; Does Not Include Valve.....	20023	31	3.5				
Service Pack; W/43mm Silver Insert.....	20037	31	3.5				
Service Pack; W/48mm Green Insert.....	20038	31	3.5				
Service Pack; W/49mm Black Insert.....	20039	31	3.5				
Service Pack; W/51mm Orange Insert.....	20040	31	3.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
M (cont'd)				M (cont'd)			
2002				2013			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36 10 6 856 227, 36236798726			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor; Includes Transmitter Only.....	20083	40	4.5
Sensor; Includes Transmitter Only; W/433 MHz					28081	40	4.5
Sensor.....	20080	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; Does Not Include Valve.....	20023	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/51mm Orange Insert.....	20040	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5				
2003				2014			
OE Sensor: BMW - 36118378682				OE Sensor: BMW - 36 10 6 856 227			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor; Programmable sensor. Programming tool required.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; Includes Transmitter Only.....	20080	31	3.5	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
Sensor; Includes Transmitter Only; W/433 MHz				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20080	31	3.5		20018 C, T	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5	Sensor; Includes Transmitter Only.....	28081	40	4.5
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	Service Pack; Does Not Include Valve.....	20023	31	3.5
Service Pack; W/48mm Green Insert.....	20038	31	3.5	Service Pack; W/43mm Silver Insert.....	20037	31	3.5
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Service Pack; W/48mm Green Insert.....	20038	31	3.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Service Pack; W/49mm Black Insert.....	20039	31	3.5
				Service Pack; W/51mm Orange Insert.....	20040	31	3.5
2004-2010				2015-2016			
OE Sensor: BMW - 36236781847				OE Sensor: BMW - 36 10 6 798 872, 36 10 6 856 227, 36106874830			
Sensor; Includes Transmitter Only.....	20083	31	3.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31	3.5		33700	11.5	1.3
Service Pack; W/43mm Silver Insert.....	20037	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/48mm Green Insert.....	20038	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	31	3.5	Sensor.....	28126	40	4.5
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Sensor; Includes Transmitter Only.....	28126	40	4.5
				Service Pack; Does Not Include Valve.....	20023	31	3.5
2010				2016			
OE Sensor: BMW - 36236798726				OE Sensor: BMW - 36 10 6 798 872			
Sensor; Includes Transmitter Only.....	20083	40	4.5	Sensor; Includes Transmitter Only.....	28126	35	4
2011-2012				2017			
OE Sensor: BMW - 36 10 6 856 227, 36236781847, 36236798726				OE Sensor: BMW - 36 10 6 798 872			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only.....	20083	40	4.5	Sensor; Includes Transmitter Only.....	28126	35	4
	20083	31	3.5				
	28081	40	4.5	OE Sensor: BMW - 36 10 6 798 872			
Service Pack; Does Not Include Valve.....	20023	31	3.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/43mm Silver Insert.....	20037	31	3.5		33700	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/49mm Black Insert.....	20039	31	3.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	31	3.5	Sensor; Includes Transmitter Only.....	28126	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
X				X (cont'd)			
1999-2004				2011			
OE Sensor: BMW - 36146752128				OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227, 36106856227, 36236781847			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor; Programmable sensor. Programming tool required.....	33500 ^{A, DB}	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3		33700	11.5	1.3
Sensor; Includes Transmitter Only.....	28082	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Does Not Include Valve.....	20023	35	4	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
Service Pack; W/43mm Silver Insert.....	20037	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	35	4		20018 ^{C, T}	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	35	4	Sensor.....	20081		
Service Pack; W/51mm Orange Insert.....	20040	35	4		28081		
2000-2004				Sensor; Includes Transmitter Only.....			
EZ-Sensor.....	33200 ^A	11.5	1.3		20083	35	4
2005-2007				Service Pack; Does Not Include Valve.....			
OE Sensor: BMW - 36236781847				20023			
Sensor; Includes Transmitter Only.....	20083	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; Does Not Include Valve.....	20023	35	4		20037	31	3.5
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4		20038	31	3.5
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4		20039	31	3.5
2008-2010				Service Pack; W/51mm Orange Insert.....			
OE Sensor: BMW - 36236781847				20040			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3		20040	35	4
	33700	11.5	1.3		20040	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2012-2014			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
Sensor; Includes Transmitter Only.....	20083	35	4	EZ-Sensor.....			
Service Pack; Does Not Include Valve.....	20023	35	4	33500 ^{A, DB}			
Service Pack; W/43mm Silver Insert.....	20037	35	4	33700			
Service Pack; W/48mm Green Insert.....	20038	35	4	EZ-Sensor; Programmable sensor. Programming tool required.....			
Service Pack; W/49mm Black Insert.....	20039	35	4	33500 ^{A, DB}			
Service Pack; W/51mm Orange Insert.....	20040	35	4	33700			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				34000			
				EZ-Sensor Service Pack; Aluminum valve.....			
				34000			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 ^{C, T}			
				20018 ^{C, T}			
				Sensor; Includes Transmitter Only.....			
				28081			
				Service Pack; Does Not Include Valve.....			
				20023			
				Service Pack; W/43mm Silver Insert.....			
				20037			
				Service Pack; W/48mm Green Insert.....			
				20038			
				Service Pack; W/49mm Black Insert.....			
				20039			
				Service Pack; W/51mm Orange Insert.....			
				20040			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				BMW (cont'd)			
X (cont'd)				Z3			
2015				2000-2002			
OE Sensor: BMW - 36 10 6 798 872, 36 10 6 856 227, 36106874830				Service Pack; Does Not Include Valve.	20023	31	3.5
EZ-Sensor.	33500 A, DB	11.5	1.3	Service Pack; W/43mm Silver Insert.	20037	31	3.5
	33700	11.5	1.3	Service Pack; W/48mm Green Insert.	20038	31	3.5
EZ-Sensor; Programmable sensor. Programming tool required.	33500 A, DB	11.5	1.3	Service Pack; W/49mm Black Insert.	20039	31	3.5
	33700	11.5	1.3	Service Pack; W/51mm Orange Insert.	20040	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Z4			
EZ-Sensor Service Pack; Aluminum valve.	34000	62	7	2003-2010			
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	OE Sensor: BMW - 36236781847			
	20018 C, T	11.5	1.3	Sensor; Includes Transmitter Only.	20083	31	3.5
Sensor.	28126	35	4	Service Pack; Does Not Include Valve.	20023	31	3.5
Sensor; Includes Transmitter Only.	28081	40	4.5	Service Pack; W/43mm Silver Insert.	20037	31	3.5
	28126	40	4.5	Service Pack; W/48mm Green Insert.	20038	31	3.5
Service Pack; Does Not Include Valve.	20023	31	3.5	Service Pack; W/49mm Black Insert.	20039	31	3.5
Service Pack; W/43mm Silver Insert.	20037	31	3.5	Service Pack; W/51mm Orange Insert.	20040	31	3.5
Service Pack; W/48mm Green Insert.	20038	31	3.5	2011			
Service Pack; W/49mm Black Insert.	20039	31	3.5	OE Sensor: BMW - 36236781847			
Service Pack; W/51mm Orange Insert.	20040	31	3.5	EZ-Sensor.	33500 A, DB	11.5	1.3
2016					33700	11.5	1.3
OE Sensor: BMW - 36 10 6 798 872, 36 10 6 856 872, 36106874830				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor.	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor; Includes Transmitter Only.	20083	31	3.5
EZ-Sensor; Programmable sensor. Programming tool required.	33500 A, DB	11.5	1.3	Service Pack; Does Not Include Valve.	20023	31	3.5
	33700	11.5	1.3	Service Pack; W/43mm Silver Insert.	20037	31	3.5
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Service Pack; W/48mm Green Insert.	20038	31	3.5
EZ-Sensor Service Pack; Aluminum valve.	34000	62	7	Service Pack; W/49mm Black Insert.	20039	31	3.5
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Service Pack; W/51mm Orange Insert.	20040	31	3.5
	20018 C, T	11.5	1.3	2012-2015			
Sensor.	28081	40	4.5	OE Sensor: BMW - 36 10 6 790 054, 36 10 6 856 227			
	28126	35	4	EZ-Sensor.	33500 A, DB	11.5	1.3
Sensor; Includes Transmitter Only.	28126	40	4.5		33700	11.5	1.3
Service Pack; Does Not Include Valve.	20023	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Service Pack; W/43mm Silver Insert.	20037	31	3.5	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Service Pack; W/48mm Green Insert.	20038	31	3.5	Sensor; Includes Transmitter Only.	28081	40	4.5
Service Pack; W/49mm Black Insert.	20039	31	3.5	Service Pack; Does Not Include Valve.	20023	31	3.5
Service Pack; W/51mm Orange Insert.	20040	31	3.5	Service Pack; W/43mm Silver Insert.	20037	31	3.5
2017				Service Pack; W/48mm Green Insert.	20038	31	3.5
EZ-Sensor.	33500 A, DB	11.5	1.3	Service Pack; W/49mm Black Insert.	20039	31	3.5
	33700	11.5	1.3	Service Pack; W/51mm Orange Insert.	20040	31	3.5
EZ-Sensor; Programmable sensor. Programming tool required.	33500 A, DB	11.5	1.3	2016			
	33700	11.5	1.3	OE Sensor: BMW - 36 10 6 856 872			
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor.	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
X4				Sensor.	28081	40	4.5
2015-2017				Service Pack; Does Not Include Valve.	20023	31	3.5
EZ-Sensor; Programmable sensor. Programming tool required.	33500 A, DB	11.5	1.3	Service Pack; W/43mm Silver Insert.	20037	31	3.5
	33700	11.5	1.3	Service Pack; W/48mm Green Insert.	20038	31	3.5
EZ-Sensor Service Pack; Aluminum valve.	34000	62	7	Service Pack; W/49mm Black Insert.	20039	31	3.5
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Service Pack; W/51mm Orange Insert.	20040	31	3.5
				2017			
				EZ-Sensor.	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
BMW (cont'd)				Buick (cont'd)			
Z8				Allure (cont'd)			
2000-2002				2010			
Service Pack; Does Not Include Valve.	20023	31	3.5	OE Sensor: General Motors - 12768826			
Service Pack; W/43mm Silver Insert.	20037	31	3.5	EZ-Sensor.	33000 A	11.5	1.3
Service Pack; W/48mm Green Insert.	20038	31	3.5		33500 A, DB	11.5	1.3
Service Pack; W/49mm Black Insert.	20039	31	3.5		33700	11.5	1.3
Service Pack; W/51mm Orange Insert.	20040	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
2003				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
OE Sensor: BMW - 36118378682				Sensor.	28206	11.5	1.3
Sensor; Includes Transmitter Only; W/433 MHz				Service Pack.	20008 C, N	11.5	1.3
Sensor.	20080	31	3.5		20018 C, T	11.5	1.3
Service Pack; Does Not Include Valve.	20023	31	3.5	2011			
Service Pack; W/43mm Silver Insert.	20037	31	3.5	EZ-Sensor.	33500 A, DB	11.5	1.3
Service Pack; W/48mm Green Insert.	20038	31	3.5		33700	11.5	1.3
Service Pack; W/49mm Black Insert.	20039	31	3.5	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Service Pack; W/51mm Orange Insert.	20040	31	3.5	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Bugatti				Cascade			
Veyron 16.4				2016-2017			
2006				OE Sensor: General Motors - 12768826, 13581558			
Service Pack; Does Not Include Valve.	20023	35	4	EZ-Sensor.	33500 A, DB	11.5	1.3
Service Pack; W/43mm Silver Insert.	20037	35	4		33700	11.5	1.3
Service Pack; W/48mm Green Insert.	20038	35	4	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Service Pack; W/49mm Black Insert.	20039	35	4	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Service Pack; W/51mm Orange Insert.	20040	35	4	Sensor.	28206	11.5	1.3
Buick				Service Pack.	20008 C, N	11.5	1.3
Allure					20018 C, T	11.5	1.3
2006				2018			
Sensor.	INDIRECT D			OE Sensor: General Motors - 13598787			
2007-2008				EZ-Sensor.	33500 A, DB	11.5	1.3
OE Sensor: General Motors - 10394110, 15921013					33700	11.5	1.3
EZ-Sensor.	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.	28211		
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Service Pack.	20047 O	71	8
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3		20049 U	71	8
Sensor.	20158	62	7	Century			
Service Pack; W/Schrader Sensor.	20004 P	62	7	1999-2005			
Service Pack; W/Siemens Sensor.	20030	80	9	Sensor.			
2009				INDIRECT D			
OE Sensor: General Motors - 25920615				Enclave			
EZ-Sensor.	33000 A	11.5	1.3	2008			
	33500 A, DB	11.5	1.3	OE Sensor: General Motors - 15921013			
	33700	11.5	1.3	EZ-Sensor.			
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7		33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.	20153	11.5	1.3		33700	11.5	1.3
Service Pack.	20008 C, N	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
				Sensor.	20158	62	7
				Service Pack; W/Schrader Sensor.	20004 P	62	7
				Service Pack; W/Siemens Sensor.	20030	80	9

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
N-Use until depleted, replaced by 20018 O-Use until depleted, replaced by 20049 P-Interchanges with 20002 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Buick (cont'd)				Buick (cont'd)			
Enclave (cont'd)				Envision			
2009-2015				2016-2018			
OE Sensor: General Motors - 13598771, 20923680, 22853741, 25920615				OE Sensor: General Motors - 13598772			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28206	11.5	1.3
Sensor	20153	11.5	1.3	Service Pack	20008 C, N	11.5	1.3
Service Pack	20008 C, N	11.5	1.3		20018 C, T	11.5	1.3
	20018 C, T	11.5	1.3	LaCrosse			
2016				2006			
OE Sensor: General Motors - 13598771				OE Sensor: General Motors - 15268606			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20153	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack	20008 C, N	11.5	1.3	Sensor	20158	62	7
	20018 C, T	11.5	1.3	Service Pack; W/Schrader Sensor	20004 P	62	7
2017-2018				2007-2008			
OE Sensor: General Motors - 13516165, 13598771, 13598773				OE Sensor: General Motors - 10394110, 15921013			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	29015	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack	20008 C, N	11.5	1.3	Sensor	20158	62	7
	20018 C, T	11.5	1.3	Service Pack; W/Schrader Sensor	20004 P	62	7
				Service Pack; W/Siemens Sensor			
				20030			
				2009			
				OE Sensor: General Motors - 25920615			
				EZ-Sensor			
				33000 A			
				33500 A, DB			
				33700			
				EZ-Sensor Service Pack; Aluminium Valve			
				34000			
				EZ-Sensor Service Pack; Rubber Valve			
				20018 C, T			
				Sensor			
				20153			
				Service Pack			
				20008 C, N			
				20018 C, T			
				20018 C, T			
				2010-2015			
				OE Sensor: General Motors - 12768826, 20922900, 22854866			
				EZ-Sensor			
				33000 A			
				33500 A, DB			
				33700			
				EZ-Sensor Service Pack; Aluminium Valve			
				34000			
				EZ-Sensor Service Pack; Rubber Valve			
				20018 C, T			
				Sensor			
				28206			
				Service Pack			
				20008 C, N			
				20018 C, T			
				20018 C, T			
Encore							
2013-2015							
OE Sensor: General Motors - 22854866							
EZ-Sensor	33000 A	11.5	1.3				
	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3				
Sensor	28206	11.5	1.3				
Service Pack	20008 C, N	11.5	1.3				
	20018 C, T	11.5	1.3				
2016-2018							
OE Sensor: General Motors - 12768826, 13598772							
EZ-Sensor	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3				
Sensor	28206	11.5	1.3				
Service Pack	20008 C, N	11.5	1.3				
	20018 C, T	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Buick (cont'd)				Buick (cont'd)			
LaCrosse (cont'd)				Regal			
2016				1999-2004			
OE Sensor: General Motors - 13598772				Sensor.....	INDIRECT ^D		
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	2011-2016			
	33700	11.5	1.3	OE Sensor: General Motors - 12768826, 13598772, 22854866			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33000 ^A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
Sensor.....	28206	11.5	1.3		33700	11.5	1.3
Service Pack.....	20008 ^{C, N}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
2017-2018				Sensor.....	28206	11.5	1.3
OE Sensor: General Motors - 13598773				Service Pack.....	20008 ^{C, N}	11.5	1.3
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3		20018 ^{C, T}	11.5	1.3
	33700	11.5	1.3	2017			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: General Motors - 13598772			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
Sensor; Exc. ZL1.....	29015	11.5	1.3		33700	11.5	1.3
Service Pack; Exc. ZL1.....	20008 ^{C, N}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Sensor.....	28206	11.5	1.3
LeSabre				Service Pack.....	20008 ^{C, N}	11.5	1.3
2000-2005					20018 ^{C, T}	11.5	1.3
Sensor.....	INDIRECT ^D			2018			
2007				OE Sensor: General Motors - 13598773			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Sensor; Exc. ZL1.....	29015	11.5	1.3
Lucerne				Service Pack.....	20008 ^{C, N}	11.5	1.3
2007-2011					20018 ^{C, T}	11.5	1.3
OE Sensor: General Motors - 15254101, 15922396, 25799331, 25920615				Rendezvous			
EZ-Sensor.....	33000 ^A	11.5	1.3	2003-2007			
	33500 ^{A, DB}	11.5	1.3	Sensor.....	INDIRECT ^D		
	33700	11.5	1.3	Verano			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2012-2015			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	OE Sensor: General Motors - 12768826, 13581558, 22854866			
Sensor.....	20153	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
Service Pack.....	20008 ^{C, N}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	20018 ^{C, T}	11.5	1.3		33700	11.5	1.3
Park Avenue				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
1998-2005				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	INDIRECT ^D			Sensor.....	28206	11.5	1.3
Rainier				Service Pack.....	20008 ^{C, N}	11.5	1.3
2006-2007					20018 ^{C, T}	11.5	1.3
OE Sensor: General Motors - 25774006				2016-2018			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	OE Sensor: General Motors - 13598772			
	33700	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; OEM Part No. 25774006.....	20116	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Service Pack.....	20004 ^P	62	7	Sensor.....	28206	11.5	1.3
				Service Pack.....	20008 ^{C, N}	11.5	1.3
					20018 ^{C, T}	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
N-Use until depleted, replaced by 20018 P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Cadillac				Cadillac (cont'd)			
ATS				ATS-V			
2013				2017-2018			
OE Sensor: General Motors - 22959744				OE Sensor: General Motors - 13598786			
EZ-Sensor; For ATS-V, When installing				EZ-Sensor; For ATS-V, When installing			
EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit				EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit			
34000.....	33000 A	11.5	1.3	34000.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; exc V; Rubber Valve....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; exc V; Rubber Valve....	20018 C, T	11.5	1.3	Sensor.....	28423		
Sensor; exc V.....	28206	11.5	1.3	Service Pack.....	20004 P		
Service Pack; exc V.....	20008 C, N	11.5	1.3				
	20018 C, T	11.5	1.3				
2014				CT6			
2016				2016			
OE Sensor: General Motors - 13581558, 20964159				OE Sensor: General Motors - 13598773			
EZ-Sensor; For ATS-V, When installing				EZ-Sensor; For ATS-V, When installing			
EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit				EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit			
34000.....	33000 A	11.5	1.3	34000.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; exc V; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; exc V; Rubber Valve....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; exc V; Rubber Valve....	20018 C, T	11.5	1.3	Sensor; Exc. ZL1.....	20154	11.5	1.3
Sensor; exc V.....	28206	11.5	1.3	Service Pack; Exc. ZL1.....	20008 C, N	11.5	1.3
Sensor; V.....	28423	62	7		20018 C, T	11.5	1.3
Service Pack; exc V.....	20008 C, N	11.5	1.3				
	20018 C, T	11.5	1.3				
Service Pack; V.....	20004 P	62	7				
2015				2017-2018			
OE Sensor: General Motors - 13581558, 20964159				OE Sensor: General Motors - 13598773			
EZ-Sensor; For ATS-V, When installing				EZ-Sensor; For ATS-V, When installing			
EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit				EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit			
34000.....	33000 A	11.5	1.3	34000.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; exc V; Rubber Valve....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; exc V; Rubber Valve....	20018 C, T	11.5	1.3	Sensor; Exc. ZL1.....	29015	11.5	1.3
Sensor; exc V.....	28206	11.5	1.3	Service Pack; Exc. ZL1.....	20008 C, N	11.5	1.3
Sensor; V.....	28423	62	7		20018 C, T	11.5	1.3
Service Pack; exc V.....	20008 C, N	11.5	1.3				
	20018 C, T	11.5	1.3				
Service Pack; V.....	20004 P	62	7				
2016-2018				CTS			
2004-2007				2004-2007			
OE Sensor: General Motors - 13598772				OE Sensor: General Motors - 25774006			
EZ-Sensor; For ATS-V, When installing				EZ-Sensor; For CTS-V, When installing			
EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit				EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit			
34000.....	33500 A, DB	11.5	1.3	34000.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; exc V; Rubber Valve....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; exc V; Rubber Valve....	20018 C, T	11.5	1.3
Sensor; exc V.....	28206	11.5	1.3	Sensor.....	20116	62	7
Service Pack; exc V.....	20008 C, N	11.5	1.3	Service Pack.....	20004 P	62	7
	20018 C, T	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Cadillac (cont'd)				Cadillac (cont'd)			
CTS (cont'd)				CTS (cont'd)			
2008				2013			
OE Sensor: General Motors - 25920615				OE Sensor: General Motors - 20925924, 22853741			
EZ-Sensor; For CTS-V, When installing				EZ-Sensor; For CTS-V, When installing			
EZ-Sensor the rubber valve MUST be removed				EZ-Sensor the rubber valve MUST be removed			
and replaced with Schrader Aluminium valve kit				and replaced with Schrader Aluminium valve kit			
34000	33000 A	11.5	1.3	34000	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; exc V; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; exc V; Rubber Valve	20018 C, T	11.5	1.3
Sensor	20153	11.5	1.3	Sensor; OEM Part No. 15268606; CTS V; W/315	20158	62	7
Service Pack	20008 C, N	11.5	1.3	MHz Sensor	20153	11.5	1.3
	20018 C, T	11.5	1.3	Sensor; OEM Part No. 25920615; Exc. CTS V	20153	11.5	1.3
2009-2011				2014-2015			
OE Sensor: General Motors - 15268606, 15922396, 25920615				OE Sensor: General Motors - 13581558, 13581559, 20964159			
EZ-Sensor; For CTS-V, When installing				EZ-Sensor; For CTS-V, When installing			
EZ-Sensor the rubber valve MUST be removed				EZ-Sensor the rubber valve MUST be removed			
and replaced with Schrader Aluminium valve kit				and replaced with Schrader Aluminium valve kit			
34000	33000 A	11.5	1.3	34000	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; exc V; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; exc V; Rubber Valve	20018 C, T	11.5	1.3
Sensor; OEM Part No. 15268606; CTS V; W/315	20158	62	7	Sensor; exc V	28206	11.5	1.3
MHz Sensor	20153	11.5	1.3	Sensor; V	28423	62	7
Sensor; OEM Part No. 25920615; Exc. CTS V	20153	11.5	1.3	Service Pack; exc V	20008 C, N	11.5	1.3
Service Pack; OEM Part No. 15268606; CTS V;	20004 P	62	7		20018 C, T	11.5	1.3
W/315 MHz Sensor	20004 P	62	7	Service Pack; V	20004 P	62	7
Service Pack; OEM Part No. 25920615; Exc. CTS	20008 C, N	11.5	1.3	2016-2018			
V	20018 C, T	11.5	1.3	OE Sensor: General Motors - 13598772			
2012				EZ-Sensor; For CTS-V, When installing			
OE Sensor: General Motors - 20923680, 20925924				EZ-Sensor the rubber valve MUST be removed			
EZ-Sensor; For CTS-V, When installing				and replaced with Schrader Aluminium valve kit			
EZ-Sensor the rubber valve MUST be removed				34000	33000 A	11.5	1.3
and replaced with Schrader Aluminium valve kit					33500 A, DB	11.5	1.3
34000	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; exc V; Aluminium Valve	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; exc V; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; exc V; Aluminium Valve	34000	62	7	Sensor; OEM Part No. 15268606; CTS V; W/315	20158	62	7
EZ-Sensor Service Pack; exc V; Rubber Valve	20018 C, T	11.5	1.3	MHz Sensor	20153	11.5	1.3
Sensor; OEM Part No. 15268606; CTS V; W/315	20158	62	7	Sensor; OEM Part No. 25920615; Exc. CTS V	20153	11.5	1.3
MHz Sensor	20153	11.5	1.3	Service Pack; OEM Part No. 15268606; CTS V;	20004 P	62	7
Sensor; OEM Part No. 25920615; Exc. CTS V	20153	11.5	1.3	W/315 MHz Sensor	20004 P	62	7
Service Pack; OEM Part No. 15268606; CTS V;	20004 P	62	7	Service Pack; OEM Part No. 25920615; Exc. CTS	20008 C, N	11.5	1.3
W/315 MHz Sensor	20004 P	62	7	V	20018 C, T	11.5	1.3
Service Pack; OEM Part No. 25920615; Exc. CTS	20008 C, N	11.5	1.3	DeVile			
V	20018 C, T	11.5	1.3	2001-2005			
				OE Sensor: General Motors - 25773946			
				EZ-Sensor; For CTS-V, When installing			
				EZ-Sensor the rubber valve MUST be removed			
				and replaced with Schrader Aluminium valve kit			
				34000	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; exc V; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	20117 B	62	7
				Service Pack	20003 F	62	7
					20007 V	62	7

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 N-Use until depleted, replaced by 20018 P-Interchanges with 20002 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Cadillac (cont'd)				Cadillac (cont'd)			
DTS				Escalade (cont'd)			
2006				2005-2006			
OE Sensor: General Motors - 15268606				OE Sensor: General Motors - 15114379			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	20158	62	7	Sensor	20107	62	7
Service Pack	20004 P	62	7	Service Pack	20004 P	62	7
2007-2011				2007			
OE Sensor: General Motors - 15254101, 15922396, 20923680, 25799331, 25920615				OE Sensor: General Motors - 15825475, 25799331			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	20153	11.5	1.3	Sensor; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem	20158	62	7
Service Pack	20008 C, N	11.5	1.3	Sensor; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem	20153	11.5	1.3
	20018 C, T	11.5	1.3	Service Pack; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem	20007 V	80	9
ELR				Service Pack; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem			
2014				20015 H			
OE Sensor: General Motors - 22854866				20008 C, N			
EZ-Sensor	33000 A	11.5	1.3	20018 C, T	11.5	1.3	
	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2008			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	OE Sensor: General Motors - 25799331			
Sensor	28206	11.5	1.3	EZ-Sensor			
Service Pack	20008 C, N	11.5	1.3	33000 A			
	20018 C, T	11.5	1.3	33500 A, DB			
2015-2017				33700			
OE Sensor: General Motors - 12768826, 13598772				34000			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve			
	34000	62	7	Sensor; OEM Part No. 25799331; OEM Part No. 15922396			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	20153			
Sensor	28206	11.5	1.3	20008 C, N			
Service Pack	20008 C, N	11.5	1.3	20018 C, T			
	20018 C, T	11.5	1.3	2009-2011			
Escalade				OE Sensor: General Motors - 15922396, 20923680, 25920615			
2004				EZ-Sensor			
OE Sensor: General Motors - 15136883				33000 A			
EZ-Sensor	33000 A	11.5	1.3	33500 A, DB			
	33500 A, DB	11.5	1.3	33700			
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor			
Sensor	20115	62	7	Service Pack			
Service Pack	20004 P	62	7	20008 C, N			
				20018 C, T			
				2011			
				Service Pack			
				20008 C, N			
				20018 C, T			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 H-Use until depleted, replaced by 20007
N-Use until depleted, replaced by 20018 P-Interchanges with 20002 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Cadillac (cont'd)				Cadillac (cont'd)			
Escalade (cont'd)				SRX (cont'd)			
2012-2013				2007-2009			
OE Sensor: General Motors - 13586335, 20923680				OE Sensor: General Motors - 15922396, 25799331			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20153	11.5	1.3	Sensor.....	20153	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
2014-2015				2010-2015			
OE Sensor: General Motors - 13581558				OE Sensor: General Motors - 12768826, 13581558, 20922900, 22854866			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28206	11.5	1.3	Sensor.....	28206	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
2016-2018				2016			
OE Sensor: General Motors - 13581558				OE Sensor: General Motors - 13581558			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28206	11.5	1.3	Sensor.....	28206	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Seville				STS			
2001-2004				2005			
OE Sensor: General Motors - 25773946				OE Sensor: General Motors - 25758220			
EZ-Sensor; For CTS-V, When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.....				EZ-Sensor.....			
	33500 A, DB	11.5	1.3		33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; exc V; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20117 B	62	7	Sensor; OEM Part No. 25758220.....	20076	62	7
Service Pack.....	20003 F	62	7	Service Pack.....	20004 P	62	7
	20007 V	62	7				
SRX				2006-2008			
2004-2006				OE Sensor: General Motors - 25758220			
OE Sensor: General Motors - 25774006				EZ-Sensor.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3		33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20116	62	7	Sensor.....	20076	62	7
Service Pack.....	20004 P	62	7	Service Pack.....	20004 P	62	7

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 N-Use until depleted, replaced by 20018 P-Interchanges with 20002 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Cadillac (cont'd)				Cadillac (cont'd)			
STS (cont'd)				XLR (cont'd)			
2009				2010-2011			
OE Sensor: General Motors - 15922396				EZ-Sensor: 33500 A, DB 11.5 1.3			
EZ-Sensor; For STS-V, When installing				33700 11.5 1.3			
EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit				EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7			
34000. 33000 A 11.5 1.3				EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3			
33500 A, DB 11.5 1.3							
33700 11.5 1.3				XT5			
EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7				2017-2018			
EZ-Sensor Service Pack; exc V; Rubber Valve. 20018 C, T 11.5 1.3				OE Sensor: General Motors - 13516165, 13598773			
Sensor; OEM Part No. 25920615; Exc. STS V. 20153 11.5 1.3				EZ-Sensor: 33500 A, DB 11.5 1.3			
Service Pack; OEM Part No. 25920615; Exc. STS				33700 11.5 1.3			
V. 20008 C, N 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7			
20018 C, T 11.5 1.3				EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3			
2010				Sensor. 29015			
OE Sensor: General Motors - 15922396				Service Pack. 20018 C, T 11.5 1.3			
EZ-Sensor; For STS-V, When installing				XTS			
EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit				2013-2015			
34000. 33000 A 11.5 1.3				OE Sensor: General Motors - 22854866			
33500 A, DB 11.5 1.3				EZ-Sensor: 33000 A 11.5 1.3			
33700 11.5 1.3				33500 A, DB 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7				33700 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7			
Sensor; OEM Part No. 15922396; OEM Part No.				EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3			
25920615. 20153 11.5 1.3				Sensor. 28206 11.5 1.3			
Service Pack. 20008 C, N 11.5 1.3				Service Pack. 20008 C, N 11.5 1.3			
20018 C, T 11.5 1.3				20018 C, T 11.5 1.3			
2011				2016-2018			
OE Sensor: General Motors - 20923680, 25920615				OE Sensor: General Motors - 13598772, 22854866			
EZ-Sensor. 33000 A 11.5 1.3				EZ-Sensor: 33500 A, DB 11.5 1.3			
33500 A, DB 11.5 1.3				33700 11.5 1.3			
33700 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7			
EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7				EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3				Sensor. 28206 11.5 1.3			
Sensor. 20153 11.5 1.3				Service Pack. 20008 C, N 11.5 1.3			
Service Pack. 20008 C, N 11.5 1.3				20018 C, T 11.5 1.3			
20018 C, T 11.5 1.3							
XLR				Chevrolet			
2004				Avalanche			
OE Sensor: General Motors - 25758220				2004-2006			
EZ-Sensor: 33000 A 11.5 1.3				EZ-Sensor: 33500 A, DB 11.5 1.3			
33500 A, DB 11.5 1.3				33700 11.5 1.3			
33700 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7			
EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7				EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3							
Sensor; OEM Part No. 25758220. 20076 62 7							
Service Pack. 20004 P 62 7							
2005-2009							
OE Sensor: General Motors - 25758220							
EZ-Sensor: 33000 A 11.5 1.3							
33500 A, DB 11.5 1.3							
33700 11.5 1.3							
EZ-Sensor Service Pack; Aluminium Valve. 34000 62 7							
EZ-Sensor Service Pack; Rubber Valve. 20018 C, T 11.5 1.3							
Sensor. 20076 62 7							
Service Pack. 20004 P 62 7							

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chevrolet (cont'd)				Chevrolet (cont'd)			
Avalanche (cont'd)				Aveo (cont'd)			
2007				2008-2011			
OE Sensor: General Motors - 15825475, 25799331				OE Sensor: General Motors - 15922396, 20923680, 25920615			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor: Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem.....				Sensor.....			
	20158	62	7		20153	11.5	1.3
Sensor: Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem.....				Service Pack.....			
	20153	11.5	1.3		20008 C, N	11.5	1.3
Service Pack: Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem.....				20018 C, T			
	20007 V	80	9		20018 C, T	11.5	1.3
	20015 H	80	9				
Service Pack: Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem.....							
	20008 C, N	11.5	1.3				
	20018 C, T	11.5	1.3				
2008				Aveo5			
OE Sensor: General Motors - 25799331				2007			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: General Motors - 25799331			
	33500 A, DB	11.5	1.3	EZ-Sensor.....			
	33700	11.5	1.3		33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor: OEM Part No. 25799331; OEM Part No. 15922396.....				EZ-Sensor Service Pack; Aluminium Valve.....			
	20153	11.5	1.3		34000	62	7
Service Pack.....	20008 C, N	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	20018 C, T	11.5	1.3	Sensor; Hatchback.....	20153	11.5	1.3
2009-2013				Service Pack.....			
OE Sensor: General Motors - 13586335, 15922396, 20923680, 25920615				20008 C, N			
EZ-Sensor.....	33000 A	11.5	1.3		20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	2008-2011			
	33700	11.5	1.3	OE Sensor: General Motors - 15922396, 20923680, 25920615			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33000 A	11.5	1.3
Sensor: OEM Part No. 25799331; OEM Part No. 15922396.....					33500 A, DB	11.5	1.3
	20153	11.5	1.3		33700	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor.....			
				Service Pack.....			
					20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
				Bolt EV			
				2017-2018			
				OE Sensor: General Motors - 22854866			
				EZ-Sensor.....			
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor; Exc. ZL1.....	28206	11.5	1.3
				Service Pack; Exc. ZL1.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
				Camaro			
				2010-2011			
				OE Sensor: General Motors - 12768826, 20922900			
				EZ-Sensor.....			
					33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor.....	28206	11.5	1.3
				Service Pack.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000, 33100 & 33200 H-Use until depleted, replaced by 20007
N-Use until depleted, replaced by 20018 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chevrolet (cont'd)				Chevrolet (cont'd)			
Camaro (cont'd)				Caprice (cont'd)			
2012				2014			
OE Sensor: General Motors - 20922900, 20964159				OE Sensor: General Motors - 13581559			
EZ-Sensor; Exc. ZL1	33000 A	11.5	1.3	EZ-Sensor; exc Police	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve; Exc.				EZ-Sensor Service Pack; exc Police; Aluminium			
ZL1	34000	62	7	Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve; Exc. ZL1				EZ-Sensor Service Pack; exc Police; Rubber			
Sensor; exc ZL1; OEM Part No. 20922900; OEM	20018 C, T	11.5	1.3	Valve	20018 C, T	11.5	1.3
Part No. 22854866	28206	11.5	1.3	Sensor	20228	71	8
Sensor; ZL1	28423	62	7	Service Pack	20047 O	71	8
Service Pack; Exc. ZL1	20008 C, N	11.5	1.3		20049 U	71	8
	20018 C, T	11.5	1.3	2015			
Service Pack; ZL1	20004 P	62	7	OE Sensor: General Motors - 13581559			
2013-2015				EZ-Sensor; exc Police			
OE Sensor: General Motors - 20964159, 22854866				33500 A, DB			
EZ-Sensor; Exc. ZL1	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; exc Police; Aluminium			
	33700	11.5	1.3	Valve			
EZ-Sensor Service Pack; Aluminium Valve; Exc.				34000			
ZL1	34000	62	7	EZ-Sensor Service Pack; exc Police; Rubber			
EZ-Sensor Service Pack; Rubber Valve; Exc. ZL1				Valve			
Sensor; Exc. ZL1	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Sensor; ZL1	28206	11.5	1.3	Sensor	20228	71	8
Sensor; ZL1	28423	62	7	Service Pack	20047 O	71	8
Service Pack; Exc. ZL1	20008 C, N	11.5	1.3		20049 U	71	8
	20018 C, T	11.5	1.3	2016			
Service Pack; ZL1	20004 P	62	7	OE Sensor: General Motors - 13598786			
2016-2017				EZ-Sensor; exc Police			
OE Sensor: General Motors - 13598773, 13598787				33500 A, DB			
EZ-Sensor; Exc. ZL1	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; exc Police; Aluminium			
EZ-Sensor Service Pack; Aluminium Valve; Exc.				Valve			
ZL1	34000	62	7	34000			
EZ-Sensor Service Pack; Rubber Valve; Exc. ZL1				EZ-Sensor Service Pack; exc Police; Rubber			
Sensor; Exc. ZL1	20018 C, T	11.5	1.3	Valve			
Sensor; ZL1	29015	11.5	1.3		20018 C, T	11.5	1.3
Service Pack; Exc. ZL1	28211	62	7	Sensor	28423	71	8
	20008 C, N	11.5	1.3	Service Pack	20004 P	62	7
	20018 C, T	11.5	1.3	2017			
2018				OE Sensor: General Motors - 13598772			
OE Sensor: General Motors - 13598773				EZ-Sensor; exc Police			
EZ-Sensor; Exc. ZL1	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve; Exc.				EZ-Sensor Service Pack; exc Police; Aluminium			
ZL1	34000	62	7	Valve			
EZ-Sensor Service Pack; Rubber Valve; Exc. ZL1				EZ-Sensor Service Pack; exc Police; Rubber			
Sensor; Exc. ZL1	20018 C, T	11.5	1.3	Valve			
Sensor; ZL1	29015	11.5	1.3		20018 C, T	11.5	1.3
Service Pack; Exc. ZL1	20008 C, N	11.5	1.3	Sensor	28206	11.5	1.3
	20018 C, T	11.5	1.3	Service Pack	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
Caprice				Captiva Sport			
2011-2013				2012-2013			
OE Sensor: General Motors - 15268606				OE Sensor: General Motors - 20923680, 22853741			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve				EZ-Sensor Service Pack; Aluminium Valve			
	34000	62	7		34000	62	7
EZ-Sensor Service Pack; Rubber Valve				EZ-Sensor Service Pack; Rubber Valve			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Sensor	20158	62	7	Sensor	20153	11.5	1.3
Service Pack	20004 P	62	7	Service Pack	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
 O-Use until depleted, replaced by 20049 P-Interchanges with 20002 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chevrolet (cont'd)				Chevrolet (cont'd)			
Captiva Sport (cont'd)				Cobalt (cont'd)			
2014-2016				2010			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: General Motors - 12768826			
	33700	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
2017				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: General Motors - 13598771, 20923680, 22853741				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor.....	33700	11.5	1.3	Sensor.....	28206	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20008 C, N	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Sensor.....	20153	11.5	1.3	Colorado			
Service Pack.....	20008 C, N	11.5	1.3	2007-2012			
	20018 C, T	11.5	1.3	OE Sensor: General Motors - 15122618			
City Express				EZ-Sensor.....	33000 A	11.5	1.3
2015-2016					33500 A, DB	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20131	62	7
Cobalt				Service Pack.....	20006	62	7
2008				2015			
OE Sensor: General Motors - 15921013, 15922396				OE Sensor: General Motors - 13581558			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Clamp-In Style Only; W/Aluminium Valve Stem.....	20158	62	7	Sensor.....	28206	11.5	1.3
Sensor; Snap-In Style Only; W/Rubber Valve Stem.....	20153	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem.....	20004 P	80	9		20018 C, T	11.5	1.3
Service Pack; Snap-In Style Only; W/Rubber Valve Stem.....	20008 C, N	11.5	1.3	2016-2018			
	20018 C, T	11.5	1.3	OE Sensor: General Motors - 13581558, 13598772			
2009				EZ-Sensor.....	33500 A, DB	11.5	1.3
OE Sensor: General Motors - 15922396					33700	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	28206	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20008 C, N	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Sensor; Snap-In Style Only; W/Rubber Valve Stem.....	20153	11.5	1.3	Corvette			
Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem.....	20004 P	80	9	1997-2000			
Service Pack; Snap-In Style Only; W/Rubber Valve Stem.....	20008 C, N	11.5	1.3	OE Sensor: General Motors - 10438853			
	20018 C, T	11.5	1.3	Sensor.....	28006 B	62	7
2010				Service Pack.....	20012	62	7
OE Sensor: General Motors - 15922396				2001-2004			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: General Motors - 25773946			
	33500 A, DB	11.5	1.3	EZ-Sensor; exc Z06; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Snap-In Style Only; W/Rubber Valve Stem.....	20153	11.5	1.3	Sensor.....	20117 B	62	7
Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem.....	20004 P	80	9	Service Pack.....	20003 F	62	7
Service Pack; Snap-In Style Only; W/Rubber Valve Stem.....	20008 C, N	11.5	1.3		20007 V	62	7
	20018 C, T	11.5	1.3				

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 N-Use until depleted, replaced by 20018 P-Interchanges with 20002 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chevrolet (cont'd)				Chevrolet (cont'd)			
Corvette (cont'd)				Corvette (cont'd)			
2005-2009				2016-2018			
OE Sensor: General Motors - 25758220				OE Sensor: General Motors - 13581560, 13598775			
EZ-Sensor; exc Z06; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.				EZ-Sensor.			
	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3		34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Sensor.	20076	62	7	Sensor.	20223	71	8
Service Pack.	20004 P	62	7	Service Pack.	20047 O	71	8
					20049 U	71	8
2010-2011				Cruze			
OE Sensor: General Motors - 15268606				2011-2015			
EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.				OE Sensor: General Motors - 12768826, 13581558, 22854866			
	33000 A	11.5	1.3	EZ-Sensor.			
	33500 A, DB	11.5	1.3		33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Sensor.	20158	62	7	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Service Pack.	20004 P	62	7	Sensor.	28206	11.5	1.3
				Service Pack.	20008 C, N	11.5	1.3
2012					20018 C, T	11.5	1.3
OE Sensor: General Motors - 15268606				2016			
EZ-Sensor; Z06, Base; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.				OE Sensor: General Motors - 13598772, 13598773			
	33000 A	11.5	1.3	EZ-Sensor.			
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Z06; Base.	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Sensor; Z06; Base.	20158	62	7	Sensor.	20154		
Service Pack; Z06; Base.	20004 P	62	7	Service Pack.	28206	11.5	1.3
					20008 C, N	11.5	1.3
2013					20018 C, T	11.5	1.3
OE Sensor: General Motors - 15268606				2017-2018			
EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.				OE Sensor: General Motors - 13598773			
	33000 A	11.5	1.3	EZ-Sensor.			
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Sensor.	20158	62	7	Sensor; Exc. ZL1.	29015	11.5	1.3
Service Pack.	20004 P	62	7	Service Pack; Exc. ZL1.	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
2014-2015				Equinox			
OE Sensor: General Motors - 13581560				2007-2009			
EZ-Sensor.				OE Sensor: General Motors - 10394110, 15921013			
	33200 A	11.5	1.3	EZ-Sensor.			
	33500 A, DB	11.5	1.3		33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Sensor.	20223	71	8	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Service Pack.	20047 O	71	8	Sensor.	20158	62	7
	20049 U	71	8	Service Pack; W/Schrader Sensor.	20004 P	62	7
				Service Pack; W/Siemens Sensor.	20030	80	9

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
O-Use until depleted, replaced by 20049 P-Interchanges with 20002 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chevrolet (cont'd)				Chevrolet (cont'd)			
Equinox (cont'd)				HHR			
2010-2014				2008-2009			
OE Sensor: General Motors - 12768826, 22854866				OE Sensor: General Motors - 15268606, 15922396			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28206	11.5	1.3	Sensor; Clamp-In Style Only; W/Aluminium Valve Stem.....	20158	62	7
Service Pack.....	20008 C, N	11.5	1.3	Sensor; Snap-In Style Only; W/Rubber Valve Stem.....	20153	11.5	1.3
	20018 C, T	11.5	1.3	Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem.....	20004 P	80	9
2015-2018				2010			
OE Sensor: General Motors - 13598772				OE Sensor: General Motors - 12768826			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28206	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	Sensor.....	28206	11.5	1.3
	20018 C, T	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
Express				2011			
2008-2009				OE Sensor: General Motors - 25920615			
OE Sensor: General Motors - 15921013				EZ-Sensor.....			
EZ-Sensor.....	33000 A	11.5	1.3		33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20158	62	7	Sensor.....	20153	11.5	1.3
Service Pack; W/Schrader Sensor.....	20004 P	62	7	Service Pack.....	20008 C, N	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	80	9		20018 C, T	11.5	1.3
2010-2015				Impala			
OE Sensor: General Motors - 13586335, 22853741, 25920615				2000-2005			
EZ-Sensor.....	33000 A	11.5	1.3	Sensor..... INDIRECT D			
	33500 A, DB	11.5	1.3	2006			
	33700	11.5	1.3	OE Sensor: General Motors - 15268606			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33000 A	11.5	1.3
Sensor.....	20153	11.5	1.3		33500 A, DB	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3		33700	11.5	1.3
	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2016-2018				2006			
OE Sensor: General Motors - 13586335				OE Sensor: General Motors - 15268606			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....			
	33700	11.5	1.3		33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor.....	20153	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20008 C, N	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	20018 C, T	11.5	1.3	Sensor; W/Alloy Wheels.....	20158	62	7
				Service Pack; W/Alloy Wheels.....			
				20004 P			
				62 7			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
 N-Use until depleted, replaced by 20018 P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chevrolet (cont'd)				Chevrolet (cont'd)			
Impala (cont'd)				Malibu			
2007				2008			
OE Sensor: General Motors - 15268606, 25799331				OE Sensor: General Motors - 15921013, 15922396			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Clamp-In Style Only; W/Aluminium Valve Stem.....	20158	62	7	Sensor; Clamp-In Style Only; W/Aluminium Valve Stem.....	20158	62	7
Sensor; Snap-In Style Only; W/Rubber Valve Stem.....	20153	11.5	1.3	Sensor; Snap-In Style Only; W/Rubber Valve Stem.....	20153	11.5	1.3
Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem.....	20004 P	62	7	Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem.....	20004 P	80	9
Service Pack; Snap-In Style Only; W/Rubber Valve Stem.....	20008 C, N	11.5	1.3	Service Pack; Snap-In Style Only; W/Rubber Valve Stem.....	20008 C, N	11.5	1.3
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
2008-2013				2009			
OE Sensor: General Motors - 15922396, 22853741, 25920615				OE Sensor: General Motors - 15922396			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20153	11.5	1.3	Sensor.....	20153	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
2014-2015				2010			
OE Sensor: General Motors - 22854866				OE Sensor: General Motors - 12768826			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28206	11.5	1.3	Sensor.....	28206	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
2016-2018				2011-2012			
OE Sensor: General Motors - 13598772, 22854866				OE Sensor: General Motors - 25920615			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28206	11.5	1.3	Sensor.....	20153	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
2013-2015				2013-2015			
OE Sensor: General Motors - 22854866				OE Sensor: General Motors - 22854866			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28206	11.5	1.3	Sensor.....	28206	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chevrolet (cont'd)				Chevrolet (cont'd)			
Malibu (cont'd)				Orlando			
2016-2018				2012-2014			
OE Sensor: General Motors - 13598773				OE Sensor: General Motors - 12768826			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20154	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	Sensor.....	28206	11.5	1.3
	20018 C, T	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
Malibu Limited				2017			
2015-2018				OE Sensor: General Motors - 12768826			
OE Sensor: General Motors - 13598773				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28206	11.5	1.3
Sensor.....	20154	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3		20018 C, T	11.5	1.3
	20018 C, T	11.5	1.3	Silverado Series			
				2004			
Monte Carlo				OE Sensor: General Motors - 15136883			
2000-2005				EZ-Sensor.....			
Sensor.....	INDIRECT ^D				33000 A	11.5	1.3
2006					33500 A, DB	11.5	1.3
OE Sensor: General Motors - 15268606					33700	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	20115	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20004 P	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2005-2006			
Sensor; W/Alloy Wheels.....	20158	62	7	OE Sensor: General Motors - 15114379			
Service Pack; W/Alloy Wheels.....	20004 P	62	7	EZ-Sensor.....			
2007					33000 A	11.5	1.3
OE Sensor: General Motors - 15268606, 25799331					33500 A, DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20107	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack.....	20004 P	62	7
Sensor; Clamp-In Style Only; W/Aluminium Valve Stem.....	20158	62	7	2007			
Sensor; Snap-In Style Only; W/Rubber Valve Stem.....	20153	11.5	1.3	OE Sensor: General Motors - 15114379, 15254101, 15825475			
Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem.....	20004 P	62	7	EZ-Sensor.....			
Service Pack; Snap-In Style Only; W/Rubber Valve Stem.....	20008 C, N	11.5	1.3		33000 A	11.5	1.3
	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic.....	20158	62	7
				Sensor; Classic.....	20107	62	7
				Sensor; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic.....	20153	11.5	1.3
				Service Pack; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic.....	20007 V	80	9
					20015 H	80	9
				Service Pack; Classic.....	20004 P	62	7
				Service Pack; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
H-Use until depleted, replaced by 20007 N-Use until depleted, replaced by 20018 P-Interchanges with 20002 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chevrolet (cont'd)				Chevrolet (cont'd)			
Silverado Series (cont'd)				Sonic (cont'd)			
2008-2012				2016-2018			
OE Sensor: General Motors - 15922396, 25920615				OE Sensor: General Motors - 13598772			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28206	11.5	1.3
Sensor.....	20153	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
Sensor; W/Single Rear Wheels.....	20153	11.5	1.3		20018 C, T	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3				
	20018 C, T	11.5	1.3				
Service Pack; W/Single Rear Wheels.....	20008 C, N	11.5	1.3				
	20018 C, T	11.5	1.3				
2013				Spark			
OE Sensor: General Motors - 25920615				2013-2015			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: General Motors - 12768826, 22854866			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; W/Single Rear Wheels.....	20153	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/Single Rear Wheels.....	20008 C, N	11.5	1.3	Sensor.....	28206	11.5	1.3
	20018 C, T	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
2014-2015				2016-2017			
OE Sensor: General Motors - 13581558				OE Sensor: General Motors - 13598772			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28206	11.5	1.3
Sensor; W/Single Rear Wheels.....	28206	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
Service Pack; W/Single Rear Wheels.....	20008 C, N	11.5	1.3		20018 C, T	11.5	1.3
	20018 C, T	11.5	1.3				
2016-2018				SS			
OE Sensor: General Motors - 13581558				2014-2017			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: General Motors - 13598786, 20964159			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; W/Single Rear Wheels.....	28206	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/Single Rear Wheels.....	20008 C, N	11.5	1.3	Sensor.....	28423	62	7
	20018 C, T	11.5	1.3	Service Pack.....	20004 P	62	7
				SSR			
Sonic				2006			
2012-2015				OE Sensor: General Motors - 25774006			
OE Sensor: General Motors - 12768826, 13581558				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; OEM Part No. 25774006.....	20116	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack.....	20004 P	62	7
Sensor.....	28206	11.5	1.3				
Service Pack.....	20008 C, N	11.5	1.3	2007			
	20018 C, T	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
 P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chevrolet (cont'd)				Chevrolet (cont'd)			
Suburban				Suburban (cont'd)			
2004				2015			
OE Sensor: General Motors - 15136883				OE Sensor: General Motors - 13581558			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20115	62	7	Sensor.....	28206	11.5	1.3
Service Pack.....	20004 P	62	7	Service Pack.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
2005-2006				2016-2018			
OE Sensor: General Motors - 15114379				OE Sensor: General Motors - 13581558			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3		34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20107	62	7	Sensor.....	28206	11.5	1.3
Service Pack.....	20004 P	62	7	Service Pack.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
2007				Tahoe			
OE Sensor: General Motors - 15825475, 25799331				2004			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: General Motors - 15136883			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem.....	20158	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem.....	20153	11.5	1.3	Sensor.....	20115	62	7
Service Pack; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem.....	20007 V	80	9	Service Pack.....	20004 P	62	7
	20015 H	80	9				
Service Pack; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem.....	20008 C, N	11.5	1.3	2005-2006			
	20018 C, T	11.5	1.3	OE Sensor: General Motors - 15114379			
2008-2014				EZ-Sensor.....	33000 A	11.5	1.3
OE Sensor: General Motors - 13581558, 13586335, 15922396, 25920615					33500 A, DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20107	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack.....	20004 P	62	7
Sensor.....	20153	11.5	1.3	2007			
Service Pack.....	20008 C, N	11.5	1.3	OE Sensor: General Motors - 15825475, 25799331			
	20018 C, T	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
2014					33500 A, DB	11.5	1.3
OE Sensor: General Motors - 13581558					33700	11.5	1.3
Sensor.....	28206	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem.....	20158	62	7
				Sensor; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem.....	20153	11.5	1.3
				Service Pack; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem.....	20007 V	80	9
					20015 H	80	9
				Service Pack; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 H-Use until depleted, replaced by 20007
N-Use until depleted, replaced by 20018 P-Interchanges with 20002 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chevrolet (cont'd)				Chevrolet (cont'd)			
Tahoe (cont'd)				Traverse (cont'd)			
2008-2013				2016-2018			
OE Sensor: General Motors - 13586335, 15922396, 20923680, 25920615				OE Sensor: General Motors - 13598771			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20153	11.5	1.3
Sensor	20153	11.5	1.3	Service Pack	20008 C, N	11.5	1.3
Service Pack	20008 C, N	11.5	1.3		20018 C, T	11.5	1.3
	20018 C, T	11.5	1.3	Trax			
2014-2015				2013-2015			
OE Sensor: General Motors - 13581558				OE Sensor: General Motors - 13581558, 22854866			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	28206	11.5	1.3	Sensor	28206	11.5	1.3
Service Pack	20008 C, N	11.5	1.3	Service Pack	20008 C, N	11.5	1.3
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
2016-2017				2016-2017			
OE Sensor: General Motors - 13581558				OE Sensor: General Motors - 13598772			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	28206	11.5	1.3	Sensor	28206	11.5	1.3 N.r
Service Pack	20008 C, N	11.5	1.3			in-lbs	
	20018 C, T	11.5	1.3	Service Pack	20008 C, N	11.5	1.3
Trailblazer				Service Pack; Rubber Valve			
2006-2009				20018 C, T			
OE Sensor: General Motors - 25774006				20018 C, T			
EZ-Sensor	33500 A, DB	11.5	1.3	2018			
	33700	11.5	1.3	OE Sensor: General Motors - 13598772			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	33500 A, DB			
Sensor; OEM Part No. 25774006	20116	62	7	33700			
Service Pack	20004 P	62	7	34000			
Traverse				EZ-Sensor Service Pack; Aluminium Valve			
2009-2015				EZ-Sensor Service Pack; Rubber Valve			
OE Sensor: General Motors - 22853741, 23445327, 25920615				Sensor			
EZ-Sensor	33000 A	11.5	1.3	28206			
	33500 A, DB	11.5	1.3	in-lbs			
	33700	11.5	1.3	20008 C, N			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	20018 C, T			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	20018 C, T			
Sensor	20153	11.5	1.3	20018 C, T			
Service Pack	20008 C, N	11.5	1.3	20018 C, T			
	20018 C, T	11.5	1.3	Uplander			
2016-2017				2008-2009			
OE Sensor: General Motors - 13581558				OE Sensor: General Motors - 15268606			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20153	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack	20008 C, N	11.5	1.3	Sensor	20158	62	7
	20018 C, T	11.5	1.3	Service Pack	20004 P	62	7

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chevrolet (cont'd)				Chrysler (cont'd)			
Volt				200 (cont'd)			
2010				2012			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Chrysler - 68078861AA			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
2011-2015				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: General Motors - 12768826, 20922900, 22854866				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	Sensor; Rubber Valve.....	28308 F	11.5	1.3
	33500 A, DB	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
	33700	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2013-2014			
Sensor.....	28206	11.5	1.3	OE Sensor: Chrysler - 68078861AA			
Service Pack.....	20008 C, N	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	20018 C, T	11.5	1.3		33700	11.5	1.3
2016				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
OE Sensor: General Motors - 13598772				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	28308 F	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2015-2017			
Sensor.....	28206	11.5	1.3	OE Sensor: Chrysler - 68193586AC			
Service Pack.....	20008 C, N	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	20018 C, T	11.5	1.3		33700	11.5	1.3
2017-2018				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: General Motors - 13598773				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3	Sensor.....	28586		
	33700	11.5	1.3	Service Pack.....	20043		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	300			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2005-2006			
Sensor; Exc. ZL1.....	20154	11.5	1.3	OE Sensor: Chrysler - 56053030AB			
Service Pack; Exc. ZL1.....	20008 C, N	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Chrysler					33700	11.5	1.3
200				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2011				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
OE Sensor: Chrysler - 68078861AA				Sensor.....	28308 F	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
	33700	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/Siemens Sensor.....	20030	71	8
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Sensor.....	28308 F	11.5	1.3				
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5				
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5				
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007
 F-Supercedes the 20066 N-Use until depleted, replaced by 20018 S-Interchanges with 20016 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chrysler (cont'd)				Chrysler (cont'd)			
300 (cont'd)				300 (cont'd)			
2007				2012			
OE Sensor: Chrysler - 56053030AB, 68001696AA				OE Sensor: Chrysler - 56029398AB			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support					33500 A, DB	11.5	1.3
(Wai) Wheel Arch Initiators.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor; W/Rubber Stem Snap-in Sensor.....	20398	11.5	1.3
Sensor; Can also use 28155 until depleted 433				Service Pack; Fits Schrader Sensor; Includes			
MHz sensor.....	28434 E	11.5	1.3	Stem Only.....	20020	58	6.5
Sensor; Use until depleted-superseded by 20066.	28308 F	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor.				Service Pack; W/Metal Stem Clamp-in Sensor;			
Does not include stem.....	20013 S	58	6.5	Does Not Include Stem.....	20013 S	58	6.5
Service Pack; Fits Schrader Sensor; Includes					20016 M	58	6.5
Stem Only.....	20020	58	6.5	Service Pack; W/Rubber Stem Snap-in Sensor....	20018 C, T	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Service Pack; W/Siemens Sensor.....	20030	71	8	2013-2015			
2008				OE Sensor: Chrysler - 56029398AB			
OE Sensor: Chrysler - 68001698AB				EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; W/Steel Wheels.....	20018 C, T	11.5	1.3	Sensor.....	20398	11.5	1.3
Sensor.....	28434 E	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor.				2016-2018			
Does not include stem.....	20013 S	58	6.5	OE Sensor: Chrysler - 56029398AB			
Service Pack; Fits Schrader Sensor; Includes				EZ-Sensor.....	33500 A, DB	11.5	1.3
Stem Only.....	20020	58	6.5		33700	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/Siemens Sensor.....	20030	71	8	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2009-2010				Sensor.....	20398	11.5	1.3
OE Sensor: Chrysler - 56029400AC				Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3	300M			
	33500 A, DB	11.5	1.3	2002-2004			
	33700	11.5	1.3	OE Sensor: Chrysler - 52088990AC			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....	28291	58	6.5		33700	11.5	1.3
Service Pack; Does Not Include Stem.....	20013 S	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	20016 M	58	6.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes				Sensor.....	20028 B	35	4
Stem Only.....	20020	58	6.5	Service Pack; W/Schrader Sensor.....	20003 F	35	4
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		20007 V	35	4
2010				Service Pack; W/Siemens Sensor.....	20030	35	4
OE Sensor: Chrysler - 56029398AB							
Sensor.....	20398	11.5	1.3	2011			
2011				OE Sensor: Chrysler - 56029398AB			
OE Sensor: Chrysler - 56029398AB				EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20398	11.5	1.3
Sensor.....	20398	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 F-Supercedes the 20066 F-Use until depleted, replaced by 20007 M-Use until depleted, replaced by 20013 S-Interchanges with 20016 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chrysler (cont'd)				Chrysler (cont'd)			
Aspen				Crossfire (cont'd)			
2007-2011				2005			
OE Sensor: Chrysler - 56029465AB, 56053036AA				OE Sensor: Chrysler - 5142340AA, 52088990AC			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
					33700	11.5	1.3
EZ-Sensor; Use 33500 for Wheel Arc Initiator systems.....				EZ-Sensor; W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by			
	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....				EZ-Sensor Service Pack; Aluminium Valve.....			
	34000	62	7		34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Sensor.....				Sensor.....			
	28308 F	11.5	1.3		20028 B	35	4
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....				Service Pack; exc Siemens OE Sensor; Service Pack contains cap, core, grommet, and nut.....			
	20013 S	58	6.5		20003 F	35	4
Service Pack; Fits Schrader Sensor; Includes Stem Only.....				Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....			
	20020	58	6.5		20013 S	58	6.5
Service Pack; Rubber Valve.....				Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
	20018 C, T	11.5	1.3		20020	58	6.5
Service Pack; W/Siemens Sensor.....				Service Pack; Rubber Valve.....			
	20030	71	8		20018 C, T	11.5	1.3
2012-2015				2006-2008			
EZ-Sensor.....				OE Sensor: Chrysler - 5096808AA			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....							
	34000	62	7		33700	11.5	1.3
Service Pack; Rubber Valve.....				EZ-Sensor; W/315 MHz Sensor. Caution: Pressure by location vehicles not supported by			
	20018 C, T	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
Concorde				EZ-Sensor Service Pack; Aluminium Valve.....			
2002-2004				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Chrysler - 52088990AC				Sensor.....			
EZ-Sensor.....	33200 A	11.5	1.3		20028 B	35	4
	33500 A, DB	11.5	1.3	Service Pack; W/Schrader Sensor.....			
	33700	11.5	1.3		20003 F	35	4
EZ-Sensor Service Pack; Aluminium Valve.....				Service Pack; W/Schrader Sensor.....			
	34000	62	7		20007 V	35	4
EZ-Sensor Service Pack; Rubber Valve.....				Service Pack; W/Siemens Sensor.....			
	20018 C, T	11.5	1.3		20030	35	4
Sensor.....				2009-2011			
	20028 B	35	4	EZ-Sensor.....			
Service Pack; W/Schrader Sensor.....					33500 A, DB	11.5	1.3
	20003 F	35	4		33700	11.5	1.3
	20007 V	35	4	Intrepid			
Service Pack; W/Siemens Sensor.....				2002-2004			
	20030	35	4	OE Sensor: Chrysler - 52088990AC			
Crossfire				EZ-Sensor.....			
2004					33200 A	11.5	1.3
OE Sensor: Chrysler - 52088990AD					33500 A, DB	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
	33700	11.5	1.3		34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	34000	62	7		20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....				Sensor.....			
	20018 C, T	11.5	1.3		20028 B	35	4
Sensor.....				Service Pack; W/Schrader Sensor.....			
	20028 B	35	4		20003 F	35	4
Service Pack; W/Schrader Sensor.....				Service Pack; W/Schrader Sensor.....			
	20003 F	35	4		20007 V	35	4
	20007 V	35	4	Service Pack; W/Siemens Sensor.....			
Service Pack; W/Siemens Sensor.....					20030	35	4
	20030	35	4	Pacifica			
2003				2003			
EZ-Sensor.....				EZ-Sensor.....			
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 S-Interchanges with 20016 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chrysler (cont'd)				Chrysler (cont'd)			
Pacifica (cont'd)				Prowler			
2004				2001			
OE Sensor: Chrysler - 5127335AB, 52088990AC				OE Sensor: Chrysler - 4815132AB			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28004	35	4
Sensor; OEM Part No. 04727392AD (315 MHz)....	20335	71	8	Service Pack; W/Black Sensor Body.....	20012	35	4
Sensor; OEM Part No. 58088990AC (433 MHz)....	20028 B	35	4	Service Pack; W/Red Sensor Body.....	20003 F	35	4
Service Pack; W/Schrader Sensor.....	20003 F	35	4		20007 V	35	4
	20007 V	35	4	2002			
Service Pack; W/Siemens Sensor.....	20030	71	8	OE Sensor: Chrysler - 52088990AC			
2005				EZ-Sensor.....	33200 A	11.5	1.3
OE Sensor: Chrysler - 5127335AB					33500 A, DB	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20028 B	35	4
Sensor.....	20335	71	8	Service Pack; W/Schrader Sensor.....	20003 F	35	4
Service Pack.....	20030	71	8		20007 V	35	4
2006-2007				Service Pack; W/Siemens Sensor.....	20030	35	4
OE Sensor: Chrysler - 56053030AB, 68001696AA				PT Cruiser			
EZ-Sensor.....	33500 A, DB	11.5	1.3	2008-2010			
	33700	11.5	1.3	OE Sensor: Chrysler - 68001696AA, 68001696AB			
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28308 F	11.5	1.3	Sensor.....	28308 F	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	71	8	Service Pack; W/Siemens Sensor.....	20030	71	8
2008				Sebring			
OE Sensor: Chrysler - 68001696AA				2007-2009			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Chrysler - 68001696AA, 68001696AB			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28308 F	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5	Sensor.....	28308 F	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; W/Siemens Sensor.....	20030	71	8	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2017-2018				Service Pack; W/Siemens Sensor.....	20030	71	8
EZ-Sensor.....	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 S-Interchanges with 20016 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chrysler (cont'd)				Chrysler (cont'd)			
Sebring (cont'd)				Town & Country (cont'd)			
2010				2008			
OE Sensor: Chrysler - 68078861AA				OE Sensor: Chrysler - 68001696AA, 68001698AB			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
					33700	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....			
	33000 A	11.5	1.3		33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....				EZ-Sensor Service Pack; Aluminium Valve.....			
	34000	62	7		34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Sensor.....				Sensor; Can also use 20066 until depleted 315 MHZ.....			
	28308 F	11.5	1.3		28308 F	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....				Sensor; Can also use 28155 until depleted 433 MHZ.....			
	20013 S	58	6.5		28434 E	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....				Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....			
	20020	58	6.5		20013 S	58	6.5
Service Pack; Rubber Valve.....				Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
	20018 C, T	11.5	1.3		20020	58	6.5
Town & Country				Service Pack; Rubber Valve.....			
2002-2003				20018 C, T 11.5 1.3			
OE Sensor: Chrysler - 52088990AC				Service Pack; W/Siemens Sensor.....			
EZ-Sensor.....	33200 A	11.5	1.3		20030	71	8
	33500 A, DB	11.5	1.3	2009-2010			
	33700	11.5	1.3	OE Sensor: Chrysler - 68001698AB			
EZ-Sensor Service Pack; Aluminium Valve.....				EZ-Sensor.....			
	34000	62	7		33200 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor.....			
	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....				33700 11.5 1.3			
	20028 B	35	4	EZ-Sensor Service Pack; Aluminium Valve.....			
Service Pack.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20003 F	35	4		20018 C, T	11.5	1.3
	20007 V	35	4		28434 E	11.5	1.3
2004-2005				Sensor.....			
OE Sensor: Chrysler - 5127335AB				Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3		20013 S	58	6.5
	33700	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
EZ-Sensor Service Pack; Aluminium Valve.....				20020 58 6.5			
	34000	62	7	Service Pack; Rubber Valve.....			
EZ-Sensor Service Pack; Rubber Valve.....				20018 C, T 11.5 1.3			
	20018 C, T	11.5	1.3	Service Pack; W/Siemens Sensor.....			
Sensor.....				20030 71 8			
	20335	71	8	2011-2015			
Service Pack.....				OE Sensor: Chrysler - 56029398AB, 68241067AB			
	20030	71	8	EZ-Sensor.....			
2006-2007				33200 A 11.5 1.3			
OE Sensor: Chrysler - 56053030AB, 68001696AA				33500 A, DB 11.5 1.3			
EZ-Sensor.....	33500 A, DB	11.5	1.3	33700 11.5 1.3			
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....				EZ-Sensor Service Pack; Rubber Valve.....			
	33000 A	11.5	1.3		20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....				Sensor.....			
	34000	62	7		20398	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....				Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Sensor.....				2016-2018			
	28308 F	11.5	1.3	OE Sensor: Chrysler - 68241067AB			
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....				EZ-Sensor.....			
	20013 S	58	6.5		33500 A, DB	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....				33700 11.5 1.3			
	20020	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....			
Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Service Pack; W/Siemens Sensor.....				Sensor.....			
	20030	71	8		20398	11.5	1.3
				Service Pack; Rubber Valve.....			
				20018 C, T 11.5 1.3			

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supersedes the 28155 F-Supersedes the 20066 F-Use until depleted, replaced by 20007 S-Interchanges with 20016 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Chrysler (cont'd)				Dodge (cont'd)			
Voyager				Caliber			
2002-2003				2007-2010			
OE Sensor: Chrysler - 52088990AC				OE Sensor: Chrysler - 68001696AB, 68078861AA			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20028 B	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20003 F	35	4	Sensor.....	28308 F	11.5	1.3
	20007 V	35	4	Service Pack; Fits Schrader Alum stem sensor.			
				Does not include stem.....	20013 S	58	6.5
				Service Pack; Fits Schrader Sensor; Includes			
				Stem Only.....	20020	58	6.5
				Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Service Pack; W/Siemens Sensor.....	20030	71	8
Dodge				2011-2012			
Avenger				OE Sensor: Chrysler - 68078861AA			
2007				EZ-Sensor.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor; Caution: Ez-sensor will not support			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
2008-2009				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: Chrysler - 68001696AA, 68001696AB				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3	Sensor.....	28308 F	11.5	1.3
	33700	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor.			
EZ-Sensor; Caution: Ez-sensor will not support				Does not include stem.....	20013 S	58	6.5
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Stem Only.....	20020	58	6.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28308 F	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
Service Pack; Fits Schrader Alum stem sensor.				2010-2012			
Does not include stem.....	20013 S	58	6.5	OE Sensor: Chrysler - 68078861AA			
Service Pack; Fits Schrader Sensor; Includes				EZ-Sensor.....			
Stem Only.....	20020	58	6.5		33500 A, DB	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	71	8	EZ-Sensor; Caution: Ez-sensor will not support			
2010-2012				(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
OE Sensor: Chrysler - 68078861AA				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	20028 B	35	4
EZ-Sensor; Caution: Ez-sensor will not support				Service Pack.....	20003 F	35	4
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3		20007 V	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2004-2005			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Chrysler - 5127335AB			
Sensor.....	28308 F	11.5	1.3	EZ-Sensor.....			
Service Pack; Fits Schrader Alum stem sensor.					33500 A, DB	11.5	1.3
Does not include stem.....	20013 S	58	6.5		33700	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes				EZ-Sensor Service Pack; Aluminium Valve.....			
Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Rubber Valve.....			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....			
				Service Pack.....			
				EZ-Sensor.....			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				EZ-Sensor Service Pack; Rubber Valve.....			
				Sensor.....			
				Service Pack.....			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				EZ-Sensor Service Pack; Rubber Valve.....			
				Sensor.....			
				Service Pack.....			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				EZ-Sensor Service Pack; Rubber Valve.....			
				Sensor.....			
				Service Pack.....			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				EZ-Sensor Service Pack; Rubber Valve.....			
				Sensor.....			
				Service Pack.....			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				EZ-Sensor Service Pack; Rubber Valve.....			
				Sensor.....			
				Service Pack.....			

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 S-Interchanges with 20016 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Dodge (cont'd)				Dodge (cont'd)			
Caravan (cont'd)				Challenger (cont'd)			
2006-2007				2013-2015			
OE Sensor: Chrysler - 68001696AA				OE Sensor: Chrysler - 56029398AB			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
					33700	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor; W/Rubber Stem Snap-in Sensor.....	20398	11.5	1.3
Sensor.....	28308 F	11.5	1.3	Service Pack; W/Rubber Stem Snap-in Sensor.....	20018 C, T	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5	2016-2018			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	OE Sensor: Chrysler - 56029398AB			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	71	8		33700	11.5	1.3
					34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor; W/Rubber Stem Snap-in Sensor.....	20398	11.5	1.3
				Service Pack; W/Rubber Stem Snap-in Sensor.....	20018 C, T	11.5	1.3
Challenger				Charger			
2008				2005			
OE Sensor: Chrysler - 56029400AB, 56029481AB				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2006-2007			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Chrysler - 68001696AA			
Sensor; OEM No. 56029400AB.....	28291	58	6.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Sensor; OEM No. 56029481AB; 433 MHz Sensor; Rubber Valve.....	28434 E	11.5	1.3		33700	11.5	1.3
Service Pack; Does Not Include Stem.....	20013 S	58	6.5	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
	20016 M	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28308 F	11.5	1.3
2009				Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
OE Sensor: Chrysler - 56029400AC				Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
EZ-Sensor.....	33200 A	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
	33700	11.5	1.3	2008			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Chrysler - 68001698AB			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
Sensor.....	28291	58	6.5		33500 A, DB	11.5	1.3
Service Pack; Does Not Include Stem.....	20013 S	58	6.5		33700	11.5	1.3
	20016 M	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28434 E	11.5	1.3
Service Pack; W/Metal Stem Clamp-in Sensor; Does Not Include Stem.....	20013 S	58	6.5	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
	20016 M	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
				Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Service Pack; W/Siemens Sensor.....	20030	71	8

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004
 E-Supercedes the 28155 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 M-Use until depleted, replaced by 20013 S-Interchanges with
 20016 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Dodge (cont'd)				Dodge (cont'd)			
Charger (cont'd)				Dakota			
2009				2008-2010			
OE Sensor: Chrysler - 56029400AC				OE Sensor: Chrysler - 56029319AA, 56029319AB			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor: Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28291	58	6.5	Sensor.....	28461 G	11.5	1.3
Service Pack; Does Not Include Stem.....	20013 S	58	6.5	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
	20016 M	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2010				2011			
OE Sensor: Chrysler - 56029398AA, 56029400AC				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; W/Metal Stem Clamp-in Sensor.....	28291	58	6.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor; W/Rubber Stem Snap-in Sensor.....	20398	11.5	1.3
Sensor; W/Metal Stem Clamp-in Sensor.....	28291	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Sensor; W/Rubber Stem Snap-in Sensor.....	20398	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; W/Metal Stem Clamp-in Sensor; Does Not Include Stem.....	20013 S	58	6.5
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		20016 M	58	6.5
Service Pack; W/Metal Stem Clamp-in Sensor; Does Not Include Stem.....	20013 S	58	6.5	2011			
	20016 M	58	6.5	OE Sensor: Chrysler - 56029398AB			
2011				EZ-Sensor.....	33200 A	11.5	1.3
OE Sensor: Chrysler - 56029398AB					33500 A, DB	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28586		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack.....	20043		
Sensor; W/Rubber Stem Snap-in Sensor.....	20398	11.5	1.3	2017			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
2012-2015					33700	11.5	1.3
OE Sensor: Chrysler - 56029398AB				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor.....	28308 F	11.5	1.3
	33700	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Sensor.....	20398	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
2016-2018				Durango			
OE Sensor: Chrysler - 56029398AB				2007			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Chrysler - 56053036AA			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor: Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
Sensor.....	20398	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2016-2018				Sensor.....	28308 F	11.5	1.3
OE Sensor: Chrysler - 56029398AB				Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Service Pack; W/Schrader Sensor; Includes Stem Only.....	20020	58	6.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/Siemens Sensor.....	20030	71	8
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Sensor.....	20398	11.5	1.3				
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007
 F-Supersedes the 20066 G-Use until depleted, replaced by 20007 G-Supersedes the 28154 M-Use until depleted, replaced by 20013 S-Interchanges with
 20016 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Dodge (cont'd)				Dodge (cont'd)			
Durango (cont'd)				Grand Caravan (cont'd)			
2008				2004-2005			
OE Sensor: Chrysler - 56053036AA				OE Sensor: Chrysler - 5127335AB			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20335	71	8
Sensor.....	28308 F	11.5	1.3	Service Pack.....	20030	71	8
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5	2006-2007			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	OE Sensor: Chrysler - 68001696AA			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	71	8		33700	11.5	1.3
2009				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
OE Sensor: Chrysler - 56029465AB				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	28308 F	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28308 F	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5	2008-2010			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	OE Sensor: Chrysler - 68001698AB			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
2011-2015					33500 A, DB	11.5	1.3
OE Sensor: Chrysler - 56029398AB					33700	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	28434 E	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Sensor.....	20398	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
2016-2018				2011-2015			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Chrysler - 56029398AB			
	33700	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Grand Caravan				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2002-2003				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
OE Sensor: Chrysler - 52088990AC				Sensor.....	20398	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	2016-2018			
	33700	11.5	1.3	OE Sensor: Chrysler - 68241067AB			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor.....	20028 B	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20003 F	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	20007 V	35	4	Sensor.....	20398	11.5	1.3
				Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 F-Supercedes the 20066 F-Use until depleted, replaced by 20007 S-Interchanges with 20016 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Dodge (cont'd)				Dodge (cont'd)			
Intrepid				Magnum			
2002-2004				2005-2007			
OE Sensor: Chrysler - 52088990AC				OE Sensor: Chrysler - 68001696AA			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20028 B	35	4	Sensor.....	28308 F	11.5	1.3
Service Pack.....	20003 F	35	4	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
	20007 V	35	4	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
				Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Service Pack; W/Siemens Sensor.....	20030	71	8
Journey				2008			
2009				OE Sensor: Chrysler - 68001698AA			
OE Sensor: Chrysler - 68001698AB				EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28434 E	11.5	1.3
Sensor.....	28434 E	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
Service Pack; W/Siemens Sensor.....	20030	71	8	2010			
2010				OE Sensor: Chrysler - 56029398AA, 68001698AB			
OE Sensor: Chrysler - 56029398AA, 68001698AB				EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor; OEM No. 56029398AA; Rubber Valve....	20398	11.5	1.3
Sensor; OEM No. 56029398AA; Rubber Valve....	20398	11.5	1.3	Sensor; Replaces clamp-in Sensor.....	28434 E	11.5	1.3
Sensor; Replaces clamp-in Sensor.....	28434 E	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
Service Pack; W/Siemens Sensor.....	20030	71	8	2011-2015			
2011-2015				OE Sensor: Chrysler - 56029398AA, 56029398AB			
OE Sensor: Chrysler - 56029398AA, 56029398AB				EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20398	11.5	1.3
Sensor.....	20398	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2016-2018			
2016-2018				OE Sensor: Chrysler - 68241067AB			
OE Sensor: Chrysler - 68241067AB				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20398	11.5	1.3
Sensor.....	20398	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 F-Supercedes the 20066 F-Use until depleted, replaced by 20007 S-Interchanges with 20016 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Dodge (cont'd)				Dodge (cont'd)			
Nitro (cont'd)				Ram Series (cont'd)			
2009-2011				2009			
OE Sensor: Chrysler - 56029465AB, 56029465AC				OE Sensor: Chrysler - 56029319AA, 56029359AB			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A		
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....			
	33000 A	11.5	1.3		33200 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....				EZ-Sensor Service Pack; Aluminium Valve.....			
	34000	62	7		34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Sensor.....				Sensor.....			
	28308 F	11.5	1.3		28434 E	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....				Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....			
	20013 S	58	6.5		28461 G	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....				Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
	20020	58	6.5		20013 S	58	6.5
Service Pack; Rubber Valve.....				Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
2012				2010			
EZ-Sensor.....				OE Sensor: Chrysler - 56029359AB, 56029398AA			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....				EZ-Sensor Service Pack; Aluminium Valve.....			
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		34000	62	7
Sensor; W/Rubber Stem Snap-in Sensor.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20398	11.5	1.3		20018 C, T	11.5	1.3
Service Pack; W/Rubber Stem Snap-in Sensor.....				Sensor; W/Rubber Stem Snap-in Sensor.....			
	28434 E	11.5	1.3		20398	11.5	1.3
Service Pack; W/Rubber Stem Snap-in Sensor.....				Service Pack; W/Rubber Stem Snap-in Sensor.....			
	20018 C, T	11.5	1.3		28434 E	11.5	1.3
Ram 4500				2011-2013			
2010				EZ-Sensor.....			
OE Sensor: Chrysler - 56029359AB, 56029398AA					33500 A, DB	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
	33700	11.5	1.3		34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	34000	62	7		20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....				Sensor; W/Rubber Stem Snap-in Sensor.....			
	20018 C, T	11.5	1.3		20398	11.5	1.3
Sensor; W/Rubber Stem Snap-in Sensor.....				Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....			
	20398	11.5	1.3		20013 S	58	6.5
Service Pack; W/Rubber Stem Snap-in Sensor.....				Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
	28434 E	11.5	1.3		20020	58	6.5
Service Pack; W/Rubber Stem Snap-in Sensor.....				Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Ram 5500				Service Pack; W/Rubber Stem Snap-in Sensor.....			
2010					20018 C, T	11.5	1.3
OE Sensor: Chrysler - 56029359AB, 56029398AA				Sprinter			
EZ-Sensor.....	33200 A	11.5	1.3	2007-2009			
	33500 A, DB	11.5	1.3	OE Sensor: Chrysler - 68006771AA, 68038945AA			
	33700	11.5	1.3	EZ-Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....					33500 A, DB	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....			
	20018 C, T	11.5	1.3		33000 A	11.5	1.3
Sensor; W/Rubber Stem Snap-in Sensor.....				EZ-Sensor Service Pack; Aluminium Valve.....			
	20398	11.5	1.3		34000	62	7
Service Pack; W/Rubber Stem Snap-in Sensor.....				EZ-Sensor Service Pack; Rubber Valve.....			
	28434 E	11.5	1.3		20018 C, T	11.5	1.3
Service Pack; W/Rubber Stem Snap-in Sensor.....				Sensor.....			
	20018 C, T	11.5	1.3		20089	53	6
Ram Series				Service Pack; Includes Valve.....			
2008					20036	53	6
OE Sensor: Chrysler - 56029319AA				Stratus			
EZ-Sensor.....	33500 A, DB	11.5	1.3	2007			
	33700	11.5	1.3	EZ-Sensor.....			
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....					33500 A, DB	11.5	1.3
	33000 A	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....				EZ-Sensor Service Pack; Aluminium Valve.....			
	34000	62	7		34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....				EZ-Sensor Service Pack; Rubber Valve.....			
	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Sensor.....							
	28461 G	11.5	1.3				
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....							
	20013 S	58	6.5				
Service Pack; Fits Schrader Sensor; Includes Stem Only.....							
	20020	58	6.5				
Service Pack; Rubber Valve.....							
	20018 C, T	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004
 E-Supercedes the 28155 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 G-Use until depleted, replaced by 20007 G-Supercedes the 28154
 S-Interchanges with 20016 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Dodge (cont'd)				Dodge (cont'd)			
Viper				Viper (cont'd)			
2003-2006				2016-2018			
OE Sensor: Chrysler - 52088990AC				OE Sensor: Chrysler - 56029400AD			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor; W/Metal Stem Clamp-in Sensor.....	28291	58	6.5
Sensor.....	20028 B	35	4	Service Pack; W/Metal Stem Clamp-in Sensor; Does Not Include Stem.....	20013 S	58	6.5
Service Pack.....	20003 F	35	4		20016 M	58	6.5
	20007 V	35	4				
2007				Ferrari			
EZ-Sensor.....	33500 A, DB	11.5	1.3	488 GTB			
	33700	11.5	1.3	2017			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Volkswagen - 4F0907275D			
2008-2010				Sensor.....	20103		
OE Sensor: Chrysler - 52088990AC				Service Pack; Does Not Include Valve.....	20023	35	4
EZ-Sensor.....	33200 A	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
	33500 A, DB	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	35	4
	33700	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/51mm Orange Insert.....	20040	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	488 Spider			
Sensor.....	20028 B	35	4	2017			
Service Pack.....	20003 F	35	4	OE Sensor: Volkswagen - 4F0907275D			
	20007 V	35	4	Sensor.....	20103		
2011				Service Pack; Does Not Include Valve.....	20023	35	4
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
	33700	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
2012-2013				Service Pack; W/51mm Orange Insert.....	20040	35	4
OE Sensor: Chrysler - 56029400AD				599 GTB			
EZ-Sensor.....	33200 A	11.5	1.3	2007-2010			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; W/Metal Stem Clamp-in Sensor.....	28291	58	6.5	612 Scaglietti			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	2004-2011			
Service Pack; W/Metal Stem Clamp-in Sensor; Does Not Include Stem.....	20013 S	58	6.5	OE Sensor: Ferrari - 224549			
	20016 M	58	6.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
2014-2015					33700	11.5	1.3
OE Sensor: Chrysler - 56029400AD				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor; Includes Transmitter Only.....	20077	35	4
	33700	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/43mm Silver Insert.....	20037	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	35	4
Sensor; W/Metal Stem Clamp-in Sensor.....	28291	58	6.5	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/Metal Stem Clamp-in Sensor; Does Not Include Stem.....	20013 S	58	6.5	Service Pack; W/51mm Orange Insert.....	20040	35	4
	20016 M	58	6.5				

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 M-Use until depleted, replaced by 20013 S-Interchanges with 20016 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Ferrari (cont'd)				Ferrari (cont'd)			
California T				F430 (cont'd)			
2017				2008-2009			
OE Sensor: Volkswagen - 4F0907275D				OE Sensor: Ferrari - 224549			
Sensor	20103			Sensor; Includes Transmitter Only	20077	35	4
Service Pack; Does Not Include Valve	20023	35	4	Service Pack; Does Not Include Valve	20023	35	4
Service Pack; W/43mm Silver Insert	20037	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; W/48mm Green Insert	20038	35	4
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; W/49mm Black Insert	20039	35	4
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/51mm Orange Insert	20040	35	4
Enzo				FF			
2003-2004				2011			
OE Sensor: Ferrari - 224551				OE Sensor: Original Equipment Manufacturer - 4F0 907 275			
EZ-Sensor	33500 A, DB	11.5	1.3	Sensor; Includes Transmitter Only	20078	35	4
	33700	11.5	1.3	Service Pack; Does Not Include Valve	20023	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/43mm Silver Insert	20037	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; W/48mm Green Insert	20038	35	4
Sensor; Includes Transmitter Only	20084	35	4	Service Pack; W/49mm Black Insert	20039	35	4
Service Pack; Does Not Include Valve	20023	35	4	Service Pack; W/51mm Orange Insert	20040	35	4
Service Pack; W/43mm Silver Insert	20037	35	4				
Service Pack; W/48mm Green Insert	20038	35	4				
Service Pack; W/49mm Black Insert	20039	35	4				
Service Pack; W/51mm Orange Insert	20040	35	4				
2005-2009				Fxx			
EZ-Sensor	33500 A, DB	11.5	1.3	2003-2009			
	33700	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
F12 Berlinetta				GTC4Lusso			
2017				2017			
OE Sensor: Volkswagen - 4F0907275D				OE Sensor: Volkswagen - 4F0907275D			
Sensor	20103			Sensor	20103		
Service Pack; Does Not Include Valve	20023	35	4	Service Pack; Does Not Include Valve	20023	35	4
Service Pack; W/43mm Silver Insert	20037	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; W/48mm Green Insert	20038	35	4
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; W/49mm Black Insert	20039	35	4
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/51mm Orange Insert	20040	35	4
F430				LaFerrari			
2005				2014			
OE Sensor: Original Equipment Manufacturer - 4F0 907 275				OE Sensor: Original Equipment Manufacturer - 4F0 907 275			
EZ-Sensor	33500 A, DB	11.5	1.3	Sensor; Includes Transmitter Only	20078	35	4
	33700	11.5	1.3	Service Pack; Does Not Include Valve	20023	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/43mm Silver Insert	20037	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; W/48mm Green Insert	20038	35	4
2006-2007				Service Pack; W/49mm Black Insert			
OE Sensor: Ferrari - 224549				Service Pack; W/51mm Orange Insert			
EZ-Sensor	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3				
Sensor; Includes Transmitter Only	20077	35	4				
Service Pack; Does Not Include Valve	20023	35	4				
Service Pack; W/43mm Silver Insert	20037	35	4				
Service Pack; W/48mm Green Insert	20038	35	4				
Service Pack; W/49mm Black Insert	20039	35	4				
Service Pack; W/51mm Orange Insert	20040	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Ferrari (cont'd)				Fiat (cont'd)			
Maranello				500X (cont'd)			
1998-2006				2018			
OE Sensor: Ferrari - 224549				EZ-Sensor:	33500 A, DB	11.5	1.3
EZ-Sensor:	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only.	20077	35	4	Ford			
Service Pack; Does Not Include Valve.	20023	35	4	C-Max			
Service Pack; W/43mm Silver Insert.	20037	35	4	2012-2015			
Service Pack; W/48mm Green Insert.	20038	35	4	OE Sensor: Ford Motor Company - DE8T-1A180-AA, DE8T-1A180AA			
Service Pack; W/49mm Black Insert.	20039	35	4	EZ-Sensor:	33000 A	11.5	1.3
Service Pack; W/51mm Orange Insert.	20040	35	4		33500 A, DB	11.5	1.3
Fiat					33700	11.5	1.3
124 Spider				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
2017				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
OE Sensor: Original Equipment Manufacturer - 68375775AA				Sensor:	20315	11.5	1.3
Sensor:	20093			Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
	INDIRECT ^D			2016-2018			
Service Pack.	20050			OE Sensor: Ford Motor Company - DE8T-1A180AA			
	20050V			EZ-Sensor:	33500 A, DB	11.5	1.3
500					33700	11.5	1.3
2012-2015				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
OE Sensor: Chrysler - 56029398AB, 68241067AB				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
EZ-Sensor:	33200 A	11.5	1.3	Sensor:	20315	11.5	1.3
	33500 A, DB	11.5	1.3	Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
	33700	11.5	1.3	Crown Victoria			
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	2006-2011			
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	OE Sensor: Ford Motor Company - 6F2Z1A189A			
Sensor:	20398	11.5	1.3	EZ-Sensor:	33000 A	11.5	1.3
Service Pack; Rubber Valve.	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
2016-2018					33700	11.5	1.3
OE Sensor: Chrysler - 68241067AB				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor:	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor:	28385	27	3
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Sensor Clip.	22100		
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Sensor Cradle.	22101		
Sensor:	20398	11.5	1.3	Universal Band.	22102		
Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Edge			
500X				2007-2008			
2014-2016				OE Sensor: Ford Motor Company - 6F2Z1A189A, 7L1Z1A189A			
EZ-Sensor:	33500 A, DB	11.5	1.3	EZ-Sensor:	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
2017				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
OE Sensor: Original Equipment Manufacturer - 68252493AB				Sensor; W/Chrome Plated Almm. Wheels.	28385	27	3
EZ-Sensor:	33500 A, DB	11.5	1.3	Sensor; W/O Chrome Plated Almm. Wheels.	28390	27	3
	33700	11.5	1.3	Sensor Clip.	22100		
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Sensor Cradle.	22101		
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Universal Band.	22102		
Sensor:	20398						
Service Pack; Rubber Valve.	20018 C, T	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Ford (cont'd)				Ford (cont'd)			
Edge (cont'd)				Escape (cont'd)			
2009-2010				2009-2010			
OE Sensor: Ford Motor Company - 7L1Z1A189A				OE Sensor: Ford Motor Company - 9L3Z1A189A			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	28390	27	3	Sensor.....	20315	11.5	1.3
Sensor Clip.....	22100			Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor Cradle.....	22101			2011			
Universal Band.....	22102			OE Sensor: Ford Motor Company - 9L3Z1A189A			
2011-2014				EZ-Sensor.....			
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA					33000 ^A	11.5	1.3
EZ-Sensor.....	33000 ^A	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Sensor.....	20315	11.5	1.3
Sensor.....	20315	11.5	1.3	2012-2015			
Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	OE Sensor: Ford Motor Company - CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA			
2015-2017				EZ-Sensor.....			
OE Sensor: Ford Motor Company - F2GT-1A180-AB					33000 ^A	11.5	1.3
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	20280	11.5	1.3	Sensor.....	20315	11.5	1.3
Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
2018				2016-2018			
OE Sensor: Ford Motor Company - F2GT-1A180-AB				OE Sensor: Ford Motor Company - DE8T1A180AA			
Sensor.....	20280	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3		33700	11.5	1.3
Escape				EZ-Sensor Service Pack; Aluminium Valve.....			
2005				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Ford Motor Company - 6F2Z1A189A				Sensor.....			
EZ-Sensor.....	33000 ^A	11.5	1.3		20315	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
	33700	11.5	1.3	E-Series Van			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2007			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	OE Sensor: Ford Motor Company - 6F2Z1A189A, 8C2Z1A189A			
Sensor; Oct. 3, 2005 & Newer.....	28385	27	3	EZ-Sensor.....	33000 ^A	11.5	1.3
Sensor Clip.....	22100				33500 ^{A, DB}	11.5	1.3
Sensor Cradle.....	22101				33700	11.5	1.3
Universal Band.....	22102			EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2006-2008				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
OE Sensor: Ford Motor Company - 6F2Z1A189A				Sensor.....	28385	27	3
EZ-Sensor.....	33000 ^A	11.5	1.3		28395	27	3
	33500 ^{A, DB}	11.5	1.3	Sensor Clip.....	22100		
	33700	11.5	1.3	Sensor Cradle.....	22101		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Universal Band.....	22102		
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3				
Sensor.....	28385	27	3				
Sensor Clip.....	22100						
Sensor Cradle.....	22101						
Universal Band.....	22102						

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Ford (cont'd)				Ford (cont'd)			
E-Series Van (cont'd)				E-Series Van (cont'd)			
2008-2009				2014-2015			
OE Sensor: Ford Motor Company - 8C2Z1A189A; Original Equipment Manufacturer - 8C2Z1A189A				OE Sensor: Ford Motor Company - 9L3Z1A189A, DE8T-1A180-AA, DE8T1A180AA			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28395	27	3	Sensor.....	20315	11.5	1.3
Sensor Clip.....	22100			Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor Cradle.....	22101			2016-2018			
Universal Band.....	22102			OE Sensor: Ford Motor Company - DE8T1A180AA			
2010				EZ-Sensor.....			
OE Sensor: Ford Motor Company - 8C2Z1A189A, 9L3Z1A189A				EZ-Sensor.....			
EZ-Sensor.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor; W/Alloy Wheels.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor.....	20315	11.5	1.3
	33700	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Expedition			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2003-2004			
EZ-Sensor Service Pack; W/Alloy Wheels; Aluminium Valve.....	34000	62	7	OE Sensor: Ford Motor Company - 4L2Z 1A150 BA			
EZ-Sensor Service Pack; W/Alloy Wheels; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
Sensor.....	20315	11.5	1.3		33500 A, DB	11.5	1.3
Sensor; W/Alloy Wheels.....	28395	27	3		33700	11.5	1.3
Sensor; W/Steel Wheels.....	20315	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor Clip.....	22100			EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor Clip; W/Alloy Wheels.....	22100			Sensor.....	20096 B	44	5
Sensor Cradle.....	22101			Service Pack.....	20002 E	44	5
Sensor Cradle; W/Alloy Wheels.....	22101				20004 P	44	5
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2005-2006			
Service Pack; W/Steel Wheels.....	20018 C, T	11.5	1.3	OE Sensor: Ford Motor Company - 5L1Z 1A150 AA			
Universal Band.....	22102			EZ-Sensor.....	33500 A, DB	11.5	1.3
Universal Band; W/Alloy Wheels.....	22102				33700	11.5	1.3
2011-2013				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Ford Motor Company - 9L3Z1A189A, DE8T1A180AA				EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor.....	33000 A	11.5	1.3	Sensor.....	20135 B	44	5
	33500 A, DB	11.5	1.3	Service Pack.....	20002 E	44	5
	33700	11.5	1.3		20004 P	44	5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2007-2010			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Ford Motor Company - 7L1Z1A189A			
Sensor.....	20315	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
2013					33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor.....	28390	27	3
				Sensor Clip.....	22100		
				Sensor Cradle.....	22101		
				Universal Band.....	22102		

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Ford (cont'd)				Ford (cont'd)			
Expedition (cont'd)				Explorer (cont'd)			
2011-2015				2006-2010			
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA				OE Sensor: Ford Motor Company - 6F2Z1A189A			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20315	11.5	1.3	Sensor.....	28385	27	3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor Clip.....	22100		
2016-2017				Sensor Cradle.....			
OE Sensor: Ford Motor Company - DE8T1A180AA				Sensor Cradle.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3	Universal Band.....	22102		
	33700	11.5	1.3	2011-2014			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....			
Sensor.....	20315	11.5	1.3		33000 A	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
2018					33700	11.5	1.3
OE Sensor: Ford Motor Company - F2GT-1A180-AB					34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20315	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20280	11.5	1.3	2015			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Ford Motor Company - DE8T-1A180-AA			
Explorer				EZ-Sensor.....			
2002-2003					33000 A	11.5	1.3
OE Sensor: Ford Motor Company - 4L2Z 1A150 BA					33500 A, DB	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; Exc. Sport.....	20096 B	44	5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Exc. Sport.....	20002 E	44	5
Sensor; Exc. Sport.....	20096 B	44	5		20004 P	44	5
Service Pack; Exc. Sport.....	20002 E	44	5	2004-2005			
	20004 P	44	5	OE Sensor: Ford Motor Company - 4L2Z 1A150 BA			
2004-2005				EZ-Sensor.....			
OE Sensor: Ford Motor Company - 4L2Z 1A150 BA					33200 A	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20096 B	44	5
Sensor.....	20096 B	44	5	Service Pack.....	20002 E	44	5
Service Pack.....	20002 E	44	5		20004 P	44	5
	20004 P	44	5	Explorer Sport Trac			
2007-2010				2007-2010			
OE Sensor: Ford Motor Company - 4L2Z 1A150 BA				OE Sensor: Ford Motor Company - 6F2Z1A189A			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20096 B	44	5	Sensor.....	28385	27	3
Service Pack.....	20002 E	44	5	Sensor Clip.....	22100		
	20004 P	44	5	Sensor Cradle.....	22101		
2007-2010				Universal Band.....			
OE Sensor: Ford Motor Company - 6F2Z1A189A				Universal Band.....			
EZ-Sensor.....	33000 A	11.5	1.3		22102		
	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Sensor.....	28385	27	3				
Sensor Clip.....	22100						
Sensor Cradle.....	22101						
Universal Band.....	22102						

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Ford (cont'd)				Ford (cont'd)			
F-150				F-250 Super Duty (cont'd)			
2007				2011-2015			
OE Sensor: Ford Motor Company - 6F2Z1A189A				OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-A, DE8T1A180AA			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28385	27	3	Sensor.....	20315	11.5	1.3
Sensor Clip.....	22100			Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor Cradle.....	22101			2016			
Universal Band.....	22102			OE Sensor: Ford Motor Company - DE8T1A180AA			
2008				EZ-Sensor.....			
OE Sensor: Ford Motor Company - 6F2Z1A189A, 8C2Z1A189A				33500 A, DB			
EZ-Sensor.....	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	Sensor.....	20315	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2017			
Sensor; W/H.D. Payload Pkg.....	28395	27	3	OE Sensor: Ford Motor Company - DE8T1A180AA			
Sensor; W/O H.D. Payload Pkg.....	28385	27	3	EZ-Sensor.....	33500 A, DB	11.5	1.3
Sensor Clip.....	22100				33700	11.5	1.3
Sensor Cradle.....	22101			EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Universal Band.....	22102			EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2009-2014				Sensor; Rubber Valve.....			
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA				20315			
EZ-Sensor.....	33000 A	11.5	1.3	2018			
	33500 A, DB	11.5	1.3	EZ-Sensor.....			
	33700	11.5	1.3	33500 A, DB			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20315	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor; Rubber Valve.....	20315	11.5	1.3
2015-2018				F-350 Super Duty			
OE Sensor: Ford Motor Company - F2GT-1A180-AA, F2GT-1A180-AB, GL3T-1A180-GA				2008-2010			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Ford Motor Company - 8C2Z1A189A			
	33700	11.5	1.3	EZ-Sensor.....			
	34000	62	7		33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor.....	20280	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
F-250 Super Duty				Sensor.....			
2008-2010				28395			
OE Sensor: Ford Motor Company - 8C2Z1A189A				27			
EZ-Sensor.....	33000 A	11.5	1.3	3			
	33500 A, DB	11.5	1.3	Sensor Clip.....			
	33700	11.5	1.3	22100			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor Cradle.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	22101			
Sensor.....	28395	27	3	Universal Band.....			
Sensor Clip.....	22100			22102			
Sensor Cradle.....	22101			2011-2015			
Universal Band.....	22102			OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-A, DE8T1A180AA			
F-250 Super Duty				EZ-Sensor.....			
2008-2010				33000 A			
OE Sensor: Ford Motor Company - 8C2Z1A189A				11.5			
EZ-Sensor.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20315	11.5	1.3
Sensor.....	28395	27	3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor Clip.....	22100						
Sensor Cradle.....	22101						
Universal Band.....	22102						

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Ford (cont'd)				Ford (cont'd)			
F-350 Super Duty (cont'd)				F-450 Super Duty (cont'd)			
2016				2017-2018			
OE Sensor: Ford Motor Company - DE8T1A180AA				EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3			
EZ-Sensor..... 33700 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				Sensor..... 20315 11.5 1.3			
Sensor..... 20315 11.5 1.3				Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				F-550 Super Duty			
2017-2018				2010			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				OE Sensor: Ford Motor Company - 8C2Z1A189A			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				EZ-Sensor..... 33000 ^A 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3			
				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
				Sensor..... 28395 27 3			
				Sensor Clip..... 22100			
				Sensor Cradle..... 22101			
				Universal Band..... 22102			
				Fiesta			
F-450 Super Duty				2011-2015			
2008				OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA			
OE Sensor: Ford Motor Company - 8C2Z1A189A				EZ-Sensor..... 33000 ^A 11.5 1.3			
EZ-Sensor..... 33000 ^A 11.5 1.3				EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				Sensor..... 20315 11.5 1.3			
Sensor..... 28395 27 3				Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
Sensor Clip..... 22100				2016-2018			
Sensor Cradle..... 22101				OE Sensor: Ford Motor Company - DE8T1A180AA			
Universal Band..... 22102				EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3			
2009				EZ-Sensor..... 33700 11.5 1.3			
OE Sensor: Ford Motor Company - 8C2Z1A189A				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
EZ-Sensor..... 33000 ^A 11.5 1.3				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				Sensor..... 28395 27 3			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				Sensor Clip..... 22100			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				Sensor Cradle..... 22101			
Sensor..... 28395 27 3				Universal Band..... 22102			
Sensor Clip..... 22100				2010			
Sensor Cradle..... 22101				OE Sensor: Ford Motor Company - 8C2Z1A189A			
Universal Band..... 22102				EZ-Sensor..... 33000 ^A 11.5 1.3			
2010				EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3			
OE Sensor: Ford Motor Company - 8C2Z1A189A				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
EZ-Sensor..... 33000 ^A 11.5 1.3				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				Sensor..... 20315 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				Five Hundred			
Sensor..... 28395 27 3				2006-2007			
Sensor Clip..... 22100				OE Sensor: Ford Motor Company - 7L1Z1A189A			
Sensor Cradle..... 22101				EZ-Sensor..... 33000 ^A 11.5 1.3			
Universal Band..... 22102				EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3			
2014-2016				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
OE Sensor: Ford Motor Company - DE8T1A180AA				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				Sensor..... 28390 27 3			
EZ-Sensor..... 33700 11.5 1.3				Sensor Clip..... 22100			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				Sensor Cradle..... 22101			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				Universal Band..... 22102			
Sensor..... 20315 11.5 1.3							
Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3							

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.		
Ford (cont'd)				Ford (cont'd)					
Flex				Focus (cont'd)					
2009-2010				2010					
OE Sensor: Ford Motor Company - 7L1Z1A189A				OE Sensor: Ford Motor Company - 9L3Z1A189A					
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3		
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3		
	33700	11.5	1.3		33700	11.5	1.3		
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		
Sensor	28390	27	3	Sensor	20315	13	1.5		
Sensor Clip	22100			Service Pack; Rubber Valve	20018 C, T	11.5	1.3		
Sensor Cradle	22101			2011					
Universal Band	22102			OE Sensor: Ford Motor Company - 9L3Z1A189A					
2011-2015				EZ-Sensor					
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A-180-AA, DE8T-1A180-AA				33000 A				11.5	1.3
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3		
	33500 A, DB	11.5	1.3		33700	11.5	1.3		
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20315	11.5	1.3		
Sensor	20315	11.5	1.3	Service Pack; Rubber Valve	20018 C, T	11.5	1.3		
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2012-2015					
2016-2018				OE Sensor: Ford Motor Company - CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA					
OE Sensor: Ford Motor Company - DE8T-1A-180-AA				EZ-Sensor					
EZ-Sensor	33500 A, DB	11.5	1.3		33000 A	11.5	1.3		
	33700	11.5	1.3		33500 A, DB	11.5	1.3		
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3		
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
Sensor	20315	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20315	13	1.5		
Focus				Service Pack; Rubber Valve					
2007				20018 C, T					
OE Sensor: Ford Motor Company - 6F2Z1A189A				20018 C, T					
EZ-Sensor	33000 A	11.5	1.3	2016					
	33500 A, DB	11.5	1.3	OE Sensor: Ford Motor Company - DE8T1A180AA, DR3V-1A180AA, G1ET-1A180AA					
	33700	11.5	1.3	EZ-Sensor					
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3		
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3		
Sensor	28385	27	3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
Sensor Clip	22100			EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		
Sensor Cradle	22101			Sensor	20315	13	1.5		
Universal Band	22102			Sensor; RS	29014				
2008-2009				Service Pack; Rubber Valve					
OE Sensor: Ford Motor Company - 7L1Z1A189A				20018 C, T					
EZ-Sensor	33000 A	11.5	1.3	2017-2018					
	33500 A, DB	11.5	1.3	OE Sensor: Ford Motor Company - DE8T1A180AA					
	33700	11.5	1.3	EZ-Sensor					
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3		
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3		
Sensor	28390	27	3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
Sensor Clip	22100			EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		
Sensor Cradle	22101			Sensor	20315	13	1.5		
Universal Band	22102			Service Pack; Rubber Valve	20018 C, T	11.5	1.3		
Freestar				2004-2005					
2004-2005				OE Sensor: Ford Motor Company - 5L1Z 1A150 AA					
OE Sensor: Ford Motor Company - 5L1Z 1A150 AA				EZ-Sensor					
EZ-Sensor	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3		
	33700	11.5	1.3		33700	11.5	1.3		
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		
Sensor; W/Aluminium Valve Stem	20135 B	44	5	Sensor	20135 B	44	5		
Service Pack; W/Aluminium Valve Stem	20002 E	44	5	Service Pack; W/Aluminium Valve Stem	20002 E	44	5		
	20004 P	44	5		20004 P	44	5		

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Ford (cont'd)				Ford (cont'd)			
Freestar (cont'd)				Mustang			
2006-2007				2007-2009			
OE Sensor: Ford Motor Company - 6F2Z1A189A				OE Sensor: Ford Motor Company - 6F2Z1A189A			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28385	27	3	Sensor.....	28385	27	3
Sensor Clip.....	22100			Sensor Clip.....	22100		
Sensor Cradle.....	22101			Sensor Cradle.....	22101		
Universal Band.....	22102			Universal Band.....	22102		
Freestyle				2010-2011			
2005-2007				OE Sensor: Ford Motor Company - 9L3Z1A189A			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Fusion				Sensor.....			
2007-2009				20315			
OE Sensor: Ford Motor Company - 6F2Z1A189A				Service Pack; Rubber Valve.....			
EZ-Sensor.....	33000 A	11.5	1.3	20018 C, T			
	33500 A, DB	11.5	1.3	2012			
	33700	11.5	1.3	OE Sensor: Ford Motor Company - CM5T 1A180 AA			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor; exc Shelby GT500.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	33000 A			
Sensor.....	28385	27	3	EZ-Sensor; Shelby GT500; MUST use Aluminium			
Sensor Clip.....	22100			stem kit 34000 before Sensor installation.....			
Sensor Cradle.....	22101			33000 A			
Universal Band.....	22102			33500 A, DB			
2010-2015				33700			
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA				EZ-Sensor Service Pack; exc Shelby GT500;			
EZ-Sensor.....	33000 A	11.5	1.3	Aluminium Valve.....			
	33500 A, DB	11.5	1.3	34000			
	33700	11.5	1.3	EZ-Sensor Service Pack; exc Shelby GT500;			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Rubber Valve.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	20018 C, T			
Sensor.....	20315	11.5	1.3	EZ-Sensor Service Pack; Shelby GT500;			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Aluminium Valve.....			
2016				34000			
OE Sensor: Ford Motor Company - DE8T1A180AA				EZ-Sensor Service Pack; Shelby GT500; Rubber			
EZ-Sensor.....	33500 A, DB	11.5	1.3	Valve.....			
	33700	11.5	1.3	20018 C, T			
	34000	62	7	Sensor; exc Shelby GT500.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	20315			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; exc Shelby GT500.....			
Sensor.....	20315	11.5	1.3	20018 C, T			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2013			
2017-2018				OE Sensor: Ford Motor Company - 9L3Z1A189A			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor; exc Shelby GT500.....			
	33700	11.5	1.3	33000 A			
	34000	62	7	33500 A, DB			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33700			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; exc Shelby GT500;			
				Aluminium Valve.....			
				34000			
				EZ-Sensor Service Pack; exc Shelby GT500;			
				Rubber Valve.....			
				20018 C, T			
				11.5			
				1.3			
				20315			
				11.5			
				1.3			
				20018 C, T			
				11.5			
				1.3			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Ford (cont'd)				Ford (cont'd)			
Mustang (cont'd)				Police Interceptor Utility			
2014				2015-2017			
OE Sensor: Ford Motor Company - CM5T 1A180 AA, DE8T-1A180-A				EZ-Sensor:	33500 A, DB	11.5	1.3
EZ-Sensor; exc Shelby GT500.	33000 A	11.5	1.3		33700	11.5	1.3
EZ-Sensor; Shelby GT500; MUST use Aluminium				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
stem kit 34000 before Sensor installation.	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3				
	33700	11.5	1.3	Ranger			
EZ-Sensor Service Pack; exc Shelby GT500;				2007-2011			
Aluminium Valve.	34000	62	7	OE Sensor: Ford Motor Company - 6F2Z1A189A			
EZ-Sensor Service Pack; exc Shelby GT500;				EZ-Sensor:	33000 A	11.5	1.3
Rubber Valve.	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Shelby GT500;					33700	11.5	1.3
Aluminium Valve.	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor Service Pack; Shelby GT500; Rubber				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Valve.	20018 C, T	11.5	1.3	Sensor.	28385	27	3
Sensor; exc Shelby GT500.	20315	11.5	1.3	Sensor Clip.	22100		
Service Pack; exc Shelby GT500.	20018 C, T	11.5	1.3	Sensor Cradle.	22101		
2015				Universal Band.	22102		
OE Sensor: Ford Motor Company - F2GT-1A180-AB				Taurus			
EZ-Sensor:	33500 A, DB	11.5	1.3	2008-2009			
	33700	11.5	1.3	OE Sensor: Ford Motor Company - 7L1Z1A189A			
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor:	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.	20280	11.5	1.3		33700	11.5	1.3
Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
2016				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
OE Sensor: Ford Motor Company - DR3V-1A180AA, F2GT-1A180-AB				Sensor.	28390	27	3
EZ-Sensor:	33500 A, DB	11.5	1.3	Sensor Clip.	22100		
	33700	11.5	1.3	Sensor Cradle.	22101		
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Universal Band.	22102		
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	2010			
Sensor.	20280	11.5	1.3	OE Sensor: Ford Motor Company - 7L1Z1A189A, 9L3Z1A189A			
Sensor; Shelby GT350.	29014			EZ-Sensor:	33500 A, DB	11.5	1.3
Service Pack; Rubber Valve.	20018 C, T	11.5	1.3		33700	11.5	1.3
2017				EZ-Sensor; Apr. & Older.	33000 A	11.5	1.3
OE Sensor: Ford Motor Company - F2GT-1A180-AB				EZ-Sensor Service Pack; Apr. & Older; Aluminium			
Sensor.	20280	11.5	1.3	Valve.	34000	62	7
Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Apr. & Older; Rubber			
Police Interceptor Sedan				Valve.	20018 C, T	11.5	1.3
2011-2013				Sensor; Apr. & Older.	28390	27	3
EZ-Sensor:	33500 A, DB	11.5	1.3	Sensor; May & Newer.	20315	11.5	1.3
	33700	11.5	1.3	Sensor Clip; Apr. & Older.	22100		
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Sensor Cradle; Apr. & Older.	22101		
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Service Pack; May & Newer.	20018 C, T	11.5	1.3
2013				Universal Band; Apr. & Older.	22102		
EZ-Sensor:	33000 A	11.5	1.3	2011-2015			
2014-2017				OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA,			
EZ-Sensor:	33500 A, DB	11.5	1.3	CM5T-1A180A, DE8T-1A180-AA, DE8T1A180A			
	33700	11.5	1.3	EZ-Sensor:	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3		33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
				Sensor.	20315	11.5	1.3
				Service Pack; Rubber Valve.	20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.		
Ford (cont'd)				Freightliner					
Taurus (cont'd)				Sprinter					
2016-2018				2007-2008					
OE Sensor: Ford Motor Company - DE8T1A180A, DE8T1A180AA				OE Sensor: Chrysler - 68006771AA					
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3		
	33700	11.5	1.3		33500 A, DB	11.5	1.3		
	34000	62	7		33700	11.5	1.3		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		
Sensor.....	20315	11.5	1.3	Sensor.....	20089	53	6		
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Includes Valve.....	20036	53	6		
Transit				2009-2012					
2014-2015				EZ-Sensor.....					
OE Sensor: Ford Motor Company - DE8T-1A180-AA, DE8T1A180AA				33500 A, DB				11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33700	11.5	1.3		
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2013					
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Chrysler - 68006771AA					
Sensor.....	20315	11.5	1.3	EZ-Sensor.....					
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	33000 A					
2016-2018				33500 A, DB					
OE Sensor: Ford Motor Company - DE8T1A180AA				33700					
EZ-Sensor.....	33500 A, DB	11.5	1.3	34000					
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....					
	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....					
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	20018 C, T					
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....					
Sensor.....	20315	11.5	1.3	20089					
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Includes Valve.....					
Transit Connect				20036					
2010-2015				2014-2016					
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA				EZ-Sensor.....					
EZ-Sensor.....	33000 A	11.5	1.3	33500 A, DB					
	33500 A, DB	11.5	1.3	33700					
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....					
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....					
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	20018 C, T					
Sensor.....	20315	11.5	1.3	Sensor.....					
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	20089					
2016-2018				Service Pack; Includes Valve.....					
OE Sensor: Ford Motor Company - DE8T1A180AA				20036					
EZ-Sensor.....	33500 A, DB	11.5	1.3	2014-2016					
	33700	11.5	1.3	EZ-Sensor.....					
	34000	62	7	33500 A, DB					
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33700					
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....					
Sensor.....	20315	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....					
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	20018 C, T					
Genesis				20018 C, T					
G80				20018 C, T					
2017				20018 C, T					
EZ-Sensor.....				33500 A, DB					
	33500 A, DB	11.5	1.3	33700					
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....					
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....					
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	20018 C, T					
Service Pack.....	20050			Service Pack.....					
	20050V			20050					
2018				20050V					
Service Pack.....				20050					
	20050V			G90					
G90				2017					
2017				EZ-Sensor.....					
EZ-Sensor.....				33500 A, DB					
	33500 A, DB	11.5	1.3	33700					
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....					
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....					
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	20018 C, T					
Service Pack.....	20050			Service Pack.....					
	20050			20050					

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
GMC				GMC (cont'd)			
Acadia				Canyon (cont'd)			
2007-2008				2015-2018			
OE Sensor: General Motors - 10394110, 15921013				OE Sensor: General Motors - 13581558			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28206	11.5	1.3
Sensor	20158	62	7	Service Pack	20008 C, N	11.5	1.3
Service Pack; W/Schrader Sensor	20004 P	62	7		20018 C, T	11.5	1.3
Service Pack; W/Siemens Sensor	20030	80	9				
2009-2015				Envoy			
OE Sensor: General Motors - 22853741, 23445327, 25920615				2006			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: General Motors - 25774006			
	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20153	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack	20008 C, N	11.5	1.3	Sensor	20116	62	7
	20018 C, T	11.5	1.3	Service Pack	20004 P	62	7
2016-2017				2007-2009			
OE Sensor: General Motors - 13598771				OE Sensor: General Motors - 25774006			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	20153	11.5	1.3	Sensor	20116	62	7
Service Pack	20008 C, N	11.5	1.3	Service Pack	20004 P	62	7
	20018 C, T	11.5	1.3				
2018				Savana Series			
OE Sensor: General Motors - 13598771				2008-2009			
EZ-Sensor	33500 A, DB	11.5	1.3	OE Sensor: General Motors - 15921013			
	33700	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor	29015	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	20158	62	7
				Service Pack; W/Schrader Sensor	20004 P	62	7
				Service Pack; W/Siemens Sensor	20030	80	9
Acadia Limited				2010-2015			
2017				OE Sensor: General Motors - 13586335, 20923680, 22853741, 25920615			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	20153	11.5	1.3
				Service Pack	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
Canyon							
2007-2012							
OE Sensor: General Motors - 15122618							
EZ-Sensor	33000 A	11.5	1.3				
	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3				
Sensor	20131	62	7				
Service Pack	20006	62	7				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
GMC (cont'd)				GMC (cont'd)			
Savana Series (cont'd)				Sierra Series (cont'd)			
2016-2018				2008-2012			
OE Sensor: General Motors - 13586335				OE Sensor: General Motors - 15922396, 25920615			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20153	11.5	1.3	Sensor.....	20153	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	Sensor; W/Single Rear Wheels.....	20153	11.5	1.3
	20018 C, T	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
				Service Pack; W/Single Rear Wheels.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
Sierra Series				2013			
2004				OE Sensor: General Motors - 13586335			
OE Sensor: General Motors - 15136883				EZ-Sensor.....			
EZ-Sensor.....	33000 A	11.5	1.3		33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20115	62	7	Sensor; W/Single Rear Wheels.....	20153	11.5	1.3
Service Pack.....	20004 P	62	7	Service Pack; W/Single Rear Wheels.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
2005-2006				2014			
OE Sensor: General Motors - 15114379				OE Sensor: General Motors - 13581558			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20107	62	7	Sensor; W/Single Rear Wheels.....	28206	11.5	1.3
Service Pack.....	20004 P	62	7	Service Pack; W/Single Rear Wheels.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
2007				2015			
OE Sensor: General Motors - 15114379, 15254101, 15825475				OE Sensor: General Motors - 13581558			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic.....	20158	62	7	Sensor; W/Single Rear Wheels.....	28206	11.5	1.3
Sensor; Classic.....	20107	62	7	Service Pack.....	20008 C, N	11.5	1.3
Sensor; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic.....	20153	11.5	1.3		20018 C, T	11.5	1.3
Service Pack; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic.....	20007 V	80	9	Service Pack.....	20008 C, N	11.5	1.3
	20015 H	80	9		20018 C, T	11.5	1.3
Service Pack; Classic.....	20004 P	62	7	Service Pack; W/Single Rear Wheels.....	20008 C, N	11.5	1.3
Service Pack; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic.....	20008 C, N	11.5	1.3		20018 C, T	11.5	1.3
	20018 C, T	11.5	1.3	2016-2017			
				OE Sensor: General Motors - 13581558			
				EZ-Sensor.....	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor; W/Single Rear Wheels.....	28206	11.5	1.3
				Service Pack.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
				Service Pack; W/Single Rear Wheels.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 H-Use until depleted, replaced by 20007
N-Use until depleted, replaced by 20018 P-Interchanges with 20002 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
GMC (cont'd)				GMC (cont'd)			
Sierra Series (cont'd)				Yukon (cont'd)			
2018				2005-2006			
OE Sensor: General Motors - 13581558				OE Sensor: General Motors - 15114379			
EZ-Sensor.....	33500 A,DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A,DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; W/Single Rear Wheels.....	20283	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	Sensor.....	20107	62	7
				Service Pack.....	20004 P	62	7
Terrain				2007			
2010-2014				OE Sensor: General Motors - 15254101, 15825475			
OE Sensor: General Motors - 12768826, 22854866				EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33500 A,DB	11.5	1.3
	33500 A,DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	Sensor; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem.....	20158	62	7
Sensor.....	28206	11.5	1.3	Sensor; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem.....	20153	11.5	1.3
Service Pack.....	20008 C,N	11.5	1.3	Service Pack; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem.....	20007 V	62	7
	20018 C,T	11.5	1.3		20015 H	62	7
2015				Service Pack; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem.....			
OE Sensor: General Motors - 13598772					20008 C,N	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		20018 C,T	11.5	1.3
	33500 A,DB	11.5	1.3	2008-2013			
	33700	11.5	1.3	OE Sensor: General Motors - 13586335, 15922396, 20923680, 25920615			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3		33500 A,DB	11.5	1.3
Sensor.....	28206	11.5	1.3		33700	11.5	1.3
Service Pack; Rubber Valve.....	20008 C,N	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
2016-2017				Sensor.....			
OE Sensor: General Motors - 13598772				Service Pack.....	20008 C,N	11.5	1.3
EZ-Sensor.....	33500 A,DB	11.5	1.3		20018 C,T	11.5	1.3
	33700	11.5	1.3	2014-2015			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: General Motors - 13581558			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
Sensor.....	28206	11.5	1.3		33500 A,DB	11.5	1.3
Service Pack; Rubber Valve.....	20008 C,N	11.5	1.3		33700	11.5	1.3
	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2018				EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
OE Sensor: General Motors - 13598772				Sensor.....	20153	11.5	1.3
EZ-Sensor.....	33500 A,DB	11.5	1.3	Service Pack.....	20008 C,N	11.5	1.3
	33700	11.5	1.3		20018 C,T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2016-2017			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	OE Sensor: General Motors - 13581558			
Sensor.....	20283	11.5	1.3	EZ-Sensor.....	33500 A,DB	11.5	1.3
Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3		33700	11.5	1.3
Yukon				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2004				EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
OE Sensor: General Motors - 15136883				Sensor.....	28206	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	Service Pack.....	20008 C,N	11.5	1.3
	33500 A,DB	11.5	1.3		20018 C,T	11.5	1.3
	33700	11.5	1.3	2016-2017			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: General Motors - 13581558			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor.....	33500 A,DB	11.5	1.3
Sensor.....	20115	62	7		33700	11.5	1.3
Service Pack.....	20004 P	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 H-Use until depleted, replaced by 20007
N-Use until depleted, replaced by 20018 P-Interchanges with 20002 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
GMC (cont'd)				Honda (cont'd)			
Yukon (cont'd)				Civic			
2018				2008-2014			
OE Sensor: General Motors - 13581558				OE Sensor: Honda - 42753SNAA83, 42753TR0A81, 42753TR3A81			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20283	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28720	35	4
				Service Pack.....	20019	35	4
Yukon XL				2016-2018			
2015-2016				Sensor.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3		INDIRECT ^D		
	33700	11.5	1.3	Crosstour			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2010-2015			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Honda - 42753TP6A82			
2017-2018				Sensor.....			
OE Sensor: General Motors - 13581558				Service Pack.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3		20100	71	8
	33700	11.5	1.3		20050	71	8
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20050V	71	8
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	CR-V			
Sensor.....	20283	11.5	1.3	2007-2011			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Honda - 42753SWA306, 42753SWA316			
Honda				EZ-Sensor.....			
Accord				33000 A			
2008-2012				33500 A, DB			
OE Sensor: Honda - 42753SWA306, 42753SWA316				33700			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
	33700	11.5	1.3	Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2012-2013			
Sensor.....	20099	35	4	OE Sensor: Honda - 42753-TP6-A82			
Service Pack.....	20032	35	4	EZ-Sensor.....			
2013-2018				33500 A, DB			
Sensor.....				33700			
	INDIRECT ^D			EZ-Sensor Service Pack; Aluminium Valve.....			
Accord Crosstour				EZ-Sensor Service Pack; Rubber Valve.....			
2010-2015				Sensor.....			
OE Sensor: Honda - 42753-TP6-A82, 42753TP6A82				Service Pack.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3	20100			
	33700	11.5	1.3	20050			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	20050V			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2014-2018			
Sensor.....	20100	35	4	Sensor.....			
Service Pack.....	20050	35	4		INDIRECT ^D		
	20050V	35	4	CR-Z			
2011-2014				2011-2014			
OE Sensor: Honda - 42753SNAA83, 42753SNAA84				OE Sensor: Honda - 42753SNAA83, 42753SNAA84			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....			
	33500 A, DB	11.5	1.3	33000 A			
	33700	11.5	1.3	33500 A, DB			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33700			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
Sensor.....	28720	35	4	EZ-Sensor Service Pack; Rubber Valve.....			
Service Pack.....	20019	35	4	Sensor.....			
				Service Pack.....			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000, 33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Honda (cont'd)				Honda (cont'd)			
CR-Z (cont'd)				Insight			
2015				2010-2014			
OE Sensor: Honda - 42753TR3A81				OE Sensor: Honda - 42753SNAA83			
EZ-Sensor.....	33500 A,DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A,DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28720	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
Service Pack.....	20019	35	4	Sensor.....	28720	35	4
2016				Service Pack.....			
OE Sensor: Honda - 42753-SNA-A83					20019	35	4
Sensor.....	28720			Odyssey			
Element				2005-2007			
2007-2008				OE Sensor: Honda - 06421S3VA04			
Service Pack; Includes Valve.....	20036	35	4	Sensor; Touring.....	28981	35	4
2009-2011				Service Pack; Touring; Includes Valve.....			
OE Sensor: Honda - 42753SNAA83					20036	35	4
EZ-Sensor.....	33000 A	11.5	1.3	2008			
	33500 A,DB	11.5	1.3	OE Sensor: Honda - 42753-AHJ-A53, 42753-SHJ-A82			
	33700	11.5	1.3	Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	Service Pack; Includes Valve.....			
Sensor.....	28720	35	4	Service Pack; Touring; Includes Valve.....			
Service Pack.....	20019	35	4	20036			
Fit				2009-2010			
2008				OE Sensor: Honda - 42753-SHJ-A82			
OE Sensor: Honda - 42753SWA306				Sensor.....			
EZ-Sensor.....	33000 A	11.5	1.3	Service Pack; Includes Valve.....			
	33500 A,DB	11.5	1.3	20036			
	33700	11.5	1.3	2011-2016			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Honda - 42753-TR3-A81, 42753-TR3-A83			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor.....			
Sensor.....	20099	35	4	EZ-Sensor.....			
Service Pack.....	20032	35	4	EZ-Sensor Service Pack; Aluminium Valve.....			
2009-2014				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Honda - 42753SNAA83, 42753TR3A81				Sensor.....			
EZ-Sensor.....	33000 A	11.5	1.3	Service Pack.....			
	33500 A,DB	11.5	1.3	20019			
	33700	11.5	1.3	2017			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Honda - 42753-TR3-A81			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	Sensor.....			
Sensor.....	28720	35	4	Service Pack.....			
Service Pack.....	20019	35	4	20019			
2015-2018				2018			
Sensor.....	INDIRECT ^D			Service Pack.....			
HR-V				20050			
2016-2017				20050V			
Sensor.....	INDIRECT ^D			Odyssey Touring			
				2005-2010			
				EZ-Sensor.....			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				EZ-Sensor Service Pack; Rubber Valve.....			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Honda (cont'd)				Honda (cont'd)			
Pilot				Ridgeline			
2005				2006			
OE Sensor: Honda - 06421S3VA02, 06421S9VA01				OE Sensor: Honda - 06421S3VA02, 06421S9VA01			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; LX; W/Long Stem Valve.....	28982	35	4	Sensor; RT.....	28982	35	4
Sensor; W/Short Stem Valve.....	28981	35	4	Sensor; RTL, RTS.....	28981	35	4
Service Pack; EX; Includes Valve.....	20036	35	4	Service Pack; RT; Includes Valve.....	20035	35	4
Service Pack; LX; W/Long Stem Valve; Includes Valve.....	20035	35	4	Service Pack; RTL, RTS; Includes Valve.....	20036	35	4
Service Pack; LX; W/Short Stem Valve; Includes Valve.....	20036	35	4	2007-2008			
2006-2008				OE Sensor: Honda - 06421S3VA04, 06421S9VA03			
OE Sensor: Honda - 06421S3VA02, 06421S3VA04				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor; RT.....	28982	35	4
Sensor.....	28981	35	4	Sensor; RTL, RTS, RTX.....	28981	35	4
Service Pack; Includes Valve.....	20036	35	4	Service Pack; RT; Includes Valve.....	20035	35	4
2009				Service Pack; RTL, RTS, RTX; Includes Valve.....	20036	35	4
OE Sensor: Honda - 42753STKA03				2009			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Honda - 06421S3VA04			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; W/Alloy Wheels.....	20098	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/Alloy Wheels.....	20032	35	4	Sensor.....	28981	35	4
2010-2011				Service Pack; Includes Valve.....	20036	35	4
OE Sensor: Honda - 42753STKA04				2010			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Honda - 06421S3VA04, 42753SHJA53			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; Exc. LX.....	20098	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Exc. LX.....	20032	35	4	Sensor; W/Alloy Wheels.....	28981	35	4
2012-2014				Sensor; W/Steel Wheels.....	28981	35	4
OE Sensor: Honda - 42753STKA04				Service Pack; RT; Includes Valve.....	20036	35	4
EZ-Sensor.....	33500 A, DB	11.5	1.3	2011-2013			
	33700	11.5	1.3	OE Sensor: Honda - 06421S3VA04, 42753SHJA53, 42753SHJA54			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor; W/Alloy Wheels.....	20098	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/Alloy Wheels.....	20032	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2015				Sensor.....	28981	35	4
OE Sensor: Honda - 42753STKA04				Sensor; W/Steel Wheels.....	28981	35	4
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; RT; Includes Valve.....	20036	35	4
	33700	11.5	1.3	2014			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Honda - 42753SHJA53			
Sensor; W/Alloy Wheels.....	20098	35	4	Sensor.....	28981	35	4
Service Pack; W/Alloy Wheels.....	20032	35	4	Service Pack; RT; Includes Valve.....	20036	35	4
				2016-2017			
				Service Pack.....	20050		
					20050V		

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000, 33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Honda (cont'd)				Hyundai			
S2000				Accent			
2008-2009				2006-2007			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: Hyundai - 52933-1F000			
	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28983	35	4
Service Pack	20032	35	4	Service Pack; Includes Valve	20036	31-40	3.5-4.5
Hummer				2008-2011			
H2				OE Sensor: Hyundai - 529332F000			
2008-2009				EZ-Sensor			
OE Sensor: General Motors - 15922396					33000 A	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28849	35	4
Sensor	20153	11.5	1.3	Service Pack	20022	35	4
Service Pack	20008 C, N	11.5	1.3	2012-2014			
	20018 C, T	11.5	1.3	OE Sensor: Hyundai - 529332M000			
H3				EZ-Sensor			
2006-2010							
OE Sensor: General Motors - 15122618					33000 A	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20092	31-40	3.5-4.5
Sensor	20131	62	7	Service Pack	20050	31-40	3.5-4.5
Service Pack	20006	62	7		20050V	31-40	3.5-4.5
H3T				2015			
2006-2008				Service Pack			
EZ-Sensor	33500 A, DB	11.5	1.3		20050	31-40	3.5-4.5
	33700	11.5	1.3		20050V	31-40	3.5-4.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Azera			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2006			
Sensor	20131	62	7	OE Sensor: Hyundai - 529332G200			
Service Pack	20006	62	7	Sensor; Includes Transmitter Only			
2009-2010				Service Pack; Includes Valve			
OE Sensor: General Motors - 15122618					20086	31-40	3.5-4.5
EZ-Sensor	33000 A	11.5	1.3		20036	31-40	3.5-4.5
	33500 A, DB	11.5	1.3	2007-2012			
	33700	11.5	1.3	OE Sensor: Hyundai - 529332G200			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33000 A	11.5	1.3
Sensor	20086	31-40	3.5-4.5		33500 A, DB	11.5	1.3
Service Pack; Includes Valve	20036	31-40	3.5-4.5		33700	11.5	1.3
2013				EZ-Sensor Service Pack; Aluminium Valve			
OE Sensor: Hyundai - 529332G201				EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor				Sensor; Includes Transmitter Only			
	33000 A	11.5	1.3	Service Pack; Includes Valve			
	33500 A, DB	11.5	1.3		20086	31-40	3.5-4.5
	33700	11.5	1.3	2014-2015			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		20052		
Sensor	20086	31-40	3.5-4.5				
Service Pack; Includes Valve	20036	31-40	3.5-4.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Hyundai (cont'd)				Hyundai (cont'd)			
Elantra				Elantra (cont'd)			
2007-2009				2014			
OE Sensor: Hyundai - 529332G200				OE Sensor: Hyundai - 52933-3N000			
EZ-Sensor:	33000 ^A	11.5	1.3	Sensor:	20092	31-40	3.5-4.5
	33500 ^{A, DB}	11.5	1.3	Service Pack:	20050	31-40	3.5-4.5
	33700	11.5	1.3		20050V	31-40	3.5-4.5
EZ-Sensor Service Pack; Aluminium Valve:	34000	62	7		20052		
EZ-Sensor Service Pack; Rubber Valve:	20018 ^{C, T}	11.5	1.3	2015			
Sensor; Includes Transmitter Only:	20086	31-40	3.5-4.5	EZ-Sensor; exc Touring:	33500 ^{A, DB}	11.5	1.3
Service Pack; Includes Valve:	20036	31-40	3.5-4.5		33700	11.5	1.3
2010				EZ-Sensor Service Pack; exc Touring; Aluminium Valve:			
OE Sensor: Hyundai - 529332G200, 529332M000					34000	62	7
EZ-Sensor; exc Touring:	33000 ^A	11.5	1.3	EZ-Sensor Service Pack; exc Touring; Rubber Valve:	20018 ^{C, T}	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	Service Pack:	20052		
	33700	11.5	1.3	2016-2018			
EZ-Sensor Service Pack; exc Touring; Aluminium Valve:	34000	62	7	EZ-Sensor; exc Touring:	33500 ^{A, DB}	11.5	1.3
EZ-Sensor Service Pack; exc Touring; Rubber Valve:	20018 ^{C, T}	11.5	1.3		33700	11.5	1.3
Sensor; exc Touring; Includes Transmitter Only:	20086	31-40	3.5-4.5	EZ-Sensor Service Pack; exc Touring; Aluminium Valve:	34000	62	7
Sensor; Touring; Includes Transmitter Only:	20092	31-40	3.5-4.5	EZ-Sensor Service Pack; exc Touring; Rubber Valve:	20018 ^{C, T}	11.5	1.3
Service Pack:	20019	35	4		20052		
	20050			Elantra Coupe			
	20050V			2013			
Service Pack; exc Touring; Includes Valve:	20036	31-40	3.5-4.5	OE Sensor: Hyundai - 529333X200			
Service Pack; Touring; Includes Transmitter Only:	20050	31-40	3.5-4.5	Sensor; W/Transmitter Only:	20086	31-40	3.5-4.5
	20050V	31-40	3.5-4.5	Service Pack:	20052		
2011				Service Pack; Includes Valve:	20036	31-40	3.5-4.5
OE Sensor: Hyundai - 529332M000, 529333X200				2014			
Sensor; exc Touring; Includes Transmitter Only:	20086	31-40	3.5-4.5	Service Pack:	20052		
Sensor; Touring; Includes Transmitter Only:	20092	31-40	3.5-4.5	Elantra GT			
Service Pack:	20019	35	4	2013-2015			
	20050			OE Sensor: Hyundai - 52933-3N000			
	20050V			Sensor:	20092	31-40	3.5-4.5
Service Pack; exc Touring; Includes Valve:	20036	31-40	3.5-4.5	Service Pack:	20050	31-40	3.5-4.5
Service Pack; Touring; Includes Transmitter Only:	20050	31-40	3.5-4.5		20050V	31-40	3.5-4.5
	20050V	31-40	3.5-4.5	2016-2017			
2012				OE Sensor: Hyundai - 52933-2M550, 52933-3N000			
OE Sensor: Hyundai - 529332M000, 529333X200				EZ-Sensor; exc Touring:	33500 ^{A, DB}	11.5	1.3
Sensor; exc Touring; W/Transmitter Only:	20086	31-40	3.5-4.5		33700	11.5	1.3
Sensor; Touring; W/Transmitter Only:	20092	31-40	3.5-4.5	EZ-Sensor Service Pack; exc Touring; Aluminium Valve:	34000	62	7
Service Pack:	20019	35	4	EZ-Sensor Service Pack; exc Touring; Rubber Valve:	20018 ^{C, T}	11.5	1.3
	20050			Sensor:	20092	31-40	3.5-4.5
	20050V			Service Pack:	20050	31-40	3.5-4.5
Service Pack; exc Touring; Includes Valve:	20036	31-40	3.5-4.5		20050V	31-40	3.5-4.5
Service Pack; Touring; W/Transmitter Only:	20050	31-40	3.5-4.5	2017			
	20050V	31-40	3.5-4.5	Service Pack:	20050		
2013					20050V		
OE Sensor: Hyundai - 529333X200				Entourage			
Sensor; W/Transmitter Only:	20086	31-40	3.5-4.5	2007-2009			
Service Pack:	20019	35	4	OE Sensor: Hyundai - 529334D200			
	20052			Sensor; Includes Transmitter Only:	20085	31-40	3.5-4.5
Service Pack; Includes Valve:	20036	31-40	3.5-4.5	Service Pack; Includes Valve:	20036	31-40	3.5-4.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Hyundai (cont'd)				Hyundai (cont'd)			
Equus				Genesis Coupe (cont'd)			
2011-2013				2014-2015			
OE Sensor: Hyundai - 529332F000, 529332F001				OE Sensor: Hyundai - 529332M000			
Sensor.....	28849	35	4	EZ-Sensor.....	33000 A	11.5	1.3
Service Pack.....	20022	35	4		33500 A, DB	11.5	1.3
2014-2015					33700	11.5	1.3
OE Sensor: Hyundai - 529332M001				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor.....	20092	31-40	3.5-4.5
	33700	11.5	1.3	Service Pack.....	20050	31-40	3.5-4.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20050V	31-40	3.5-4.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2016			
Sensor.....	20092	31-40	3.5-4.5	OE Sensor: Hyundai - 529332M000			
Service Pack.....	20050	31-40	3.5-4.5	Sensor.....	20092	31-40	3.5-4.5
	20050V	31-40	3.5-4.5	Service Pack.....	20050	31-40	3.5-4.5
2016					20050V	31-40	3.5-4.5
OE Sensor: Hyundai - 529332M001				Santa Fe			
EZ-Sensor.....	33500 A, DB	11.5	1.3	2007			
	33700	11.5	1.3	OE Sensor: Hyundai - 529334D200			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; Includes Transmitter Only.....	20085	31-40	3.5-4.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Includes Valve.....	20036	31-40	3.5-4.5
Sensor.....	20092	31-40	3.5-4.5	2008			
Service Pack.....	20050	31-40	3.5-4.5	OE Sensor: Hyundai - 529332G200, 529334D200			
	20050V	31-40	3.5-4.5	EZ-Sensor.....	33000 A	11.5	1.3
	20050V	31-40	3.5-4.5		33500 A, DB	11.5	1.3
Genesis					33700	11.5	1.3
2009-2014				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: Hyundai - 529332F000				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28849	35	4	Sensor; Includes Transmitter Only.....	20085	31-40	3.5-4.5
Service Pack.....	20022	35	4		20086	31-40	3.5-4.5
2014				Service Pack; Includes Valve.....	20036	31-40	3.5-4.5
Service Pack.....	20050			2009			
	20050V			OE Sensor: Hyundai - 529332G200			
2015-2016				EZ-Sensor.....	33000 A	11.5	1.3
Service Pack.....	20050				33500 A, DB	11.5	1.3
	20050V				33700	11.5	1.3
Genesis Coupe				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2010-2012				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
OE Sensor: Hyundai - 529332M000				Sensor; Includes Transmitter Only.....	20086	31-40	3.5-4.5
EZ-Sensor.....	33000 A	11.5	1.3	Service Pack; Includes Valve.....	20036	31-40	3.5-4.5
	33500 A, DB	11.5	1.3	2010-2012			
	33700	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor.....	20092	31-40	3.5-4.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20050	31-40	3.5-4.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	20050V	31-40	3.5-4.5	2013			
2013				OE Sensor: Hyundai - 529332M001			
OE Sensor: Hyundai - 52933-A5000				Sensor.....	20092	31-40	3.5-4.5
Sensor.....	20092	31-40	3.5-4.5	Service Pack.....	20022	35	4
Service Pack.....	20050	31-40	3.5-4.5		20050	31-40	3.5-4.5
	20050V	31-40	3.5-4.5		20050V	31-40	3.5-4.5
2014-2016				2014-2016			
OE Sensor: Hyundai - 529332M000, 529333N000				OE Sensor: Hyundai - 529332M000, 529333N000			
Sensor.....	20092	31-40	3.5-4.5	Sensor.....	20092	31-40	3.5-4.5
Service Pack.....	20050	31-40	3.5-4.5	Service Pack.....	20050	31-40	3.5-4.5
	20050V	31-40	3.5-4.5		20050V	31-40	3.5-4.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Hyundai (cont'd)				Hyundai (cont'd)			
Santa Fe (cont'd)				Sonata (cont'd)			
2018				2015-2017			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Hyundai - 52933-C1100			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Santa Fe XL				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2013				Sensor.....	20281	11.5	1.3
OE Sensor: Hyundai - 52933A5000				Service Pack; Rubber Valve.....	20046	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	2018			
	33500 A, DB	11.5	1.3	OE Sensor: Hyundai - 52933-C1100			
	33700	11.5	1.3	Sensor.....	20281	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Rubber Valve.....	20046	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Tiburon			
Sensor.....	28849	35	4	2007-2008			
Service Pack.....	20022	35	4	OE Sensor: Hyundai - 529331FA00			
Sonata				EZ-Sensor.....	33500 A, DB	11.5	1.3
2007-2008					33700	11.5	1.3
OE Sensor: Hyundai - 52933-1F000, 529331FA00				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	28983	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Includes Valve.....	20036	31-40	3.5-4.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Tucson			
Sensor.....	28983	35	4	2006-2009			
Service Pack; Includes Valve.....	20036	31-40	3.5-4.5	OE Sensor: Hyundai - 529331FA00			
2008				EZ-Sensor.....	33500 A, DB	11.5	1.3
OE Sensor: Hyundai - 52933-2F000					33700	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28849	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2009-2010				Sensor.....	28983	35	4
OE Sensor: Hyundai - 529332F000				Service Pack; Includes Valve.....	20036	31-40	3.5-4.5
EZ-Sensor.....	33000 A	11.5	1.3	2010-2013			
	33500 A, DB	11.5	1.3	OE Sensor: Hyundai - 529332F000			
	33700	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor.....	28849	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20022	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2011-2013				Sensor.....	28849	35	4
OE Sensor: Hyundai - 529332M000, 529332M001				Service Pack.....	20022	35	4
EZ-Sensor.....	33000 A	11.5	1.3	2014			
	33500 A, DB	11.5	1.3	OE Sensor: Hyundai - 529332S500			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20092	31-40	3.5-4.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20050	31-40	3.5-4.5	Sensor.....	28500		
	20050V	31-40	3.5-4.5	2015-2017			
2014				OE Sensor: Hyundai - 52933-C1100			
OE Sensor: Hyundai - 529332M550				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20281	11.5	1.3
Sensor.....	20092	31-40	3.5-4.5	Service Pack; Rubber Valve.....	20046	11.5	1.3
Service Pack.....	20050	31-40	3.5-4.5				
	20050V	31-40	3.5-4.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Hyundai (cont'd)				Infiniti			
Tucson (cont'd)				EX35			
2018				2008-2010			
OE Sensor: Hyundai - 52933-C1100				OE Sensor: Nissan - 40700-JK00B			
Sensor.....	20281	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
Service Pack; Rubber Valve.....	20046	11.5	1.3		33500 A, DB	11.5	1.3
					33700	11.5	1.3
Veloster				EZ-Sensor Service Pack; Aluminium Valve.....			
2012-2016				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Hyundai - 529332V000				Sensor.....	28210	66	7.5
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack.....	20014	66	7.5
	33700	11.5	1.3	2011-2012			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....	28505	11.5	1.3		33700	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2017				2013			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20050			EX37			
	20050V			2011-2012			
2018-2021				EZ-Sensor.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3		33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Veracruz				EX35			
2006-2007				2003-2006			
OE Sensor: Hyundai - 529334D200				OE Sensor: Nissan - 40700-CD001			
Sensor; Includes Transmitter Only.....	20085	31-40	3.5-4.5	EZ-Sensor.....	33000 A	11.5	1.3
Service Pack; Includes Valve.....	20036	31-40	3.5-4.5		33500 A, DB	11.5	1.3
2008				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Hyundai - 529332G200, 529334D200				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	Sensor.....	20064	66	7.5
	33500 A, DB	11.5	1.3	Service Pack.....	20007 V	66	7.5
	33700	11.5	1.3	2007			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Nissan - 40700-CD001, 40700-JA01B			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
Sensor.....	20086				33500 A, DB	11.5	1.3
Sensor; Includes Transmitter Only.....	20085	31-40	3.5-4.5		33700	11.5	1.3
Service Pack; Includes Valve.....	20036	31-40	3.5-4.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2009-2012				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Hyundai - 529332G200				Sensor; Jul. & Newer.....	28204	66	7.5
EZ-Sensor.....	33000 A	11.5	1.3	Sensor; Jun. & Older.....	20064	66	7.5
	33500 A, DB	11.5	1.3	Service Pack; Jul. & Newer.....	20014	66	7.5
	33700	11.5	1.3	Service Pack; Jun. & Older.....	20007 V	66	7.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Sensor; Includes Transmitter Only.....	20086	31-40	3.5-4.5				
Service Pack; Includes Valve.....	20036	31-40	3.5-4.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Infiniti (cont'd)				Infiniti (cont'd)			
FX35 (cont'd)				FX45 (cont'd)			
2008				2007			
OE Sensor: Nissan - 40700-JA01B				OE Sensor: Nissan - 40700-CD001, 40700-JA01B			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28204	66	7.5	Sensor; Jul. & Newer.....	28204	66	7.5
Service Pack.....	20014	66	7.5	Sensor; Jun. & Older.....	20064	66	7.5
2009-2010				2008			
OE Sensor: Nissan - 40700-JK00B				OE Sensor: Nissan - 40700-JA01B			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28210	66	7.5	Sensor.....	28204	66	7.5
Service Pack.....	20014	66	7.5	Service Pack.....	20014	66	7.5
2011-2012				FX50			
EZ-Sensor.....	33000 A	11.5	1.3	2009-2010			
	33500 A, DB	11.5	1.3	OE Sensor: Nissan - 40700-JK00B			
	33700	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
2013				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	28210	66	7.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20014	66	7.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2011-2013			
FX37				EZ-Sensor.....	33000 A	11.5	1.3
2013					33500 A, DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28210	66	7.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack.....	20014	66	7.5
FX45				G25			
2003-2006				2011-2013			
OE Sensor: Nissan - 40700-CD001				EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	G35			
Sensor.....	20064	66	7.5	2003			
Service Pack.....	20007 V	66	7.5	OE Sensor: Nissan - 40700-CD001			
				EZ-Sensor.....	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor; Jun. & Newer.....	20064	61-72	6.8-8.2
				Service Pack; Jun. & Newer.....	20007 V	61-72	6.8-8.2

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008
V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Infiniti (cont'd)				Infiniti (cont'd)			
G35 (cont'd)				M35 (cont'd)			
2004-2006				2008-2010			
OE Sensor: Nissan - 40700-CD001				OE Sensor: Nissan - 40700-JA00C, 40700-JA01C			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A,DB	11.5	1.3		33500 A,DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
Sensor.....	20064	61-72	6.8-8.2	Sensor.....	28204	66	7.5
Service Pack.....	20007 V	61-72	6.8-8.2	Service Pack.....	20014	66	7.5
2007				2011-2012			
OE Sensor: Nissan - 40700-JA01B, 40700-JK00B				EZ-Sensor.....	33500 A,DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A,DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	M35h			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	2011			
Sensor; Coupe.....	28204	66	7.5	EZ-Sensor.....	33500 A,DB	11.5	1.3
Sensor; Sedan.....	28210	66	7.5		33700	11.5	1.3
Service Pack.....	20014	66	7.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2008				EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
OE Sensor: Nissan - 40700-JK00B				2012			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Nissan - 40700-JA01C			
	33500 A,DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A,DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28210	66	7.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
Service Pack.....	20014	66	7.5	Sensor.....	28204	66	7.5
G37				Service Pack.....	20014	66	7.5
2008-2010				M37			
OE Sensor: Nissan - 40700-JK00B				2011-2012			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Nissan - 40700-JA01C			
	33500 A,DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A,DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28210	66	7.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
Service Pack.....	20014	66	7.5	Sensor.....	28204	66	7.5
2011-2013				Service Pack.....	20014	66	7.5
EZ-Sensor.....	33000 A	11.5	1.3	2013			
	33500 A,DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A,DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
M35				EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
2006-2007				M37			
OE Sensor: Nissan - 40700-CD001				2011-2012			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Nissan - 40700-JA01C			
	33500 A,DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A,DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20064	66	7.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
Service Pack.....	20007 V	66	7.5	Sensor.....	28204	66	7.5
M35				Service Pack.....	20014	66	7.5
2006-2007				2013			
OE Sensor: Nissan - 40700-CD001				EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33500 A,DB	11.5	1.3
	33500 A,DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3				
Sensor.....	20064	66	7.5				
Service Pack.....	20007 V	66	7.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008
V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Infiniti (cont'd)				Infiniti (cont'd)			
M45				Q30			
2003-2004				2016			
OE Sensor: Nissan - 40700-CD001				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20064	66	7.5	Sensor.....	20213	80	9
Service Pack.....	20007 V	66	7.5	Service Pack.....	20049 U		
2006-2007				Q45			
OE Sensor: Nissan - 40700-CD001				2002			
EZ-Sensor.....	33000 A	11.5	1.3	Service Pack.....	20007 V	66	7.5
	33500 A, DB	11.5	1.3	2003-2005			
	33700	11.5	1.3	OE Sensor: Nissan - 40700-CD001			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....	20064	66	7.5		33700	11.5	1.3
Service Pack.....	20007 V	66	7.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2008-2009				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Nissan - 40700-JA00C, 40700-JA01C				20018 C, T			
EZ-Sensor.....	33000 A	11.5	1.3	Sensor.....	20064	66	7.5
	33500 A, DB	11.5	1.3	Service Pack.....	20007 V	66	7.5
	33700	11.5	1.3	2006			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Nissan - 40700-CD001, 40700-JA01B			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
Sensor.....	28204	66	7.5		33500 A, DB	11.5	1.3
Service Pack.....	20014	66	7.5		33700	11.5	1.3
2010				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Nissan - 40700-JA01C				34000			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; Aug. & Newer.....	28204	66	7.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor; Jul. & Older.....	20064	66	7.5
Sensor.....	28204	66	7.5	Service Pack; Aug. & Newer.....	20014	66	7.5
Service Pack.....	20014	66	7.5	Service Pack; Jul. & Older.....	20007 V	66	7.5
2011				Q70			
EZ-Sensor.....				2014-2018			
	33000 A	11.5	1.3	EZ-Sensor.....			
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
M56				Q70L			
2011-2012				2018			
OE Sensor: Nissan - 40700-JA01C				EZ-Sensor.....			
EZ-Sensor.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	QX30			
Sensor.....	28204	66	7.5	2016			
Service Pack.....	20014	66	7.5	OE Sensor: Mercedes-Benz - A0009050030			
2013				EZ-Sensor.....			
EZ-Sensor.....					33000 A	11.5	1.3
	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20213	80	9
				Service Pack.....			
				20049 U			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008
 U-Interchanges with 20047 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Infiniti (cont'd)				Infiniti (cont'd)			
QX30 (cont'd)				QX56 (cont'd)			
2017-2018				2008-2010			
EZ-Sensor	33500 A, DB	11.5	1.3	OE Sensor: Nissan - 40700-JA01B, 40700-JA02B			
	33700	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
QX4				EZ-Sensor Service Pack; Aluminium Valve			
2003				EZ-Sensor Service Pack; Rubber Valve			
OE Sensor: Nissan - 40700-CD001				Sensor	28204	49	5.5
EZ-Sensor	33000 A	11.5	1.3	Service Pack	20014	49	5.5
	33500 A, DB	11.5	1.3	2011-2013			
	33700	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor	20064	66	7.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack	20007 V	66	7.5	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
QX50				QX60			
2013-2018				2014-2015			
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack	20050V		
	33700	11.5	1.3		20051		
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	QX70			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2014-2018			
QX56				EZ-Sensor			
2004							
OE Sensor: Nissan - 40700-CK002					33500 A, DB	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	QX80			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2014-2016			
Sensor	20069	49	5.5	EZ-Sensor	33500 A, DB	11.5	1.3
Service Pack	20005 K	49	5.5		33700	11.5	1.3
	20009 R	49	5.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
2005-2006				EZ-Sensor Service Pack; Rubber Valve			
OE Sensor: Nissan - 40700-CK001, 40700-CK002					20018 C, T	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3	Sensor; W/Alloy Wheels	20161	49	5.5
	33500 A, DB	11.5	1.3	Sensor; W/Steel Wheels	20069	49	5.5
	33700	11.5	1.3	Service Pack; W/Alloy Wheels	20007 V	49	5.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/Steel Wheels	20005 K	49	5.5
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		20009 R	49	5.5
Sensor; W/Alloy Wheels	20161	49	5.5	Isuzu			
Sensor; W/Steel Wheels	20069	49	5.5	Ascender			
Service Pack; W/Alloy Wheels	20007 V	49	5.5	2006-2008			
Service Pack; W/Steel Wheels	20005 K	49	5.5	OE Sensor: Isuzu - 8257740060			
	20009 R	49	5.5	EZ-Sensor	33500 A, DB	11.5	1.3
2007				EZ-Sensor Service Pack; exc Touring; Aluminium Valve			
OE Sensor: Nissan - 40700-CK001, 40700-JA02B					34000	62	7
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor	20116	62	7
	33700	11.5	1.3	Service Pack	20004 P	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2009-2011			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
Sensor; Apr. 1 & Newer	28204	49	5.5		33700	11.5	1.3
Sensor; Mar. & Older	20161	49	5.5	EZ-Sensor Service Pack; exc Touring; Aluminium Valve	34000	62	7
Service Pack; Apr. 1 & Newer	20014	49	5.5	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; Mar. & Older	20007 V	49	5.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 K-Use until depleted, replaced by 20009
P-Interchanges with 20002 R-Interchanges with 20005, 20010 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Isuzu (cont'd)				Jaguar (cont'd)			
i-290				XE			
2007-2008				2015-2017			
OE Sensor: General Motors - 15122618				Service Pack.....	20050		
EZ-Sensor.....	33000 A	11.5	1.3		20050V		
	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Sensor.....	20131	62	7				
Service Pack.....	20006	62	7				
2009				Jeep			
EZ-Sensor.....	33500 A, DB	11.5	1.3	Cherokee			
	33700	11.5	1.3	2013			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack..... 20018 C, T			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2014			
Sensor.....	20131	62	7	OE Sensor: Chrysler - 682397208AA			
Service Pack.....	20006	62	7	EZ-Sensor..... 33500 A, DB 11.5 1.3			
				33700 11.5 1.3			
				EZ-Sensor Service Pack..... 20018 C, T			
				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
				Sensor..... 28984 35 4			
				Service Pack..... 20635 11.5 1.3			
				Service Pack; Rubber Valve..... 20018 C, T 11.5 1.3			
				2015			
				OE Sensor: Chrysler - 68239720AC			
				EZ-Sensor..... 33500 A, DB 11.5 1.3			
				33700 11.5 1.3			
				EZ-Sensor Service Pack..... 20018 C, T			
				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
				Sensor..... 28984 35 4			
				Service Pack; Rubber Valve..... 20018 C, T 11.5 1.3			
				20635 11.5 1.3			
				2016-2017			
				OE Sensor: Chrysler - 68239720AC			
				EZ-Sensor..... 33500 A, DB 11.5 1.3			
				33700 11.5 1.3			
				EZ-Sensor Service Pack..... 20018 C, T			
				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
				Sensor..... 28984 35 4			
				Service Pack; Rubber Valve..... 20635 11.5 1.3			
				2018			
				OE Sensor: Chrysler - 68239720AC			
				Sensor..... 28984 35 4			
				Service Pack; Rubber Valve..... 20635 11.5 1.3			
				Commander			
				2006-2007			
				OE Sensor: Chrysler - 56053030AB, 56053036AA			
				EZ-Sensor..... 33500 A, DB 11.5 1.3			
				33700 11.5 1.3			
				EZ-Sensor; Caution: Ez-sensor will not support			
				(Wai) Wheel Arch Initiators..... 33000 A 11.5 1.3			
				EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7			
				EZ-Sensor Service Pack; Rubber Valve..... 20018 C, T 11.5 1.3			
				Sensor..... 28308 F 11.5 1.3			
				Service Pack; Fits Schrader Alum stem sensor.			
				Does not include stem..... 20013 S 58 6.5			
				Service Pack; Fits Schrader Sensor; Includes			
				Stem Only..... 20020 58 6.5			
				Service Pack; Rubber Valve..... 20018 C, T 11.5 1.3			
				Service Pack; W/Siemens Sensor..... 20030 71 8			
Jaguar				Jaguar			
2004-2012				2004-2012			
OE Sensor: Jaguar - C2C25519, C2C40476, C2C40725, C2S40710, C2Z15016, C2Z15017, XR855949, XR855950							
Sensor: W/315 MHz Sensor.....	20090	71	8				
Sensor: W/433 MHz Sensor.....	20091	71	8				
Service Pack.....	20030	71	8				
2016-2017							
Service Pack.....	20050						
	20050V						

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007 F-Supersedes the 20066 S-Interchanges with 20016 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Jeep (cont'd)				Jeep (cont'd)			
Commander (cont'd)				Compass (cont'd)			
2008-2010				2016-2017			
OE Sensor: Chrysler - 56029359AA, 56029359AB				OE Sensor: Chrysler - 56029479AB			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28308 F	11.5	1.3
Sensor.....	28434 E	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor.				Grand Cherokee			
Does not include stem.....	20013 S	58	6.5	2002-2004			
Service Pack; Fits Schrader Sensor; Includes				OE Sensor: Chrysler - 52088990AC			
Stem Only.....	20020	58	6.5	EZ-Sensor.....	33200 A	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
2011					33700	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Compass				Sensor.....	20028 B	64	7
2007-2010				Service Pack.....	20003 F	64	7
OE Sensor: Chrysler - 68001696AA, 68001696AB					20007 V	64	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	2005-2007			
	33700	11.5	1.3	OE Sensor: Chrysler - 56053030AB, 68001696AA			
EZ-Sensor; Caution: Ez-sensor will not support				EZ-Sensor.....	33500 A, DB	11.5	1.3
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor; Caution: Ez-sensor will not support			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
Sensor.....	28308 F	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Fits Schrader Alum stem sensor.				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Does not include stem.....	20013 S	58	6.5	Sensor.....	28308 F	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes				Service Pack; Fits Schrader Alum stem sensor.			
Stem Only.....	20020	58	6.5	Does not include stem.....	20013 S	58	6.5
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes			
Service Pack; W/Siemens Sensor.....	20030	71	8	Stem Only.....	20020	58	6.5
2011				Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
OE Sensor: Chrysler - 68001696AB				Service Pack; W/Siemens Sensor.....	20030	71	8
EZ-Sensor.....	33500 A, DB	11.5	1.3	2008-2010			
	33700	11.5	1.3	OE Sensor: Chrysler - 56029359AB			
EZ-Sensor; Caution: Ez-sensor will not support				EZ-Sensor.....	33200 A	11.5	1.3
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28308 F	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor.				Sensor.....	28434 E	11.5	1.3
Does not include stem.....	20013 S	58	6.5	Service Pack; Fits Schrader Alum stem sensor.			
Service Pack; Fits Schrader Sensor; Includes				Does not include stem.....	20013 S	58	6.5
Stem Only.....	20020	58	6.5	Service Pack; Fits Schrader Sensor; Includes			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Stem Only.....	20020	58	6.5
2012-2015				Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
OE Sensor: Chrysler - 56029481AB, 68001696AB				2011-2015			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Chrysler - 56029398AA, 56029398AB			
	33700	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support					33500 A, DB	11.5	1.3
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28308 F	11.5	1.3	Sensor.....	20398	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 F-Supercedes the 20066 F-Use until depleted, replaced by 20007 S-Interchanges with 20016 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Jeep (cont'd)				Jeep (cont'd)			
Grand Cherokee (cont'd)				Liberty (cont'd)			
2016-2018				2010-2012			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Chrysler - 56029465AB			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
Liberty				EZ-Sensor Service Pack; Aluminium Valve.....			
2002-2004				20018 C, T			
OE Sensor: Chrysler - 52088990AC				Sensor.....	28308 F	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
	33500 A, DB	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
	33700	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/Siemens Sensor.....	20030	71	8
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2007-2010			
Sensor.....	20028 B	64	7	OE Sensor: Chrysler - 68001696AA, 68001696AB			
Service Pack.....	20003 F	64	7	EZ-Sensor.....	33500 A, DB	11.5	1.3
	20007 V	64	7		33700	11.5	1.3
2005-2008				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....			
OE Sensor: Chrysler - 56053036AA, 68001696AB				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	28308 F	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28308 F	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	71	8
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5	2011-2012			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	OE Sensor: Chrysler - 68078861AA			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	71	8		33700	11.5	1.3
2009				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....			
OE Sensor: Chrysler - 56029359AB, 56029465AB				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor.....	28308 F	11.5	1.3
	33700	11.5	1.3	Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2013-2015			
Sensor; W/315 MHz Snap-in Sensor.....	28308 F	11.5	1.3	OE Sensor: Chrysler - 56029479AB, 56029481AB			
Sensor; W/433 MHz Clamp-in Sensor.....	28434 E	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem.....	20013 S	58	6.5		33700	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor; W/315 MHz.....	28308 F	11.5	1.3
				Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 F-Supercedes the 20066 F-Use until depleted, replaced by 20007 S-Interchanges with 20016 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Jeep (cont'd)				Jeep (cont'd)			
Patriot (cont'd)				Wrangler (cont'd)			
2016-2017				2011			
OE Sensor: Chrysler - 56029481AB				OE Sensor: Chrysler - 56029479AA			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor; W/315 MHz	28308 F	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28308 F	11.5	1.3
Renegade				2012			
2015-2016				Service Pack; Fits Schrader Alum stem sensor. Does not include stem			
OE Sensor: Chrysler - 68193586AC				20013 S	58	6.5	
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
	33700	11.5	1.3	Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2012			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	OE Sensor: Chrysler - 56029479AA			
Sensor	28586			EZ-Sensor	33500 A, DB	11.5	1.3
Service Pack	20043				33700	11.5	1.3
2017-2018				EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor	28308 F	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Wrangler				2013-2015			
2007-2008				OE Sensor: Chrysler - 56029398AB, 68241067AB			
OE Sensor: Chrysler - 56053036AA				EZ-Sensor	33200 A	11.5	1.3
EZ-Sensor	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor; Caution: Ez-sensor will not support (Wai) Wheel Arch Initiators	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20398	11.5	1.3
Sensor	28308 F	11.5	1.3	Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem	20013 S	58	6.5	2016-2018			
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	OE Sensor: Chrysler - 68241067AB			
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
Service Pack; W/Siemens Sensor	20030	71	8		33700	11.5	1.3
2009-2010				EZ-Sensor Service Pack; Aluminium Valve			
OE Sensor: Chrysler - 56029359AB					34000	62	7
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor	28983	35	4
	33700	11.5	1.3	Service Pack; Includes Valve	20036	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2010-2011			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor			
Sensor	28434 E	11.5	1.3		33500 A, DB	11.5	1.3
Service Pack; Fits Schrader Alum stem sensor. Does not include stem	20013 S	58	6.5		33700	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Kia				Amanti			
2007-2009				2007-2009			
OE Sensor: Kia - 529331FA00				OE Sensor: Kia - 529331FA00			
EZ-Sensor				EZ-Sensor			
				33500 A, DB			
				11.5			
				1.3			
				33700			
				11.5			
				1.3			
				34000			
				62			
				7			
				20018 C, T			
				11.5			
				1.3			
				28983			
				35			
				4			
				20036			
				35			
				4			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004
E-Supercedes the 28155 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 S-Interchanges with 20016 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Kia (cont'd)				Kia (cont'd)			
Borrego				Forte Koup			
2009-2011				2010-2013			
OE Sensor: Hyundai - 529332F000				OE Sensor: Hyundai - 529332M000; Kia - 529332M000			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	28849	35	4	Sensor.....	20092	31-40	3.5-4.5
Service Pack.....	20022	35	4	Service Pack.....	20050	31-40	3.5-4.5
					20050V	31-40	3.5-4.5
Cadenza				2014			
2014-2015				EZ-Sensor.....			
OE Sensor: Hyundai - 529332M550, 52933A5000; Kia - 529332M550					33500 ^{A, DB}	11.5	1.3
EZ-Sensor.....	33000 ^A	11.5	1.3		33700	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20092	31-40	3.5-4.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack.....	20050	31-40	3.5-4.5
Sensor.....	20092	31-40	3.5-4.5		20050V	31-40	3.5-4.5
Service Pack.....	20050	31-40	3.5-4.5	2015-2017			
	20050V	31-40	3.5-4.5	EZ-Sensor.....			
2016							
OE Sensor: Kia - 529332M550				EZ-Sensor Service Pack; Aluminium Valve.....			
Sensor.....	20092	31-40	3.5-4.5	EZ-Sensor Service Pack; Rubber Valve.....			
Service Pack.....	20050	31-40	3.5-4.5	20018 ^{C, T}			
	20050V	31-40	3.5-4.5	11.5 1.3			
Forte				Forte5			
2010-2013				2012-2013			
OE Sensor: Hyundai - 529332M000; Kia - 529332M000				OE Sensor: Hyundai - 529332M000			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	20092	31-40	3.5-4.5	Sensor.....	20092	31-40	3.5-4.5
Service Pack.....	20050	31-40	3.5-4.5	Service Pack.....	20050	31-40	3.5-4.5
	20050V	31-40	3.5-4.5		20050V	31-40	3.5-4.5
2014-2015				K900			
OE Sensor: Kia - 52933-3X205, 52933-A7000				2015			
Sensor.....	28070			EZ-Sensor.....			
2016-2017							
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	20018 ^{C, T}			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	11.5 1.3			
Service Pack.....	20052			Magentis			
2018				2008			
Service Pack.....	20052			OE Sensor: Hyundai - 52933-2G200			
				EZ-Sensor.....			
				33000 ^A			
				11.5 1.3			
				33500 ^{A, DB}			
				11.5 1.3			
				33700			
				11.5 1.3			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				34000			
				62 7			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 ^{C, T}			
				11.5 1.3			
				Sensor; Includes Transmitter Only.....			
				20086			
				31-40 3.5-4.5			
				Service Pack; Includes Valve.....			
				20036			
				31-40 3.5-4.5			
				2009			
				OE Sensor: Hyundai - 52933-2G200			
				Sensor; Includes Transmitter Only.....			
				20086			
				31-40 3.5-4.5			
				Service Pack; Includes Valve.....			
				20036			
				31-40 3.5-4.5			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Kia (cont'd)				Kia (cont'd)			
Magentis (cont'd)				Rio5			
2010				2007-2011			
OE Sensor: Hyundai - 52933-2G200				OE Sensor: Hyundai - 529332F000			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5		33700	11.5	1.3
Service Pack; Includes Valve	20036	31-40	3.5-4.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Optima				EZ-Sensor Service Pack; Rubber Valve			
2006-2010				Sensor			
OE Sensor: Hyundai - 529332G200				Service Pack	20022	35	4
EZ-Sensor	33000 A	11.5	1.3	2012			
	33500 A, DB	11.5	1.3	OE Sensor: Hyundai - 529332M000			
	33700	11.5	1.3	Sensor	20092	31-40	3.5-4.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack	20050	31-40	3.5-4.5
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		20050V	31-40	3.5-4.5
Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5	2015-2016			
Service Pack; Includes Valve	20036	31-40	3.5-4.5	Service Pack	20052		
2011-2015				Rondo			
OE Sensor: Kia - 52933-2M000, 529332M000				2007-2011			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: Hyundai - 529332G200			
	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20092	31-40	3.5-4.5	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack	20050	31-40	3.5-4.5	Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5
	20050V	31-40	3.5-4.5	Service Pack; Includes Valve	20036	31-40	3.5-4.5
2016-2018				Sedona			
EZ-Sensor	33500 A, DB	11.5	1.3	2006-2008			
	33700	11.5	1.3	OE Sensor: Hyundai - 529334D200			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor; Includes Transmitter Only	20085	31-40	3.5-4.5
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; Includes Valve	20036	31-40	3.5-4.5
Rio				2009-2012			
2007-2011				OE Sensor: Hyundai - 529332G200			
OE Sensor: Hyundai - 529332F000				EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor; Includes Transmitter Only	20086	31-40	3.5-4.5
Sensor	28849	35	4	Service Pack; Includes Valve	20036	31-40	3.5-4.5
Service Pack	20022	35	4	2013-2014			
2012-2016				EZ-Sensor			
Service Pack	20022	35	4		33500 A, DB	11.5	1.3
	20052				33700	11.5	1.3
2017				EZ-Sensor Service Pack; Aluminium Valve			
OE Sensor: Kia - 52933-3X200					34000	62	7
Sensor	20086	31-40	3.5-4.5	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack	20022	35	4	2015-2017			
	20050			OE Sensor: Kia - 52933-B2100			
	20050V			EZ-Sensor	33500 A, DB	11.5	1.3
	20052				33700	11.5	1.3
2018				EZ-Sensor Service Pack; Aluminium Valve			
Service Pack	20022	35	4		34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	20218	11.5	1.3
				Service Pack; Rubber Valve	20046	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Kia (cont'd)				Kia (cont'd)			
Sedona (cont'd)				Soul			
2018				2010-2013			
OE Sensor: Kia - 52933-B2100				OE Sensor: Kia - 529332M000, 529332M001			
Sensor.....	20218	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
Service Pack; Rubber Valve.....	20046	11.5	1.3		33500 ^{A, DB}	11.5	1.3
Sorento					33700	11.5	1.3
2005-2006				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
	33700	11.5	1.3	Sensor.....	20092	31-40	3.5-4.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20050	31-40	3.5-4.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3		20050V	31-40	3.5-4.5
2007-2009				2014			
OE Sensor: Kia - 529331FA00				OE Sensor: Kia - 52933-B2100			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	28983	35	4	Sensor.....	20218	11.5	1.3
Service Pack; Includes Valve.....	20036	35	4	Service Pack.....	20046	11.5	1.3
2010				2015-2016			
OE Sensor: Kia - 52933-B2100				OE Sensor: Kia - 52933-B2100			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
2011-2014				2017-2018			
OE Sensor: Kia - 529332M000; Original Equipment Manufacturer - 529332M00				OE Sensor: Kia - 52933-B2100			
EZ-Sensor.....	33000 ^A	11.5	1.3	Sensor.....	20218	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	Service Pack; Rubber Valve.....	20046	11.5	1.3
	33700	11.5	1.3	Soul EV			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2017			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	OE Sensor: Kia - 52933-B2100			
Sensor.....	20092	31-40	3.5-4.5	Sensor.....	20218	11.5	1.3
Service Pack.....	20050	31-40	3.5-4.5	Service Pack; Rubber Valve.....	20046	11.5	1.3
	20050V	31-40	3.5-4.5	Spectra			
2015				2006			
OE Sensor: Kia - 52933-2M550				OE Sensor: Hyundai - 529332F000			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	Sensor.....	28849	35	4
	33700	11.5	1.3	Service Pack.....	20022	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2007-2009			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	OE Sensor: Hyundai - 529332F000			
Sensor.....	20092	31-40	3.5-4.5	EZ-Sensor.....	33000 ^A	11.5	1.3
Service Pack.....	20050	31-40	3.5-4.5		33500 ^{A, DB}	11.5	1.3
	20050V	31-40	3.5-4.5		33700	11.5	1.3
2016-2017				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
	33700	11.5	1.3	Sensor.....	28849	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20022	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	2010-2011			
Service Pack.....	20050	31-40	3.5-4.5	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
	20050V	31-40	3.5-4.5		33700	11.5	1.3
2018				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Kia (cont'd)				Kia (cont'd)			
Spectra5				Sportage (cont'd)			
2006				2017-2018			
OE Sensor: Hyundai - 529332F000				EZ-Sensor.....	33500 A, DB	11.5	1.3
Sensor.....	28849	35	4		33700	11.5	1.3
Service Pack.....	20022	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2007-2009				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
OE Sensor: Hyundai - 529332F000				Sensor.....	28849	35	4
EZ-Sensor.....	33000 A	11.5	1.3	Service Pack.....	20022	35	4
	33500 A, DB	11.5	1.3				
	33700	11.5	1.3	Lamborghini			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Aventador			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2011-2016			
Sensor.....	28849	35	4	OE Sensor: Volkswagen - 4F0 907 275			
Service Pack.....	20022	35	4	Sensor; Includes Transmitter Only.....	20078	35	4
Sportage				Service Pack; Does Not Include Valve.....	20023	35	4
2005				Service Pack; W/43mm Silver Insert.....	20037	35	4
OE Sensor: Hyundai - 529331FA00				Service Pack; W/48mm Green Insert.....	20038	35	4
Sensor; Jun. 15, 2005 & Newer.....	28983	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; Jun. 15, 2005 & Newer; Includes				Service Pack; W/51mm Orange Insert.....	20040	35	4
Valve.....	20036	31-40	3.5-4.5	2017			
2006-2008				OE Sensor: Volkswagen - 4F0 907 275, 7-PP-907-275F			
OE Sensor: Hyundai - 529331FA00; Kia - 529331FA00				Sensor.....	20103		
Sensor.....	28983	35	4	Sensor; Includes Transmitter Only.....	20078	35	4
Service Pack; Includes Valve.....	20036	31-40	3.5-4.5	Service Pack; Does Not Include Valve.....	20023	35	4
2009-2012				Service Pack; W/43mm Silver Insert.....	20037	35	4
OE Sensor: Kia - 529332F000				Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor.....	33000 A	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
	33500 A, DB	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	35	4
	33700	11.5	1.3	Huracan			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2017			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Volkswagen - 7-PP-907-275F			
Sensor.....	28849	35	4	Sensor.....	20103		
Service Pack.....	20022	35	4	Service Pack; Does Not Include Valve.....	20023	35	4
2013				Service Pack; W/43mm Silver Insert.....	20037	35	4
OE Sensor: Kia - 529332F000				Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
	33700	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Land Rover			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Discovery			
Sensor.....	28849	35	4	2014-2016			
Service Pack.....	20022	35	4	Service Pack.....	20050		
2014-2015					20050V		
OE Sensor: Hyundai - 529332S500				Discovery Sport			
EZ-Sensor.....	33500 A, DB	11.5	1.3	2015-2017			
	33700	11.5	1.3	Service Pack.....	20050		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20050V		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	LR2			
Sensor.....	28500			2008-2015			
2016				OE Sensor: Land Rover - LR021936, LR032833, LR066378			
EZ-Sensor.....	33500 A, DB	11.5	1.3	Sensor.....	20090	71	8
	33700	11.5	1.3	Service Pack.....	20030	71	8
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Service Pack.....	20052						

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Land Rover (cont'd)				Land Rover (cont'd)			
LR3				Range Rover			
2002-2004				2002			
OE Sensor: Land Rover - YBD000060				OE Sensor: Land Rover - YBD000061			
EZ-Sensor.....	33200 A	11.5	1.3	Sensor; Includes Transmitter Only.....	28082	58	6.5
	33500 A, DB	11.5	1.3	Service Pack.....	20050		
	33700	11.5	1.3		20050V		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Does Not Include Valve.....	20023	58	6.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	58	6.5
Sensor; Includes Transmitter Only.....	28082	58	6.5	Service Pack; W/48mm Green Insert.....	20038	58	6.5
Service Pack; Does Not Include Valve.....	20023	58	6.5	Service Pack; W/49mm Black Insert.....	20039	58	6.5
Service Pack; W/43mm Silver Insert.....	20037	58	6.5	Service Pack; W/51mm Orange Insert.....	20040	58	6.5
Service Pack; W/48mm Green Insert.....	20038	58	6.5				
Service Pack; W/49mm Black Insert.....	20039	58	6.5	2003-2005			
Service Pack; W/51mm Orange Insert.....	20040	58	6.5	OE Sensor: Land Rover - YBD000061			
2005				EZ-Sensor.....	33200 A	11.5	1.3
OE Sensor: Land Rover - YBD000060					33500 A, DB	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; Includes Transmitter Only.....	28082	58	6.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack.....	20050		
Sensor; Includes Transmitter Only.....	28082	58	6.5		20050V		
Service Pack.....	20050			Service Pack; Does Not Include Valve.....	20023	58	6.5
	20050V			Service Pack; W/43mm Silver Insert.....	20037	58	6.5
Service Pack; Does Not Include Valve.....	20023	58	6.5	Service Pack; W/48mm Green Insert.....	20038	58	6.5
Service Pack; W/43mm Silver Insert.....	20037	58	6.5	Service Pack; W/49mm Black Insert.....	20039	58	6.5
Service Pack; W/48mm Green Insert.....	20038	58	6.5	Service Pack; W/51mm Orange Insert.....	20040	58	6.5
Service Pack; W/49mm Black Insert.....	20039	58	6.5				
Service Pack; W/51mm Orange Insert.....	20040	58	6.5	2006-2009			
2006-2009				OE Sensor: Land Rover - LR010532, LR010533, LR018860, LR018861, LR0500461, RQH500471			
OE Sensor: Land Rover - LR010532, LR010533, LR018860, LR018861, LR0500461, RQH500471				Sensor; W/315 MHz Sensor.....	20090	71	8
Sensor; W/315 MHz Sensor.....	20090	71	8	Sensor; W/433 MHz Sensor.....	20091	71	8
Sensor; W/433 MHz Sensor.....	20091	71	8	Service Pack.....	20030	71	8
Service Pack.....	20030	71	8		20050		
	20050				20050V		
	20050V			2010-2011			
LR4				OE Sensor: Land Rover - LR018860, LR018861			
2010-2011				Sensor; W/315 MHz Sensor.....	20090	71	8
OE Sensor: Land Rover - LR018860, LR018861				Sensor; W/433 MHz Sensor.....	20091	71	8
Sensor; W/315 MHz Sensor.....	20090	71	8	Service Pack.....	20030	71	8
Sensor; W/433 MHz Sensor.....	20091	71	8	2012-2014			
Service Pack.....	20030	71	8	OE Sensor: Land Rover - LR0031713, LR021936			
2012-2014				Sensor.....	20090	71	8
OE Sensor: Land Rover - LR021936, LR032833				Service Pack.....	20030	71	8
Sensor.....	20090	71	8	2015-2017			
Service Pack.....	20030	71	8	Service Pack.....	20050		
					20050V		
				Range Rover Evoque			
				2012-2015			
				OE Sensor: Land Rover - LR0031713, LR021936			
				Sensor.....	20090	71	8
				Service Pack.....	20030	71	8
				2016-2017			
				Service Pack.....	20050		
					20050V		

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Land Rover (cont'd)				Lexus (cont'd)			
Range Rover Sport				ES300h			
2005				2013			
Service Pack.	20050			OE Sensor: Toyota - 4260733021			
	20050V			EZ-Sensor.	33000 A	11.5	1.3
2006-2009					33500 A, DB	11.5	1.3
OE Sensor: Land Rover - LR010532, LR010533, LR018860, LR018861, LR0500461, ROH500471					33700	11.5	1.3
Sensor; W/315 MHz Sensor.	20090	71	8	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Sensor; W/433 MHz Sensor.	20091	71	8	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Service Pack.	20030	71	8	Sensor.	28370	35	4
	20050			Service Pack.	20032	35	4
	20050V			2014-2018			
2010-2011				OE Sensor: Toyota - 4260730060, 4260733021			
OE Sensor: Land Rover - LR018860, LR018861				Sensor.	28370	35	4
Sensor; W/315 MHz Sensor.	20090	71	8	Service Pack.	20032	35	4
Sensor; W/433 MHz Sensor.	20091	71	8	ES350			
Service Pack.	20030	71	8	2007-2012			
2012-2014				OE Sensor: Toyota - 4260733021			
OE Sensor: Land Rover - LR021936, LR031713				EZ-Sensor.	33000 A	11.5	1.3
Sensor.	20090	71	8		33500 A, DB	11.5	1.3
Service Pack.	20030	71	8		33700	11.5	1.3
2015-2017				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Service Pack.	20050			EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
	20050V			Sensor.	28370	35	4
				Service Pack.	20032	35	4
Lexus				2013-2017			
CT200h				OE Sensor: Toyota - 4260730060, 4260733021			
2011				EZ-Sensor.	33500 A, DB	11.5	1.3
OE Sensor: Toyota - 4260733021					33700	11.5	1.3
EZ-Sensor.	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.	28370	35	4
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Service Pack.	20032	35	4
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	GS F			
Sensor.	28370	35	4	2016			
Service Pack.	20032	35	4	OE Sensor: Toyota - 4260733021			
2012-2015				EZ-Sensor.	33500 A, DB	11.5	1.3
OE Sensor: Toyota - 4260733021					33700	11.5	1.3
EZ-Sensor.	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.	28370	35	4
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Service Pack.	20032	35	4
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	2017-2018			
Sensor.	28370	35	4	OE Sensor: Toyota - 4260733021			
Service Pack.	20032	35	4	Sensor.	28370	35	4
2016-2017				Service Pack.	20032	35	4
OE Sensor: Toyota - 4260733021				GS200t			
Sensor.	28370	35	4	2016			
Service Pack.	20032	35	4	OE Sensor: Toyota - 4260730060			
				EZ-Sensor.	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
				Sensor.	28370	35	4
				Service Pack.	20032	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Lexus (cont'd)				Lexus (cont'd)			
GS200t (cont'd)				GS430			
2017				2005			
OE Sensor: Toyota - 4260730060				OE Sensor: Toyota - 4260730030			
Sensor.....	28370	35	4	EZ-Sensor.....	33000 A	11.5	1.3
Service Pack.....	20032	35	4		33500 A, DB	11.5	1.3
GS300							
2006							
OE Sensor: Toyota - 4260730030							
EZ-Sensor.....	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3		34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28335	35	4
Sensor.....	28335	35	4	Service Pack.....	20031	35	4
Service Pack.....	20031	35	4	2006			
2007-2011				OE Sensor: Toyota - 4260730030, 4260733021			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28335	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20031	35	4	Sensor; Jul. & Newer.....	28370	35	4
GS350				Sensor; Jun. & Older.....			
2007-2011				Service Pack; Jul. & Newer.....			
OE Sensor: Toyota - 4260733021				Service Pack; Jun. & Older.....			
EZ-Sensor.....	33000 A	11.5	1.3	2007			
	33500 A, DB	11.5	1.3	OE Sensor: Toyota - 4260733021			
	33700	11.5	1.3	EZ-Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....	28370	35	4		33700	11.5	1.3
Service Pack.....	20032	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2013				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Toyota - 42607-30060				Sensor.....			
EZ-Sensor.....	33200 A	11.5	1.3	Service Pack.....			
EZ-Sensor; For use with 433 MHz sensor				GS450h			
42607-30070.....	33500 A, DB	11.5	1.3	2007-2011			
	33700	11.5	1.3	OE Sensor: Toyota - 4260733021			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33000 A	11.5	1.3
Sensor; 315 MHz.....	28370	35	4		33500 A, DB	11.5	1.3
Service Pack.....	20032	62	7		33700	11.5	1.3
2014-2017				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Toyota - 42607-30060, 4260730060				EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor; For use with 433 MHz sensor				Sensor.....			
42607-30070.....	33500 A, DB	11.5	1.3	Service Pack.....			
	33700	11.5	1.3	2013-2014			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Toyota - 4260730060, 4260733021			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....			
Sensor; 315 MHz.....	28370	35	4	Service Pack.....			
Service Pack.....	20032	35	4	2015			
2016-2017				OE Sensor: Toyota - 4260730600			
OE Sensor: Toyota - 42607-30060, 4260730060				EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor; For use with 433 MHz sensor				Sensor.....			
42607-30070.....	33500 A, DB	11.5	1.3	Service Pack.....			
	33700	11.5	1.3	2016-2017			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Toyota - 4260730600			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....			
Sensor; 315 MHz.....	28370	35	4	Service Pack.....			
Service Pack.....	20032	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Lexus (cont'd)				Lexus (cont'd)			
GS460				GX470 (cont'd)			
2008-2011				2006			
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 4260730030, 4260733011, 4260735010			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28370	35	4	Sensor; Feb. & Newer; W/O Valve Cap.....	28335	35	4
Service Pack.....	20032	35	4	Sensor; Feb. & Newer; W/Valve Cap.....	28365	35	4
2012-2016				Sensor; Jan. 31 & Older.....			
OE Sensor: Toyota - 4260730600, 4260733021				Service Pack; Feb. & Newer.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; Jan. 31 & Older.....	20031	35	4
	33700	11.5	1.3	2007-2009			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Toyota - 4260733021			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....			
Sensor.....	28370	35	4	33000 A			
Service Pack.....	20032	35	4	33500 A, DB			
2016				33700			
EZ-Sensor.....				34000			
33000 A				34000			
11.5				62			
1.3				7			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 C, T			
				11.5			
				1.3			
				Sensor.....			
				28370			
				35			
				4			
				Service Pack.....			
				20032			
				35			
				4			
GX460				HS250h			
2010-2015				2010-2012			
OE Sensor: Toyota - 4260733021, 4260733022				OE Sensor: Toyota - 4260775010			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28370	35	4	Sensor.....	28345	35	4
Service Pack.....	20032	35	4	Service Pack.....	20032	35	4
2016-2017				IS F			
OE Sensor: Toyota - 4260733022				2008-2013			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Toyota - 4260733021			
	33700	11.5	1.3	EZ-Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33000 A			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	33500 A, DB			
Sensor.....	28370	35	4	33700			
Service Pack.....	20032	35	4	34000			
2018				EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor.....				EZ-Sensor Service Pack; Rubber Valve.....			
33500 A, DB				20018 C, T			
11.5				11.5			
1.3				1.3			
33700				28370			
11.5				35			
34000				4			
62				7			
7				Service Pack.....			
EZ-Sensor Service Pack; Aluminium Valve.....				20032			
EZ-Sensor Service Pack; Rubber Valve.....				35			
20018 C, T				4			
11.5							
1.3				2014-2016			
				OE Sensor: Toyota - 4260733021			
				Sensor.....			
				28370			
				35			
				4			
				Service Pack.....			
				20032			
				35			
				4			
GX470				IS200t			
2004-2005				2016			
OE Sensor: Toyota - 4260735010				OE Sensor: Toyota - 4260730600			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28345	35	4
Sensor.....	28345	35	4	Service Pack.....	20031	35	4
Service Pack.....	20031	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Lexus (cont'd)				Lexus (cont'd)			
IS200t (cont'd)				IS350			
2017				2006			
OE Sensor: Toyota - 4260730600				OE Sensor: Toyota - 4260730030, 4260733021			
Sensor.....	28370	35	4	EZ-Sensor.....	33000 A	11.5	1.3
Service Pack.....	20032	35	4		33500 A, DB	11.5	1.3
IS250							
2006							
OE Sensor: Toyota - 4260730030, 4260733021				EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor.....	33000 A	11.5	1.3		34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor; Apr. 1 & Newer.....	28370	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; Mar. & Older.....	28335	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Apr. 1 & Newer.....	20032	35	4
Sensor; Apr. 1 & Newer.....	28370	35	4	Service Pack; Mar. & Older.....	20031	35	4
Sensor; Mar. & Older.....	28335	35	4	2007-2012			
Service Pack; Apr. 1 & Newer.....	20032	35	4	OE Sensor: Toyota - 4260733021			
Service Pack; Mar. & Older.....	20031	35	4	EZ-Sensor.....	33000 A	11.5	1.3
2007							
OE Sensor: Toyota - 4260733021							
EZ-Sensor.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; C; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28370	35	4
EZ-Sensor Service Pack; exc C; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack.....	20032	35	4
Sensor.....	28370	35	4	2013-2017			
Service Pack.....	20032	35	4	OE Sensor: Toyota - 4260733021			
2008-2012							
OE Sensor: Toyota - 4260733021				EZ-Sensor.....			
EZ-Sensor.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28370	35	4
Sensor.....	28370	35	4	Service Pack.....	20032	35	4
Service Pack.....	20032	35	4	2018			
2013-2016							
OE Sensor: Toyota - 4260730060, 4260733021				OE Sensor: Toyota - 4260733021			
Sensor.....	28370	35	4	Sensor.....	28370	35	4
Service Pack.....	20032	35	4	Service Pack.....	20032	35	4
IS300				LFA			
2016				2012			
OE Sensor: Toyota - 4260730600				OE Sensor: Toyota - 4260733021			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28370	35	4	Sensor.....	28370	35	4
Service Pack.....	20032	35	4	Service Pack.....	20032	35	4
2017-2018				2013-2015			
OE Sensor: Toyota - 4260730600				EZ-Sensor.....			
Sensor.....	28370	35	4		33500 A, DB	11.5	1.3
Service Pack.....	20032	35	4		33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....			
				EZ-Sensor Service Pack; Rubber Valve.....			
				2016			
				OE Sensor: Toyota - 4260733021			
				EZ-Sensor.....			
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor.....	28370	35	4
				Service Pack.....	20032	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Lexus (cont'd)				Lexus (cont'd)			
LS430				LX470 (cont'd)			
2004-2006				2007			
Sensor	INDIRECT ^D			OE Sensor: Toyota - 4260733021			
LS460				EZ-Sensor	33000 ^A	11.5	1.3
2007-2016					33500 ^{A, DB}	11.5	1.3
OE Sensor: Toyota - 4260733021					33700	11.5	1.3
EZ-Sensor	33000 ^A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 ^{C, T}	11.5	1.3
	33700	11.5	1.3	Sensor	28370	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack	20032	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 ^{C, T}	11.5	1.3	LX570			
Sensor	28370	35	4	2008-2011			
Service Pack	20032	35	4	OE Sensor: Toyota - 4260733021			
2017				EZ-Sensor	33000 ^A	11.5	1.3
OE Sensor: Toyota - 4260733021					33500 ^{A, DB}	11.5	1.3
EZ-Sensor	33500 ^{A, DB}	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 ^{C, T}	11.5	1.3	Sensor	28370	35	4
Sensor	28370	35	4	Service Pack	20032	35	4
Service Pack	20032	35	4	2013-2014			
LS600h				OE Sensor: Toyota - 4260733021			
2008-2012				EZ-Sensor	33000 ^A	11.5	1.3
OE Sensor: Toyota - 4260733021					33500 ^{A, DB}	11.5	1.3
EZ-Sensor	33000 ^A	11.5	1.3		33700	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor	28370	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 ^{C, T}	11.5	1.3	Service Pack	20032	35	4
Sensor	28370	35	4	2015			
Service Pack	20032	35	4	EZ-Sensor	33000 ^A	11.5	1.3
2013-2016					33500 ^{A, DB}	11.5	1.3
OE Sensor: Toyota - 4260730600, 4260733021					33700	11.5	1.3
Sensor	28370	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack	20032	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 ^{C, T}	11.5	1.3
LX470				2016			
2005				OE Sensor: Toyota - 4260733021			
OE Sensor: Toyota - 4260733011				EZ-Sensor	33500 ^{A, DB}	11.5	1.3
EZ-Sensor	33000 ^A	11.5	1.3		33700	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor	28370	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 ^{C, T}	11.5	1.3	Service Pack	20032	35	4
Sensor	28365	35	4	2017			
Service Pack	20031	35	4	EZ-Sensor	33500 ^{A, DB}	11.5	1.3
2006					33700	11.5	1.3
OE Sensor: Toyota - 4260733011, 4260733021				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor	33000 ^A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 ^{C, T}	11.5	1.3
	33500 ^{A, DB}	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 ^{C, T}	11.5	1.3				
Sensor; Aug. & Newer	28370	35	4				
Sensor; Jul. & Older	28365	35	4				
Service Pack; Aug. & Newer	20032	35	4				
Service Pack; Jul. & Older	20031	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Lexus (cont'd)				Lexus (cont'd)			
NX200t				RX330 (cont'd)			
2015-2017				2006			
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 4260733021			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33700	11.5	1.3		33500 ^{A, DB}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28370	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Service Pack.....	20032	35	4	Sensor; Models made in Japan; Feb. & Newer....	28370	35	4
				Service Pack; Feb. & Newer.....	20032	35	4
				Service Pack; Jan. 31 & Older.....	20031	35	4
NX300				RX350			
2018				2007-2010			
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 4260733021			
Sensor.....	28370	35	4	EZ-Sensor.....	33000 ^A	11.5	1.3
Service Pack.....	20032	35	4		33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Sensor; Models made in Japan.....	28370	35	4
				Service Pack.....	20032	35	4
NX300h				2011-2012			
2016-2018				2007-2010			
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 426070E011, 4260733021			
Sensor.....	28370	35	4	EZ-Sensor.....	33000 ^A	11.5	1.3
Service Pack.....	20032	35	4		33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Sensor.....	28370	35	4
				Service Pack.....	20032	35	4
RC F				2013			
2015-2017				2007-2010			
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 426070E011			
Sensor.....	28370	35	4	EZ-Sensor; exc F Sport.....	33000 ^A	11.5	1.3
Service Pack.....	20032	35	4		33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; exc F Sport; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; exc F Sport; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Sensor; exc F Sport.....	28370	35	4
				Service Pack; exc F Sport.....	20032	35	4
RC200t				2014-2015			
2016-2017				2007-2010			
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 4260733011, 4260733021			
Sensor.....	28370	35	4	EZ-Sensor; exc F Sport.....	33000 ^A	11.5	1.3
Service Pack.....	20032	35	4		33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; exc F Sport; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; exc F Sport; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Sensor; F Sport; Vehicle Made for Canada.....	28370	35	4
				Service Pack.....	20032	35	4
RC300							
2016-2017							
OE Sensor: Toyota - 4260733021							
Sensor.....	28370	35	4				
Service Pack.....	20032	35	4				
RC350							
2016-2017							
OE Sensor: Toyota - 4260733021							
Sensor.....	28370	35	4				
Service Pack.....	20032	35	4				
RX330							
2004-2005							
Sensor.....	INDIRECT ^D						

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Lexus (cont'd)				Lexus (cont'd)			
RX350 (cont'd)				SC430 (cont'd)			
2016-2017				2006			
OE Sensor: Toyota - 4260733021				OE Sensor: Toyota - 4260724010, 4260724020, 4260724030, 4260724040, 4260733021			
EZ-Sensor; exc F Sport	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; exc F Sport; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; exc F Sport; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor; F Sport; Vehicle Made for Canada	28370	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack	20032	35	4	Sensor; Aug. & Newer	28370	27	3
				Sensor; W/Blue I.D. Mark; Jul. & Older	28315	27	3
				Sensor; W/Gold I.D. Mark; Jul. & Older	28325	27	3
				Sensor; W/Red I.D. Mark; Jul. & Older	28320	27	3
				Sensor; W/White I.D. Mark; Jul. & Older	28310	27	3
				Service Pack; Aug. & Newer	20032	27	3
RX400h				2007-2010			
2006				OE Sensor: Toyota - 4260733021			
OE Sensor: Toyota - 4260733021				EZ-Sensor	33000 A	11.5	1.3
Sensor	28370	35	4		33500 A, DB	11.5	1.3
Service Pack	20032	35	4		33700	11.5	1.3
2007-2008				EZ-Sensor Service Pack; Aluminium Valve			
OE Sensor: Toyota - 4260733021					34000	62	7
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor; Models made in Japan	28370	35	4
	33700	11.5	1.3	Service Pack	20032	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2009-2012			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
Sensor; Models made in Japan	28370	35	4		33700	11.5	1.3
Service Pack	20032	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
RX450h				Lincoln			
2010-2013				Aviator			
OE Sensor: Toyota - 4260733021				2003-2005			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: Ford Motor Company - 4L2Z 1A150 BA			
	33500 A, DB	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	28370	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack	20032	35	4	Sensor	20096 B	44	5
				Service Pack	20002 E	44	5
2014-2016					20004 P	44	5
OE Sensor: Toyota - 4260733011, 4260733021				Continental			
Sensor	28370	35	4	2017			
Service Pack	20032	35	4	OE Sensor: Ford Motor Company - F2GT-1A180-AB			
				EZ-Sensor	33500 A, DB	11.5	1.3
SC430					33700	11.5	1.3
2002-2005				EZ-Sensor Service Pack; Aluminium Valve			
OE Sensor: Toyota - 4260724010, 4260724020, 4260724030, 4260724040					34000	62	7
Sensor; W/Blue I.D. Mark	28315	27	3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor; W/Gold I.D. Mark	28325	27	3	Sensor	20280	11.5	1.3
Sensor; W/Red I.D. Mark	28320	27	3	Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor; W/White I.D. Mark	28310	27	3	Cuv			
				2014-2016			
				OE Sensor: Ford Motor Company - DE8T1A180AA			
				EZ-Sensor	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	20315	11.5	1.3
				Service Pack; Rubber Valve	20018 C, T	11.5	1.3

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Lincoln (cont'd)				Lincoln (cont'd)			
Cuv (cont'd)				MKC (cont'd)			
2017				2018			
OE Sensor: Ford Motor Company - DE8T1A180AA				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
EZ-Sensor.....	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	20315	11.5	1.3				
Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3				
Mark LT				MKS			
2007-2008				2009-2010			
OE Sensor: Ford Motor Company - 6F2Z1A189A				OE Sensor: Ford Motor Company - 7L1Z1A189A			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	28385	27	3	Sensor.....	28390	27	3
Sensor Clip.....	22100			Sensor Clip.....	22100		
Sensor Cradle.....	22101			Sensor Cradle.....	22101		
Universal Band.....	22102			Universal Band.....	22102		
2013-2014				2011-2015			
OE Sensor: Ford Motor Company - DE8T1A180AA				OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	20315	11.5	1.3	Sensor.....	20315	11.5	1.3
Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
2015-2016				2016			
OE Sensor: Ford Motor Company - F2GT-1A180-AB				OE Sensor: Ford Motor Company - DE8T-1A180-AA			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	20280	11.5	1.3	Sensor.....	20315	11.5	1.3
Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
MKC				2017			
2015				2010			
OE Sensor: Ford Motor Company - 9L3Z1A189A				OE Sensor: Ford Motor Company - DE8T-1A180-AA			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	20315	11.5	1.3	Sensor.....	20315	11.5	1.3
Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
2016-2017				MKT			
2010				2010			
OE Sensor: Ford Motor Company - 9L3Z1A189A				OE Sensor: Ford Motor Company - 7L1Z1A189A			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33700	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	28390	27	3	Sensor.....	28390	27	3
Sensor Clip.....	22100			Sensor Clip.....	22100		
Sensor Cradle.....	22101			Sensor Cradle.....	22101		
Universal Band.....	22102			Universal Band.....	22102		

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Lincoln (cont'd)				Lincoln (cont'd)			
MKT (cont'd)				MKX (cont'd)			
2011-2016				2015-2017			
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-10A-180-AA, DE8T-1A180-AA, DE8T1A180AA				OE Sensor: Ford Motor Company - F2GT-1A180-AB			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20280	11.5	1.3
Sensor	20315	11.5	1.3	Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; Rubber Valve	20018 C, T	11.5	1.3				
2017-2018				MKZ			
OE Sensor: Ford Motor Company - DE8T-10A-180-AA				2007-2009			
EZ-Sensor	33500 A, DB	11.5	1.3	OE Sensor: Ford Motor Company - 6F2Z1A189A			
	33700	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor	20315	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	28385	27	3
				Sensor Clip	22100		
				Sensor Cradle	22101		
				Universal Band	22102		
MKX				2010-2015			
2007-2008				OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, CM5T-1A180-AA, DE8T-1A180-AA, DE8T1A180AA			
OE Sensor: Ford Motor Company - 6F2Z1A189A, 7L1Z1A189A				EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor; W/Chrome Plated Almm. Wheels	28385	27	3
Sensor; W/Chrome Plated Almm. Wheels	28385	27	3	Sensor; W/O Chrome Plated Almm. Wheels	28390	27	3
Sensor; W/O Chrome Plated Almm. Wheels	28390	27	3	Sensor Clip	22100		
Sensor Clip	22100			Sensor Cradle	22101		
Sensor Cradle	22101			Universal Band	22102		
Universal Band	22102						
2009-2010				2016			
OE Sensor: Ford Motor Company - 7L1Z1A189A				OE Sensor: Ford Motor Company - DE8T1A180AA			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20315	11.5	1.3
Sensor	28390	27	3	Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor Clip	22100						
Sensor Cradle	22101			2017-2018			
Universal Band	22102			EZ-Sensor	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
2011-2014				Navigator			
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA				2003-2004			
EZ-Sensor	33000 A	11.5	1.3	OE Sensor: Ford Motor Company - 4L2Z 1A150 BA			
	33500 A, DB	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	20315	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20096 B	44	5
				Service Pack	20002 E	44	5
					20004 P	44	5

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Lincoln (cont'd)				Lincoln (cont'd)			
Navigator (cont'd)				Town Car (cont'd)			
2005-2006				2011			
OE Sensor: Ford Motor Company - 5L1Z 1A150 AA				OE Sensor: Ford Motor Company - 9L3Z1A189A			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20135 B	44	5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20002 E	44	5	Sensor.....	20315	11.5	1.3
	20004 P	44	5	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2007-2010				Zephyr			
OE Sensor: Ford Motor Company - 7L1Z1A189A				2006			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Ford Motor Company - 6F2Z1A189A			
	33500 A, DB	11.5	1.3	EZ-Sensor.....			
	33700	11.5	1.3	33000 A			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33500 A, DB			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	33700			
Sensor.....	28390	27	3	34000			
Sensor Clip.....	22100			EZ-Sensor Service Pack; Aluminium Valve.....			
Sensor Cradle.....	22101			EZ-Sensor Service Pack; Rubber Valve.....			
Universal Band.....	22102			Sensor.....			
2011-2015				Sensor Clip.....			
OE Sensor: Ford Motor Company - 9L3Z1A189A, CM5T 1A180 AA, DE8T-1A180-AA, DE8T1A180AA				Sensor Cradle.....			
EZ-Sensor.....	33000 A	11.5	1.3	Universal Band.....			
	33500 A, DB	11.5	1.3	22102			
	33700	11.5	1.3	Lotus			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Elise			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2008-2015			
Sensor.....	20315	11.5	1.3	OE Sensor: Original Equipment Manufacturer - 12825085, 13227143			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....			
2016-2017				33500 A, DB			
OE Sensor: Ford Motor Company - DE8T1A180AA				33700			
EZ-Sensor.....	33500 A, DB	11.5	1.3	34000			
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....			
Sensor.....	20315	11.5	1.3	Service Pack.....			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	20009 R			
2018				2016			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....			
	33700	11.5	1.3	33500 A, DB			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33700			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	34000			
Sensor.....	20315	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
2018				20018 C, T			
EZ-Sensor.....	33500 A, DB	11.5	1.3	11.5			
	33700	11.5	1.3	1.3			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	1.3			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	1.3			
Town Car				Evora			
2006-2010				2010-2013			
OE Sensor: Ford Motor Company - 6F2Z1A189A				OE Sensor: Original Equipment Manufacturer - 12825085, 13227143			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....			
	33500 A, DB	11.5	1.3	33500 A, DB			
	33700	11.5	1.3	33700			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	34000			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
Sensor.....	28385	27	3	EZ-Sensor Service Pack; Rubber Valve.....			
Sensor Clip.....	22100			Sensor.....			
Sensor Cradle.....	22101			Service Pack.....			
Universal Band.....	22102			20009 R			
2016-2017				2014			
OE Sensor: Ford Motor Company - DE8T1A180AA				EZ-Sensor.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3	33500 A, DB			
	33700	11.5	1.3	33700			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	34000			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
Sensor.....	28385	27	3	EZ-Sensor Service Pack; Rubber Valve.....			
Sensor Clip.....	22100			Sensor.....			
Sensor Cradle.....	22101			Service Pack.....			
Universal Band.....	22102			20009 R			

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 P-Interchanges with 20002 R-Interchanges with 20005, 20010 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Lotus (cont'd)				Maserati (cont'd)			
Evora (cont'd)				GranTurismo			
2015				2014			
OE Sensor: Original Equipment Manufacturer - 12825085				OE Sensor: Original Equipment Manufacturer - 282189			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	20159	88	10	Sensor; Does Not Include Valve	20078	35	4
Service Pack	20009 R	88	10	Service Pack; W/43mm Silver Insert	20037	35	4
2016-2017				2015			
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack; W/48mm Green Insert	20038	35	4
	33700	11.5	1.3	Service Pack; W/49mm Black Insert	20039	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/51mm Orange Insert	20040	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2015			
Exige				OE Sensor: Original Equipment Manufacturer - 282189			
2008-2015				EZ-Sensor			
OE Sensor: Original Equipment Manufacturer - 12825085, 13227143				33500 A, DB			
EZ-Sensor	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20159	88	10
Sensor	20159	88	10	Service Pack	20009 R	88	10
Service Pack	20009 R	88	10	2016			
2016				OE Sensor: Original Equipment Manufacturer - 282189			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Maserati				Quattroporte			
Coupe				2004-2008			
2004-2006				OE Sensor: Chrysler - 185189			
Service Pack; Does Not Include Valve	20023	35	4	EZ-Sensor	33200 A	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	35	4		33500 A, DB	11.5	1.3
Service Pack; W/48mm Green Insert	20038	35	4		33700	11.5	1.3
Service Pack; W/49mm Black Insert	20039	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; W/51mm Orange Insert	20040	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Ghibli				Sensor; Includes Transmitter Only			
2014-2016				20077			
OE Sensor: Original Equipment Manufacturer - 670002790				Service Pack; Does Not Include Valve			
EZ-Sensor	33500 A, DB	11.5	1.3		20023	35	4
	33700	11.5	1.3	Service Pack; W/43mm Silver Insert	20037	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/48mm Green Insert	20038	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; W/49mm Black Insert	20039	35	4
Sensor	20284	71	8	Service Pack; W/51mm Orange Insert	20040	35	4
Service Pack	20047 O	71	8	2014-2016			
	20049 U	71	8	OE Sensor: Original Equipment Manufacturer - 670002790			
Maserati				EZ-Sensor			
2004-2006				33500 A, DB			
Service Pack; Does Not Include Valve				33700			
Service Pack; W/43mm Silver Insert				33700			
Service Pack; W/48mm Green Insert				34000			
Service Pack; W/49mm Black Insert				20018 C, T			
Service Pack; W/51mm Orange Insert				20077			
Service Pack; Does Not Include Valve				20023			
Service Pack; W/43mm Silver Insert				20037			
Service Pack; W/48mm Green Insert				20038			
Service Pack; W/49mm Black Insert				20039			
Service Pack; W/51mm Orange Insert				20040			
Service Pack				20047 O			
Service Pack				20049 U			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 O-Use until depleted, replaced by 20049
R-Interchanges with 20005, 20010 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Maserati (cont'd)				Mazda (cont'd)			
Spyder				3			
2004-2006				2004			
Service Pack; Does Not Include Valve.	20023	35	4	OE Sensor: Mazda - GN3A37140B			
Service Pack; W/43mm Silver Insert.	20037	35	4	Sensor.	20093	71	8
Service Pack; W/48mm Green Insert.	20038	35	4	Service Pack.	20050	71	8
Service Pack; W/49mm Black Insert.	20039	35	4		20050V	71	8
Service Pack; W/51mm Orange Insert.	20040	35	4	2005-2012			
Maybach				OE Sensor: Mazda - GN3A37140B			
57,62				EZ-Sensor.			
2002-2011				33500 A, DB			
OE Sensor: Volkswagen - 4D0907275D					33700	11.5	1.3
EZ-Sensor.	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Sensor; Includes Transmitter Only.	20079	35	4
Sensor; Includes Transmitter Only.	20079	35	4	Service Pack; Does Not Include Valve.	20023	35	4
Service Pack; Does Not Include Valve.	20023	35	4	Service Pack; W/43mm Silver Insert.	20037	35	4
Service Pack; W/43mm Silver Insert.	20037	35	4	Service Pack; W/48mm Green Insert.	20038	35	4
Service Pack; W/48mm Green Insert.	20038	35	4	Service Pack; W/49mm Black Insert.	20039	35	4
Service Pack; W/49mm Black Insert.	20039	35	4	Service Pack; W/51mm Orange Insert.	20040	35	4
Service Pack; W/51mm Orange Insert.	20040	35	4	2003-2011			
2003-2011				EZ-Sensor.			
2012				33000 A			
OE Sensor: Volkswagen - 4D0907275D							
EZ-Sensor.	33500 A, DB	11.5	1.3	2006-2010			
	33700	11.5	1.3	OE Sensor: Mazda - GN3A37140B			
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor.	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor; Includes Transmitter Only.	20079	35	4	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Service Pack; Does Not Include Valve.	20023	35	4	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Service Pack; W/43mm Silver Insert.	20037	35	4	Sensor.	20093	71	8
Service Pack; W/48mm Green Insert.	20038	35	4	Service Pack.	20050	71	8
Service Pack; W/49mm Black Insert.	20039	35	4		20050V	71	8
Service Pack; W/51mm Orange Insert.	20040	35	4	2011			
Mazda				EZ-Sensor.			
2				33500 A, DB			
2011-2013				11.5			
OE Sensor: Mazda - BBM237140B, GN3A37140B					33700	11.5	1.3
EZ-Sensor.	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Sensor.	20093	71	8
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Service Pack.	20050	71	8
Sensor.	20093	71	8		20050V	71	8
Service Pack.	20050	71	8	2012-2013			
	20050V	71	8	OE Sensor: Mazda - BBM2-37-140B, GN3A37140B			
2014-2015				EZ-Sensor.	33500 A, DB	11.5	1.3
EZ-Sensor.	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mazda (cont'd)				Mazda (cont'd)			
6				CX-3			
2005-2007				2016-2018			
EZ-Sensor	33500 A, DB	11.5	1.3	Sensor	INDIRECT ^D		
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	CX-5			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2013-2016			
2008-2013				Sensor			
OE Sensor: Mazda - BBM2-37-140B, GN3A37140B				INDIRECT ^D			
EZ-Sensor	33500 A, DB	11.5	1.3	2017			
	33700	11.5	1.3	OE Sensor: Mazda - BH4A-37-140			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack			
Sensor	20093	71	8	20093			
Service Pack	20050	71	8	20050			
	20050V	71	8	20050V			
2014-2017				CX-7			
Sensor	INDIRECT ^D			2007-2011			
B2300				OE Sensor: Mazda - GN3A37140B			
2007-2009				EZ-Sensor			
OE Sensor: Ford Motor Company - 6F2Z1A189A; Mazda - 6F2Z1A189A				33500 A, DB			
EZ-Sensor	33000 A	11.5	1.3	11.5			
	33500 A, DB	11.5	1.3	11.5			
	33700	11.5	1.3	33700			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	20018 C, T			
Sensor	28385	27	3	Sensor			
Sensor Clip	22100			20093			
Sensor Cradle	22101			20050			
Universal Band	22102			20050V			
B3000				2012			
2007-2008				EZ-Sensor			
OE Sensor: Mazda - 6F2Z1A189A				33500 A, DB			
EZ-Sensor	33000 A	11.5	1.3	11.5			
	33500 A, DB	11.5	1.3	11.5			
	33700	11.5	1.3	33700			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	20018 C, T			
Sensor	28385	27	3	Sensor			
Sensor Clip	22100			20093			
Sensor Cradle	22101			20050			
Universal Band	22102			20050V			
B4000				2014-2015			
2007-2009				EZ-Sensor			
OE Sensor: Ford Motor Company - ZZDA-37-140; Mazda - 6F2Z1A189A				33500 A, DB			
EZ-Sensor	33000 A	11.5	1.3	11.5			
	33500 A, DB	11.5	1.3	11.5			
	33700	11.5	1.3	33700			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	20018 C, T			
Sensor	28385	27	3	Sensor			
Sensor Clip	22100			20093			
Sensor Cradle	22101			20050			
Universal Band	22102			20050V			
B4000				2016			
2007-2009				EZ-Sensor			
OE Sensor: Ford Motor Company - ZZDA-37-140; Mazda - 6F2Z1A189A				33500 A, DB			
EZ-Sensor	33000 A	11.5	1.3	11.5			
	33500 A, DB	11.5	1.3	11.5			
	33700	11.5	1.3	33700			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	20018 C, T			
Sensor	28385	27	3	Sensor			
Sensor Clip	22100			20093			
Sensor Cradle	22101			20050			
Universal Band	22102			20050V			
B4000				2017			
2007-2009				Sensor			
OE Sensor: Ford Motor Company - ZZDA-37-140; Mazda - 6F2Z1A189A				INDIRECT ^D			
EZ-Sensor	33000 A	11.5	1.3	INDIRECT ^D			
	33500 A, DB	11.5	1.3	INDIRECT ^D			
	33700	11.5	1.3	INDIRECT ^D			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	INDIRECT ^D			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	INDIRECT ^D			
Sensor	28385	27	3	INDIRECT ^D			
Sensor Clip	22100			INDIRECT ^D			
Sensor Cradle	22101			INDIRECT ^D			
Universal Band	22102			INDIRECT ^D			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mazda (cont'd)				Mazda (cont'd)			
MX-5 Miata				Tribute (cont'd)			
2006-2015				2009-2011			
OE Sensor: Mazda - GN3A37140B, GS1D37140				OE Sensor: Mazda - ZZDA37140			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20093	71	8	Sensor.....	20315	11.5	1.3
Service Pack.....	20050	71	8	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	20050V	71	8				
2016-2017				Mercedes-Benz			
Sensor.....	INDIRECT ^D			550,63AMG			
RX-8				2006			
2004				EZ-Sensor.....			
OE Sensor: Mazda - GN3A37140B				33500 A, DB			
Sensor.....	20093	71	8		33700	11.5	1.3
Service Pack.....	20050	71	8	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	20050V	71	8	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2005-2011				2007-2009			
OE Sensor: Mazda - GN3A37140B				OE Sensor: Mercedes-Benz - 0025409017			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20093	71	8	Sensor.....	28214	58	6.5
Service Pack.....	20050	71	8	Service Pack; Does Not Include Stem.....	20013 ^S	58	6.5
	20050V	71	8		20016 ^M	58	6.5
Tribute				Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
2006				20020			
OE Sensor: Mazda - ZZC137140				58			
EZ-Sensor.....	33000 A	11.5	1.3	6.5			
	33500 A, DB	11.5	1.3	AMG GT			
	33700	11.5	1.3	2017			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	33500 A, DB			
Sensor.....	28385	27	3	33700			
Sensor Clip.....	22100			34000			
Sensor Cradle.....	22101			EZ-Sensor Service Pack; Aluminium Valve.....			
Universal Band.....	22102			20018 C, T			
2008				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Mazda - ZZC137140				20018 C, T			
EZ-Sensor.....	33000 A	11.5	1.3	11.5			
	33500 A, DB	11.5	1.3	1.3			
	33700	11.5	1.3	62			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	7			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
Sensor.....	28385	27	3	20018 C, T			
Sensor Clip.....	22100			11.5			
Sensor Cradle.....	22101			1.3			
Universal Band.....	22102			20013			
2009				80			
OE Sensor: Mazda - ZZC137140				9			
EZ-Sensor.....	33000 A	11.5	1.3	20049 ^U			
	33500 A, DB	11.5	1.3	80			
	33700	11.5	1.3	9			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2015-2016			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Mercedes-Benz - A0009050030			
Sensor.....	28385	27	3	EZ-Sensor.....			
Sensor Clip.....	22100			33200 A			
Sensor Cradle.....	22101			11.5			
Universal Band.....	22102			1.3			
2010				33700			
OE Sensor: Mazda - ZZC137140				11.5			
EZ-Sensor.....	33000 A	11.5	1.3	34000			
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
	33700	11.5	1.3	20018 C, T			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	11.5			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	1.3			
Sensor.....	28385	27	3	20213			
Sensor Clip.....	22100			80			
Sensor Cradle.....	22101			9			
Universal Band.....	22102			20049 ^U			
2011				80			
OE Sensor: Mazda - ZZC137140				9			
EZ-Sensor.....	33000 A	11.5	1.3	B200			
	33500 A, DB	11.5	1.3	2014			
	33700	11.5	1.3	OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	20213			
Sensor.....	28385	27	3	80			
Sensor Clip.....	22100			9			
Sensor Cradle.....	22101			20049 ^U			
Universal Band.....	22102			80			
2012				9			
OE Sensor: Mazda - ZZC137140				2015			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....			
	33500 A, DB	11.5	1.3	33200 A			
	33700	11.5	1.3	11.5			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	1.3			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	33700			
Sensor.....	28385	27	3	11.5			
Sensor Clip.....	22100			34000			
Sensor Cradle.....	22101			EZ-Sensor Service Pack; Rubber Valve.....			
Universal Band.....	22102			20018 C, T			
2013				11.5			
OE Sensor: Mazda - ZZC137140				1.3			
EZ-Sensor.....	33000 A	11.5	1.3	20213			
	33500 A, DB	11.5	1.3	80			
	33700	11.5	1.3	9			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	20049 ^U			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	80			
Sensor.....	28385	27	3	9			
Sensor Clip.....	22100						
Sensor Cradle.....	22101						
Universal Band.....	22102						

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
M-Use until depleted, replaced by 20013 S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
B200 (cont'd)				C Series (cont'd)			
2017-2018				2001-2006			
OE Sensor: Mercedes-Benz - A0009050030				EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor; Programmable Sensor. Programming tool required.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor.....	20213	80	9	EZ-Sensor Service Pack; Aluminium valve.....	34000	62	7
Service Pack.....	20049 U	80	9	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
B250				2007			
2015				2007			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - 0025406817, 0025409017			
Sensor.....	20213	80	9	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack.....	20049 U	80	9		33700	11.5	1.3
2016				2007			
OE Sensor: Mercedes-Benz - A0009050030				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor.....	20094	53	6
	33700	11.5	1.3	Sensor; Jun. & Newer.....	28214	58	6.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Includes Valve.....	20036	53	6
Sensor.....	20213	80	9	Service Pack; Jun. & Newer; Does Not Include Stem.....	20013 S	58	6.5
Service Pack.....	20049 U	80	9		20016 M	58	6.5
2017-2018				2008-2009			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - 0025406817, 0025407917, 0025409017			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20213	80	9	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20049 U	80	9	Sensor.....	20094	53	6
B250e				2010-2012			
2016-2018				2010-2012			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - 0009054100, 0035400217			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20213	80	9	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20049 U	80	9	Sensor.....	28214	58	6.5
C Series				2010-2012			
2000				2010-2012			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Mercedes-Benz - 0009054100, 0035400217			
	33700	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor; Programmable Sensor. Programming tool required.....	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	20018 C, T	11.5	1.3	Sensor.....	28214	58	6.5
				Service Pack; Does Not Include Stem.....	20013 S	58	6.5
					20016 M	58	6.5
				Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
				Service Pack; Includes Valve.....	20036	53	6

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
CL (cont'd)				CLA45 AMG (cont'd)			
2008-2009				2017-2018			
OE Sensor: Mercedes-Benz - 0025407917				OE Sensor: Mercedes-Benz - A0009050030			
Sensor	20094	53	6	EZ-Sensor	33500 A, DB	11.5	1.3
Service Pack; Includes Valve	20036	53	6		33700	11.5	1.3
2010-2012				EZ-Sensor Service Pack; Aluminium Valve			
EZ-Sensor	33000 A	11.5	1.3		34000	62	7
	33200 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor	20213	80	9
	33700	11.5	1.3	Service Pack	20049 U	80	9
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	CLK			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2006			
2013-2015				OE Sensor: Mercedes-Benz - 0025409017			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
2016-2017				Sensor			
EZ-Sensor	33500 A, DB	11.5	1.3		28214	58	6.5
	33700	11.5	1.3	Service Pack; Does Not Include Stem	20013 S	58	6.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		20016 M	58	6.5
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
CLA250				2007-2009			
2014-2016				EZ-Sensor			
OE Sensor: Mercedes-Benz - A0009050030					33500 A, DB	11.5	1.3
EZ-Sensor	33200 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	CLK350			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2006-2009			
Sensor	20213	80	9	OE Sensor: Mercedes-Benz - 0025409017			
Service Pack	20049 U	80	9	EZ-Sensor	33200 A	11.5	1.3
2017-2018					33500 A, DB	11.5	1.3
OE Sensor: Mercedes-Benz - A0009050030					33700	11.5	1.3
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor	28214	58	6.5
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; Does Not Include Stem	20013 S	58	6.5
Sensor	20213	80	9		20016 M	58	6.5
Service Pack	20049 U	80	9	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
CLA45 AMG				CLS			
2014-2016				2006			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - 0025407917			
EZ-Sensor	33200 A	11.5	1.3	Sensor	20094	53	6
	33500 A, DB	11.5	1.3	Service Pack; Includes Valve	20036	53	6
	33700	11.5	1.3	CLS550			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2007-2011			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	OE Sensor: Mercedes-Benz - 0025407917			
Sensor	20213	80	9	Sensor	20094	53	6
Service Pack	20049 U	80	9	Service Pack; Includes Valve	20036	53	6

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
CLS550 (cont'd)				E250			
2012				2014-2016			
OE Sensor: Mercedes-Benz - 0009054100				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28214	58	6.5	Sensor.....	20213	80	9
Service Pack; Does Not Include Stem.....	20013 S	58	6.5	Service Pack.....	20049 U	80	9
	20016 M	58	6.5	2017			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	OE Sensor: Mercedes-Benz - A0009050030			
2013				Sensor.....			
OE Sensor: Mercedes-Benz - 0009057200				Service Pack.....			
EZ-Sensor.....	33200 A	11.5	1.3	20213 80 9			
	33500 A, DB	11.5	1.3	20049 U 80 9			
	33700	11.5	1.3	E320			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2001-2005			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Does Not Include Valve.....			
Sensor.....	28214	58	6.5	20023 35 4			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; W/43mm Silver Insert.....			
Service Pack; W/O Valve.....	20013 S	58	6.5	20037 35 4			
	20016 M	58	6.5	Service Pack; W/48mm Green Insert.....			
2014-2016				20038 35 4			
OE Sensor: Mercedes-Benz - A0009050030				Service Pack; W/49mm Black Insert.....			
EZ-Sensor.....	33200 A	11.5	1.3	20039 35 4			
	33500 A, DB	11.5	1.3	Service Pack; W/51mm Orange Insert.....			
	33700	11.5	1.3	20040 35 4			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2006-2009			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Mercedes-Benz - 0025406817, 0025407917			
Sensor.....	20213	80	9	Sensor.....			
Service Pack.....	20049 U	80	9	20094 53 6			
2017				Service Pack; Includes Valve.....			
OE Sensor: Mercedes-Benz - A0009052102				20036 53 6			
Sensor.....	28238			E350			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2006-2009			
CLS63 AMG S				OE Sensor: Mercedes-Benz - 0025406817, 0025407917, 0025408017			
2014-2016				Sensor; W/315 MHz Sensor.....			
OE Sensor: Mercedes-Benz - A0009050030				20094 53 6			
EZ-Sensor.....	33200 A	11.5	1.3	Sensor; W/433 MHz Sensor.....			
	33500 A, DB	11.5	1.3	20095 53 6			
	33700	11.5	1.3	Service Pack; Includes Valve.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	20036 53 6			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2010-2012			
Sensor.....	20213	80	9	OE Sensor: Mercedes-Benz - 0009054100, 0035400217			
Service Pack.....	20049 U	80	9	EZ-Sensor.....			
2017				33200 A 11.5 1.3			
OE Sensor: Mercedes-Benz - A0009052102				33500 A, DB 11.5 1.3			
EZ-Sensor.....	33500 A, DB	11.5	1.3	33700 11.5 1.3			
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	34000 62 7			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
Sensor.....	20213	80	9	20018 C, T 11.5 1.3			
Service Pack.....	20049 U	80	9	Sensor.....			
2013				28214 58 6.5			
OE Sensor: Mercedes-Benz - 0009057200				Service Pack; Does Not Include Stem.....			
EZ-Sensor.....	33200 A	11.5	1.3	20013 S 58 6.5			
	33500 A, DB	11.5	1.3	20016 M 58 6.5			
	33700	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	20020 58 6.5			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2013			
Sensor.....	20213	80	9	OE Sensor: Mercedes-Benz - 0009057200			
Service Pack.....	20049 U	80	9	EZ-Sensor.....			
2017				33200 A 11.5 1.3			
OE Sensor: Mercedes-Benz - A0009052102				33500 A, DB 11.5 1.3			
EZ-Sensor.....	33500 A, DB	11.5	1.3	33700 11.5 1.3			
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	34000 62 7			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
Sensor.....	28238			20018 C, T 11.5 1.3			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....			
				28214 58 6.5			
				Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
				20020 58 6.5			
				Service Pack; W/O Valve.....			
				20013 S 58 6.5			
				20016 M 58 6.5			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
E350 (cont'd)				E55 AMG			
2014-2016				1999			
OE Sensor: Mercedes-Benz - A0009050030				Service Pack; Does Not Include Valve; Jul. & Newer.	20023	35	4
EZ-Sensor.	33200 A	11.5	1.3	Service Pack; W/43mm Silver Insert.	20037	35	4
	33500 A, DB	11.5	1.3	Service Pack; W/48mm Green Insert; Jul. & Newer.	20038	35	4
	33700	11.5	1.3	Service Pack; W/49mm Black Insert; Jul. & Newer.	20039	35	4
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Service Pack; W/51mm Orange Insert; Jul. & Newer.	20040	35	4
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3				
Sensor.	20213	80	9	2000-2005			
Service Pack.	20049 U	80	9	Service Pack; Does Not Include Valve.	20023	35	4
2017				Service Pack; W/43mm Silver Insert.	20037	35	4
OE Sensor: Mercedes-Benz - A0009050030				Service Pack; W/48mm Green Insert.	20038	35	4
Sensor.	20213	80	9	Service Pack; W/49mm Black Insert.	20039	35	4
Service Pack.	20049 U	80	9	Service Pack; W/51mm Orange Insert.	20040	35	4
				2006			
E400				OE Sensor: Mercedes-Benz - 0025406817			
2010-2013				Sensor.	20094	53	6
EZ-Sensor.	33500 A, DB	11.5	1.3	Service Pack; Includes Valve.	20036	53	6
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	E550			
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	2007-2009			
2014-2016				OE Sensor: Mercedes-Benz - 0025407917, 0025408017			
OE Sensor: Mercedes-Benz - A0009050030				Sensor; W/315 MHz Sensor.	20094	53	6
EZ-Sensor.	33200 A	11.5	1.3	Sensor; W/433 MHz Sensor.	20095	53	6
	33500 A, DB	11.5	1.3	Service Pack; Includes Valve.	20036	53	6
	33700	11.5	1.3	2010-2011			
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	OE Sensor: Mercedes-Benz - 0009054100, 0035400217			
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor.	33200 A	11.5	1.3
Sensor.	20213	80	9		33500 A, DB	11.5	1.3
Service Pack.	20049 U	80	9		33700	11.5	1.3
2017				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
OE Sensor: Mercedes-Benz - A0009050030				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Sensor.	20213	80	9	Sensor.	28214	58	6.5
Service Pack.	20049 U	80	9	Service Pack; Does Not Include Stem.	20013 S	58	6.5
					20016 M	58	6.5
E430				Service Pack; Fits Schrader Sensor; Includes Stem Only.	20020	58	6.5
2001-2002				2012-2013			
Service Pack; Does Not Include Valve.	20023	35	4	OE Sensor: Mercedes-Benz - 0009054100, 0009057200			
Service Pack; W/43mm Silver Insert.	20037	35	4	EZ-Sensor.	33200 A	11.5	1.3
Service Pack; W/48mm Green Insert.	20038	35	4		33500 A, DB	11.5	1.3
Service Pack; W/49mm Black Insert.	20039	35	4		33700	11.5	1.3
Service Pack; W/51mm Orange Insert.	20040	35	4	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
E500				Sensor.	28214	58	6.5
2003-2005				Service Pack; Fits Schrader Sensor; Includes Stem Only.	20020	58	6.5
Service Pack; Does Not Include Valve.	20023	35	4	Service Pack; W/O Valve.	20013 S	58	6.5
Service Pack; W/43mm Silver Insert.	20037	35	4		20016 M	58	6.5
Service Pack; W/48mm Green Insert.	20038	35	4				
Service Pack; W/49mm Black Insert.	20039	35	4				
Service Pack; W/51mm Orange Insert.	20040	35	4				
2006							
OE Sensor: Mercedes-Benz - 0025406817							
Sensor.	20094	53	6				
Service Pack; Includes Valve.	20036	53	6				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
E550 (cont'd)				E63 AMG (cont'd)			
2014-2016				2017			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20213	80	9
Sensor.....	20213	80	9	Service Pack.....	20049 U	80	9
Service Pack.....	20049 U	80	9	E63 AMG S			
2017				2010-2013			
OE Sensor: Mercedes-Benz - A0009050030				EZ-Sensor.....			
Sensor.....	20213	80	9		33500 A, DB	11.5	1.3
Service Pack.....	20049 U	80	9		33700	11.5	1.3
E63 AMG				EZ-Sensor Service Pack; Aluminium Valve.....			
2007-2009				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Mercedes-Benz - 0025406817, 0025407917				2014-2016			
Sensor.....	20094	53	6	OE Sensor: Mercedes-Benz - A0009050030			
Service Pack; Includes Valve.....	20036	53	6	EZ-Sensor.....			
2010-2011				33200 A			
OE Sensor: Mercedes-Benz - 0009054100, 0035400217				11.5			
EZ-Sensor.....	33200 A	11.5	1.3	11.5			
	33500 A, DB	11.5	1.3	11.5			
	33700	11.5	1.3	62			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	7			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	11.5			
Sensor.....	28214	58	6.5	80			
Service Pack; Does Not Include Stem.....	20013 S	58	6.5	9			
	20016 M	58	6.5	80			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	9			
2012-2013				20049 U			
OE Sensor: Mercedes-Benz - 0009054100, 0009057200				G500			
EZ-Sensor.....	33200 A	11.5	1.3	2007			
	33500 A, DB	11.5	1.3	OE Sensor: Mercedes-Benz - 0025408617			
	33700	11.5	1.3	EZ-Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33200 A			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	11.5			
Sensor.....	28214	58	6.5	11.5			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	11.5			
Service Pack; W/O Valve.....	20013 S	58	6.5	62			
	20016 M	58	6.5	7			
2014-2016				11.5			
OE Sensor: Mercedes-Benz - A0009050030				11.5			
EZ-Sensor.....	33200 A	11.5	1.3	11.5			
	33500 A, DB	11.5	1.3	11.5			
	33700	11.5	1.3	62			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	7			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	11.5			
Sensor.....	20213	80	9	58			
Service Pack.....	20049 U	80	9	6.5			
				Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
				20020			
				58			
				6.5			
				Service Pack; Mar. & Newer; Does Not Include Stem.....			
				20013 S			
				58			
				6.5			
				20016 M			
				58			
				6.5			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013 S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
G500 (cont'd)				G550			
2008				2009-2010			
OE Sensor: Mercedes-Benz - 0025409017				OE Sensor: Mercedes-Benz - 0025409017			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	28214	58	6.5	Sensor	28214	58	6.5
Service Pack; Does Not Include Stem	20013 S	58	6.5	Service Pack; Does Not Include Stem	20013 S	58	6.5
	20016 M	58	6.5		20016 M	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
G55 AMG				2011			
2007				OE Sensor: Mercedes-Benz - 0025409017			
OE Sensor: Mercedes-Benz - 0025408617				EZ-Sensor			
EZ-Sensor	33200 A	11.5	1.3		33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor; Mar. & Newer	28214	58	6.5	Sensor	28214	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
Service Pack; Mar. & Newer; Does Not Include Stem	20013 S	58	6.5	Service Pack; Mar. & Newer; Does Not Include Stem	20013 S	58	6.5
	20016 M	58	6.5		20016 M	58	6.5
2008-2010				2012-2013			
OE Sensor: Mercedes-Benz - 0025409017				OE Sensor: Mercedes-Benz - 0009057200, 0025409017			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	28214	58	6.5	Sensor	28214	58	6.5
Service Pack; Does Not Include Stem	20013 S	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
	20016 M	58	6.5	Service Pack; W/O Valve	20013 S	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5		20016 M	58	6.5
2011				2014-2016			
OE Sensor: Mercedes-Benz - 0025409017				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	28214	58	6.5	Sensor	20213	80	9
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack	20049 U	80	9
Service Pack; Mar. & Newer; Does Not Include Stem	20013 S	58	6.5	2017-2018			
	20016 M	58	6.5	OE Sensor: Mercedes-Benz - A0009050030			
				EZ-Sensor			
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	20213	80	9
				Service Pack	20049 U	80	9

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013 S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
G63 AMG				GL (cont'd)			
2014-2016				2012-2013			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - 0009054100, 0009057200			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	28214	58	6.5
Service Pack.....	20049 U	80	9	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
2017-2018				Service Pack; W/O Valve.....			
OE Sensor: Mercedes-Benz - A0009050030				20013 S			
EZ-Sensor.....	33500 A, DB	11.5	1.3	20016 M			
	33700	11.5	1.3	2014-2016			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....			
Sensor.....	20213	80	9	33200 A			
Service Pack.....	20049 U	80	9	33500 A, DB			
G65 AMG				33700			
2016-2018				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Mercedes-Benz - A0009050030				20018 C, T			
EZ-Sensor.....	33500 A, DB	11.5	1.3	Sensor.....			
	33700	11.5	1.3	20213			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	20049 U			
Sensor.....	20213	80	9	2017-2018			
Service Pack.....	20049 U	80	9	OE Sensor: Mercedes-Benz - A0009050030			
GL				EZ-Sensor.....			
2007-2009				33500 A, DB			
OE Sensor: Mercedes-Benz - 0025408017				33700			
Sensor.....	20095	53	6	EZ-Sensor Service Pack; Aluminium Valve.....			
Service Pack; Includes Valve.....	20036	53	6	20018 C, T			
2010				Sensor.....			
OE Sensor: Mercedes-Benz - 0035400217				20213			
EZ-Sensor.....	33200 A	11.5	1.3	Service Pack.....			
	33500 A, DB	11.5	1.3	20049 U			
	33700	11.5	1.3	GL320			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2007-2009			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Mercedes-Benz - 0025408017			
Sensor.....	28214	58	6.5	Sensor.....			
Service Pack; Does Not Include Stem.....	20013 S	58	6.5	20095			
	20016 M	58	6.5	Service Pack; Includes Valve.....			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	20036			
2011				GL350			
OE Sensor: Mercedes-Benz - 0009054100				2010			
EZ-Sensor.....	33200 A	11.5	1.3	OE Sensor: Mercedes-Benz - 0035400217			
	33500 A, DB	11.5	1.3	EZ-Sensor.....			
	33700	11.5	1.3	33200 A			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33500 A, DB			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	33700			
Sensor.....	28214	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	20018 C, T			
Service Pack; Mar. & Newer; Does Not Include Stem.....	20013 S	58	6.5	Sensor.....			
	20016 M	58	6.5	28214			
GL320				Service Pack; Does Not Include Stem.....			
2007-2009				20013 S			
OE Sensor: Mercedes-Benz - 0025408017				20016 M			
Sensor.....	20095	53	6	Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
Service Pack; Includes Valve.....	20036	53	6	20020			
GL350				2010			
OE Sensor: Mercedes-Benz - 0035400217				OE Sensor: Mercedes-Benz - 0035400217			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....			
	33500 A, DB	11.5	1.3	33200 A			
	33700	11.5	1.3	33500 A, DB			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33700			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
Sensor.....	28214	58	6.5	20018 C, T			
Service Pack; Does Not Include Stem.....	20013 S	58	6.5	Sensor.....			
	20016 M	58	6.5	28214			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Does Not Include Stem.....			
GL350				20013 S			
2010				20016 M			
OE Sensor: Mercedes-Benz - 0035400217				Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
EZ-Sensor.....	33200 A	11.5	1.3	20020			
	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Sensor.....	28214	58	6.5				
Service Pack; Does Not Include Stem.....	20013 S	58	6.5				
	20016 M	58	6.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
GL350 (cont'd)				GL63 AMG (cont'd)			
2011				2014-2016			
OE Sensor: Mercedes-Benz - 0009054100				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28214	58	6.5	Sensor.....	20213	80	9
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack.....	20049 U	80	9
Service Pack; Mar. & Newer; Does Not Include Stem.....	20013 S	58	6.5				
	20016 M	58	6.5	2017-2018			
				OE Sensor: Mercedes-Benz - A0009050030			
2012-2013				EZ-Sensor.....	33500 A, DB	11.5	1.3
OE Sensor: Mercedes-Benz - 0009054100, 0009057200					33700	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	20213	80	9
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20049 U	80	9
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Sensor.....	28214	58	6.5	GLA250			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	2015-2018			
Service Pack; W/O Valve.....	20013 S	58	6.5	OE Sensor: Mercedes-Benz - A0009050030			
	20016 M	58	6.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
					33700	11.5	1.3
2014-2015				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: Mercedes-Benz - A0009050030				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3	Sensor.....	20213	80	9
	33500 A, DB	11.5	1.3	Service Pack.....	20049 U	80	9
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	GLA45 AMG			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2015-2018			
Sensor.....	20213	80	9	OE Sensor: Mercedes-Benz - A0009050030			
Service Pack.....	20049 U	80	9	EZ-Sensor.....	33500 A, DB	11.5	1.3
					33700	11.5	1.3
2016-2018				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: Mercedes-Benz - A0009050030				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3	Sensor.....	20213	80	9
	33700	11.5	1.3	Service Pack.....	20049 U	80	9
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	GLC300			
Sensor.....	20213	80	9	2016-2018			
Service Pack.....	20049 U	80	9	OE Sensor: Mercedes-Benz - A0009050030			
				EZ-Sensor.....	33500 A, DB	11.5	1.3
GL63 AMG					33700	11.5	1.3
2013				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: Mercedes-Benz - 0009057200				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3	Sensor.....	20213	80	9
	33500 A, DB	11.5	1.3	Service Pack.....	20049 U	80	9
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	GLC43 AMG			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2017-2018			
Sensor.....	28214	58	6.5	OE Sensor: Mercedes-Benz - A0009050030			
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/O Valve.....	20013 S	58	6.5		33700	11.5	1.3
	20016 M	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor.....	20213	80	9
				Service Pack.....	20049 U	80	9

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
GLE300d				GLE550			
2016-2018				2016-2018			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	20213	80	9
Service Pack.....	20049 U	80	9	Service Pack.....	20049 U	80	9
GLE350				GLE550e			
2016-2018				2016-2018			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	20213	80	9
Service Pack.....	20049 U	80	9	Service Pack.....	20049 U	80	9
GLE350d				GLE63 AMG			
2016-2018				2016-2018			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	20213	80	9
Service Pack.....	20049 U	80	9	Service Pack.....	20049 U	80	9
GLE400				GLE63 AMG S			
2016-2018				2016-2018			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	20213	80	9
Service Pack.....	20049 U	80	9	Service Pack.....	20049 U	80	9
GLE43 AMG				GLK250			
2017-2018				2014-2016			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20213	80	9	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20049 U	80	9	Sensor.....	20213	80	9
				Service Pack.....	20049 U	80	9
GLE450 AMG							
2016-2018							
OE Sensor: Mercedes-Benz - A0009050030							
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	20213	80	9
Service Pack.....	20049 U	80	9	Service Pack.....	20049 U	80	9

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008
U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
GLK350				GLK350 (cont'd)			
2010				2017			
OE Sensor: Mercedes-Benz - 0035400217				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20213	80	9
Sensor	28214	58	6.5	Service Pack	20049 U	80	9
Service Pack; Does Not Include Stem	20013 S	58	6.5				
	20016 M	58	6.5				
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5				
2011				GLS350d			
OE Sensor: Mercedes-Benz - 0009054100				2017			
EZ-Sensor	33200 A	11.5	1.3	OE Sensor: Mercedes-Benz - A0009050030			
	33500 A, DB	11.5	1.3	EZ-Sensor			
	33700	11.5	1.3	33500 A, DB 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	33700 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
Sensor	28214	58	6.5	34000 62 7			
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	EZ-Sensor Service Pack; Rubber Valve			
Service Pack; Mar. & Newer; Does Not Include Stem	20013 S	58	6.5	20018 C, T 11.5 1.3			
	20016 M	58	6.5	Sensor			
				20213 80 9			
				Service Pack			
				20049 U 80 9			
2012				GLS450			
OE Sensor: Mercedes-Benz - 0009054100				2017			
EZ-Sensor	33200 A	11.5	1.3	OE Sensor: Mercedes-Benz - A0009050030			
	33500 A, DB	11.5	1.3	EZ-Sensor			
	33700	11.5	1.3	33500 A, DB 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	33700 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
Sensor	28214	58	6.5	34000 62 7			
Service Pack; Does Not Include Stem	20013 S	58	6.5	EZ-Sensor Service Pack; Rubber Valve			
	20016 M	58	6.5	20018 C, T 11.5 1.3			
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Sensor			
				20213 80 9			
				Service Pack			
				20049 U 80 9			
2013				Metris			
OE Sensor: Mercedes-Benz - 0009057200				2015-2017			
EZ-Sensor	33200 A	11.5	1.3	OE Sensor: Mercedes-Benz - A4479050500			
	33500 A, DB	11.5	1.3	EZ-Sensor			
	33700	11.5	1.3	33500 A, DB 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	33700 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
Sensor	28214	58	6.5	34000 62 7			
Service Pack; Does Not Include Stem	20013 S	58	6.5	EZ-Sensor Service Pack; Rubber Valve			
	20016 M	58	6.5	20018 C, T 11.5 1.3			
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Sensor			
				28239			
				Service Pack			
				20018 C, T			
2014-2016				ML250			
OE Sensor: Mercedes-Benz - A0009050030				2015-2018			
EZ-Sensor	33200 A	11.5	1.3	OE Sensor: Mercedes-Benz - A0009050030			
	33500 A, DB	11.5	1.3	EZ-Sensor			
	33700	11.5	1.3	33500 A, DB 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	33700 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
Sensor	28214	58	6.5	34000 62 7			
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	EZ-Sensor Service Pack; Rubber Valve			
Service Pack; W/O Valve	20013 S	58	6.5	20018 C, T 11.5 1.3			
	20016 M	58	6.5	Sensor			
				20213 80 9			
				Service Pack			
				20049 U 80 9			
2017				ML320			
OE Sensor: Mercedes-Benz - A0009050030				2007-2009			
EZ-Sensor	33200 A	11.5	1.3	OE Sensor: Mercedes-Benz - 0025406917, 0025408017			
	33500 A, DB	11.5	1.3	Sensor			
	33700	11.5	1.3	20095 53 6			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; Includes Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	20036 53 6			
Sensor	20213	80	9				
Service Pack	20049 U	80	9				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013 S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
ML350				ML350 (cont'd)			
2006-2009				2014			
OE Sensor: Mercedes-Benz - 0025406917, 0025408017				EZ-Sensor.....	33200 ^A	11.5	1.3
Sensor.....	20095	53	6		33500 ^{A, DB}	11.5	1.3
Service Pack; Includes Valve.....	20036	53	6		33700	11.5	1.3
2010				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Mercedes-Benz - 0035400217					34000	62	7
EZ-Sensor.....	33200 ^A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
	33500 ^{A, DB}	11.5	1.3		20018 ^{C, T}	11.5	1.3
	33700	11.5	1.3	2015			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Mercedes-Benz - 000 905 00 30			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor.....	33200 ^A	11.5	1.3
Sensor.....	28214	58	6.5		33500 ^{A, DB}	11.5	1.3
Service Pack; Does Not Include Stem.....	20013 ^S	58	6.5		33700	11.5	1.3
	20016 ^M	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....			
Service Pack; Fits Schrader Sensor; Includes					34000	62	7
Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Rubber Valve.....			
2011					20018 ^{C, T}	11.5	1.3
OE Sensor: Mercedes-Benz - 0009054100				Sensor.....			
EZ-Sensor.....	33200 ^A	11.5	1.3		20213	80	9
	33500 ^{A, DB}	11.5	1.3	Service Pack.....			
	33700	11.5	1.3		20049 ^U	80	9
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2016-2018			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	OE Sensor: Mercedes-Benz - A0009050030			
Sensor.....	28214	58	6.5	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes					33700	11.5	1.3
Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....			
Service Pack; Mar. & Newer; Does Not Include					34000	62	7
Stem.....	20013 ^S	58	6.5	EZ-Sensor Service Pack; Rubber Valve.....			
	20016 ^M	58	6.5		20018 ^{C, T}	11.5	1.3
2012				Sensor.....			
OE Sensor: Mercedes-Benz - 0009054100					20213	80	9
EZ-Sensor.....	33200 ^A	11.5	1.3	Service Pack.....			
	33500 ^{A, DB}	11.5	1.3		20049 ^U	80	9
	33700	11.5	1.3	ML400			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2015-2018			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	OE Sensor: Mercedes-Benz - A0009050030			
Sensor.....	28214	58	6.5	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
Service Pack; Does Not Include Stem.....	20013 ^S	58	6.5		33700	11.5	1.3
	20016 ^M	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....			
Service Pack; Fits Schrader Sensor; Includes					34000	62	7
Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Rubber Valve.....			
2013					20018 ^{C, T}	11.5	1.3
OE Sensor: Mercedes-Benz - 0009057200				Sensor.....			
EZ-Sensor.....	33200 ^A	11.5	1.3		20213	80	9
	33500 ^{A, DB}	11.5	1.3	Service Pack.....			
	33700	11.5	1.3		20049 ^U	80	9
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	ML450			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	2010			
Sensor.....	28214	58	6.5	OE Sensor: Mercedes-Benz - 0035400217			
Service Pack; Fits Schrader Sensor; Includes				EZ-Sensor.....	33200 ^A	11.5	1.3
Stem Only.....	20020	58	6.5		33500 ^{A, DB}	11.5	1.3
Service Pack; W/O Valve.....	20013 ^S	58	6.5		33700	11.5	1.3
	20016 ^M	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....			
					34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....			
					20018 ^{C, T}	11.5	1.3
				Sensor.....			
					28214	58	6.5
				Service Pack; Does Not Include Stem.....			
					20013 ^S	58	6.5
					20016 ^M	58	6.5
				Service Pack; Fits Schrader Sensor; Includes			
				Stem Only.....	20020	58	6.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
ML450 (cont'd)				ML550 (cont'd)			
2011				2015-2016			
OE Sensor: Mercedes-Benz - 0009054100				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	28214	58	6.5	Sensor	20213	80	9
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack	20049 U	80	9
Service Pack; Mar. & Newer; Does Not Include Stem	20013 S	58	6.5	2017-2018			
	20016 M	58	6.5	OE Sensor: Mercedes-Benz - A0009050030			
ML500				EZ-Sensor			
2006-2007				33500 A, DB			
OE Sensor: Mercedes-Benz - 0025406917				33700			
Sensor	20095	53	6	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Includes Valve	20036	53	6	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
ML550				Sensor			
2008-2009				20213			
OE Sensor: Mercedes-Benz - 0025406917, 0025408017				Service Pack			
Sensor	20095	53	6	20049 U			
Service Pack; Includes Valve	20036	53	6	ML63 AMG			
2010				2007-2009			
OE Sensor: Mercedes-Benz - 0035400217				OE Sensor: Mercedes-Benz - 0025406917, 0025408017			
EZ-Sensor	33200 A	11.5	1.3	Sensor	20095	53	6
	33500 A, DB	11.5	1.3	Service Pack; Includes Valve	20036	53	6
	33700	11.5	1.3	2010			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Mercedes-Benz - 0035400217			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor			
Sensor	28214	58	6.5	33200 A			
Service Pack; Does Not Include Stem	20013 S	58	6.5	33500 A, DB			
	20016 M	58	6.5	33700			
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	EZ-Sensor Service Pack; Aluminium Valve			
2011-2012				34000			
OE Sensor: Mercedes-Benz - 0009054100				EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor	33200 A	11.5	1.3	20018 C, T			
	33500 A, DB	11.5	1.3	Sensor			
	33700	11.5	1.3	28214			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; Does Not Include Stem			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	20013 S			
Sensor	28214	58	6.5	20016 M			
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only			
Service Pack; Mar. & Newer; Does Not Include Stem	20013 S	58	6.5	20020			
	20016 M	58	6.5	58 6.5			
2013-2014				2011			
EZ-Sensor				OE Sensor: Mercedes-Benz - 0009054100			
	33200 A	11.5	1.3	EZ-Sensor			
	33500 A, DB	11.5	1.3	33200 A			
	33700	11.5	1.3	33500 A, DB			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	33700			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
2015-2016				34000			
OE Sensor: Mercedes-Benz - 0009054100				EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor	33200 A	11.5	1.3	20018 C, T			
	33500 A, DB	11.5	1.3	Sensor			
	33700	11.5	1.3	28214			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; Fits Schrader Sensor; Includes Stem Only			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	20020			
Sensor	28214	58	6.5	58 6.5			
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack; Mar. & Newer; Does Not Include Stem			
Service Pack; Mar. & Newer; Does Not Include Stem	20013 S	58	6.5	20013 S			
	20016 M	58	6.5	20016 M			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013 S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
ML63 AMG (cont'd)				R350 (cont'd)			
2012-2013				2011			
OE Sensor: Mercedes-Benz - 0009054100, 0009057200				OE Sensor: Mercedes-Benz - 0009054100			
EZ-Sensor.....	33200 ^A	11.5	1.3	EZ-Sensor.....	33200 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	28214	58	6.5	Sensor.....	28214	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
Service Pack; W/O Valve.....	20013 ^S	58	6.5	Service Pack; Mar. & Newer; Does Not Include Stem.....	20013 ^S	58	6.5
	20016 ^M	58	6.5		20016 ^M	58	6.5
2014-2016				2012			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - 0009054100			
EZ-Sensor.....	33200 ^A	11.5	1.3	EZ-Sensor.....	33200 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	28214	58	6.5
Service Pack.....	20049 ^U	80	9	Service Pack; Does Not Include Stem.....	20013 ^S	58	6.5
2017-2018				2013			
OE Sensor: Mercedes-Benz - A0009050030				Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3		20020	58	6.5
	33700	11.5	1.3	2013			
	34000	62	7	OE Sensor: Mercedes-Benz - 0009057200			
EZ-Sensor Service Pack; Aluminium Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor.....	33200 ^A	11.5	1.3
Sensor.....	20213	80	9		33500 ^{A, DB}	11.5	1.3
Service Pack.....	20049 ^U	80	9		33700	11.5	1.3
R320				R500			
2007-2009				2006-2007			
OE Sensor: Mercedes-Benz - 0025406917, 0025408017				OE Sensor: Mercedes-Benz - 0025406917			
Sensor.....	20095	53	6	Sensor.....	20095	53	6
Service Pack; Includes Valve.....	20036	53	6	Service Pack; Includes Valve.....	20036	53	6
R350				R63 AMG			
2006-2009				2007			
OE Sensor: Mercedes-Benz - 0025406917, 0025408017				OE Sensor: Mercedes-Benz - 0025406917			
Sensor.....	20095	53	6	Sensor.....	20095	53	6
Service Pack; Includes Valve.....	20036	53	6	Service Pack; Includes Valve.....	20036	53	6
2010				S Series			
OE Sensor: Mercedes-Benz - 0035400217				2006			
EZ-Sensor.....	33200 ^A	11.5	1.3	Service Pack; Does Not Include Valve.....			
	33500 ^{A, DB}	11.5	1.3		20023	35	4
	33700	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
Sensor.....	28214	58	6.5	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; Does Not Include Stem.....	20013 ^S	58	6.5				
	20016 ^M	58	6.5				
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
S Series (cont'd)				S Series (cont'd)			
2010				2017-2018			
OE Sensor: Mercedes-Benz - 0025407917				OE Sensor: Mercedes-Benz - A0009050030			
Sensor	20094	53	6	EZ-Sensor	33500 A, DB	11.5	1.3
Service Pack; Includes Valve	20036	53	6		33700	11.5	1.3
2011				EZ-Sensor Service Pack; Aluminium Valve			
OE Sensor: Mercedes-Benz - 0009054100				EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor	33200 A	11.5	1.3	Sensor	20213	80	9
	33500 A, DB	11.5	1.3	Service Pack	20049 U	80	9
	33700	11.5	1.3	S430			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2000-2006			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor			
Sensor	28214	58	6.5		33000 A	11.5	1.3
Service Pack; Does Not Include Stem	20013 S	58	6.5		33200 A	11.5	1.3
	20016 M	58	6.5		33500 A, DB	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only				EZ-Sensor Service Pack; Aluminium Valve			
	20020	58	6.5	EZ-Sensor Service Pack; Rubber Valve			
2012				Service Pack; Does Not Include Valve			
OE Sensor: Mercedes-Benz - 0009054100				Service Pack; W/43mm Silver Insert			
EZ-Sensor	33200 A	11.5	1.3	Service Pack; W/48mm Green Insert			
	33500 A, DB	11.5	1.3	Service Pack; W/49mm Black Insert			
	33700	11.5	1.3	Service Pack; W/51mm Orange Insert			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	S500			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2000			
Sensor	28214	58	6.5	OE Sensor: Mercedes-Benz - 0008223406			
Service Pack; Fits Schrader Sensor; Includes Stem Only				EZ-Sensor			
	20020	58	6.5		33000 A	11.5	1.3
Service Pack; W/O Valve	20013 S	58	6.5		33500 A, DB	11.5	1.3
	20016 M	58	6.5		33700	11.5	1.3
2013				EZ-Sensor Service Pack; Aluminium Valve			
OE Sensor: Mercedes-Benz - 0009057200, A0009050030				EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor	33200 A	11.5	1.3	Sensor; Includes Transmitter Only			
	33500 A, DB	11.5	1.3	Service Pack; Does Not Include Valve			
	33700	11.5	1.3	Service Pack; W/43mm Silver Insert			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/48mm Green Insert			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; W/49mm Black Insert			
Sensor	20213	80	9	Service Pack; W/51mm Orange Insert			
	28214	58	6.5	2001			
	20049 U	80	9	OE Sensor: Mercedes-Benz - 0008223406			
Service Pack				EZ-Sensor			
Service Pack; Fits Schrader Sensor; Includes Stem Only					33000 A	11.5	1.3
	20020	58	6.5		33500 A, DB	11.5	1.3
Service Pack; W/O Valve	20013 S	58	6.5		33700	11.5	1.3
	20016 M	58	6.5	EZ-Sensor; Programmable sensor, Rubber Valve			
2014-2016					33500 A, DB	11.5	1.3
OE Sensor: Mercedes-Benz - A0009050030					33700	11.5	1.3
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve			
	33700	11.5	1.3	Sensor; Includes Transmitter Only			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; Does Not Include Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; W/43mm Silver Insert			
Sensor	20213	80	9	Service Pack; W/48mm Green Insert			
	28214	58	6.5	Service Pack; W/49mm Black Insert			
	20049 U	80	9	Service Pack; W/51mm Orange Insert			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
 S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
S500 (cont'd)				S550 (cont'd)			
2002-2006				2014-2016			
OE Sensor: Mercedes-Benz - 0008223406				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33200 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor; Includes Transmitter Only.....	20079	35	4	Sensor.....	20213	80	9
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack.....	20049 ^U	80	9
Service Pack; W/43mm Silver Insert.....	20037	35	4	2017-2018			
Service Pack; W/48mm Green Insert.....	20038	35	4	OE Sensor: Mercedes-Benz - A0009050030			
Service Pack; W/49mm Black Insert.....	20039	35	4	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	35	4		33700	11.5	1.3
S55 AMG				EZ-Sensor Service Pack; Aluminium Valve.....			
2001-2006				EZ-Sensor Service Pack; Rubber Valve.....			
Service Pack; Does Not Include Valve.....	20023	35	4	Sensor.....	20213	80	9
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack.....	20049 ^U	80	9
Service Pack; W/48mm Green Insert.....	20038	35	4	S550e			
Service Pack; W/49mm Black Insert.....	20039	35	4	2015-2016			
Service Pack; W/51mm Orange Insert.....	20040	35	4	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
S550							
2007-2010							
OE Sensor: Mercedes-Benz - 0025406817, 0025407917				EZ-Sensor.....			
Sensor.....	20094	53	6		33700	11.5	1.3
Service Pack; Includes Valve.....	20036	53	6	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2011				EZ-Sensor Service Pack; Rubber Valve.....			
OE Sensor: Mercedes-Benz - 0009054100				20018 ^{C, T}			
EZ-Sensor.....	33200 ^A	11.5	1.3	Sensor.....	28214	58	6.5
	33500 ^{A, DB}	11.5	1.3	Service Pack; Does Not Include Stem.....	20013 ^S	58	6.5
	33700	11.5	1.3		20016 ^M	58	6.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Fits Schrader Sensor; Includes			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Stem Only.....			
Sensor.....	28214	58	6.5	20020			
Service Pack; Does Not Include Stem.....	20013 ^S	58	6.5	20012-2013			
	20016 ^M	58	6.5	OE Sensor: Mercedes-Benz - 0009054100, 0009057200			
Service Pack; Fits Schrader Sensor; Includes				EZ-Sensor.....			
Stem Only.....				33200 ^A			
Service Pack; W/O Valve.....				33500 ^{A, DB}			
				33700			
				33700			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				34000			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 ^{C, T}			
				28214			
				Sensor.....			
				28214			
				Service Pack; Does Not Include Stem.....			
				20013 ^S			
				20016 ^M			
				58			
				6.5			
				Service Pack; Fits Schrader Sensor; Includes			
				Stem Only.....			
				20020			
				58			
				6.5			
				Service Pack; Does Not Include Valve.....			
				20023			
				35			
				4			
				Service Pack; W/43mm Silver Insert.....			
				20037			
				35			
				4			
				Service Pack; W/48mm Green Insert.....			
				20038			
				35			
				4			
				Service Pack; W/49mm Black Insert.....			
				20039			
				35			
				4			
				Service Pack; W/51mm Orange Insert.....			
				20040			
				35			
				4			
				2007-2010			
				OE Sensor: Mercedes-Benz - 0025406817, 0025407917			
				Sensor.....			
				20094			
				53			
				6			
				Service Pack; Includes Valve.....			
				20036			
				53			
				6			
				2011			
				OE Sensor: Mercedes-Benz - 0009054100			
				EZ-Sensor.....			
				33200 ^A			
				11.5			
				1.3			
				33500 ^{A, DB}			
				11.5			
				1.3			
				33700			
				11.5			
				1.3			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 ^{C, T}			
				11.5			
				1.3			
				Sensor.....			
				28214			
				58			
				6.5			
				Service Pack; Does Not Include Stem.....			
				20013 ^S			
				58			
				6.5			
				20016 ^M			
				58			
				6.5			
				Service Pack; Fits Schrader Sensor; Includes			
				Stem Only.....			
				20020			
				58			
				6.5			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
S600 (cont'd)				S63 AMG (cont'd)			
2012-2013				2012-2013			
OE Sensor: Mercedes-Benz - 0009054100, 0009057200				OE Sensor: Mercedes-Benz - 0009054100, 0009057200			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	28214	58	6.5	Sensor	28214	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only				Service Pack; Fits Schrader Sensor; Includes Stem Only			
	20020	58	6.5		20020	58	6.5
Service Pack; W/O Valve	20013 S	58	6.5	Service Pack; W/O Valve	20013 S	58	6.5
	20016 M	58	6.5		20016 M	58	6.5
2014-2016				2014-2016			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	20213	80	9	Sensor	20213	80	9
Service Pack	20049 U	80	9	Service Pack	20049 U	80	9
2017-2018				2017-2018			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	20213	80	9	Sensor	20213	80	9
Service Pack	20049 U	80	9	Service Pack	20049 U	80	9
S63 AMG				S65 AMG			
2008-2010				2006			
OE Sensor: Mercedes-Benz - 0025406817, 0025407917				Service Pack; Does Not Include Valve			
Sensor	20094	53	6	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; Includes Valve	20036	53	6	Service Pack; W/48mm Green Insert	20038	35	4
2011				Service Pack; W/49mm Black Insert			
OE Sensor: Mercedes-Benz - 0009054100				Service Pack; W/51mm Orange Insert			
EZ-Sensor	33200 A	11.5	1.3		20040	35	4
	33500 A, DB	11.5	1.3	2007-2010			
	33700	11.5	1.3	OE Sensor: Mercedes-Benz - 0025406817, 0025407917			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor	20094	53	6
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; Includes Valve	20036	53	6
Sensor	28214	58	6.5	2011			
Service Pack; Does Not Include Stem	20013 S	58	6.5	OE Sensor: Mercedes-Benz - 0009054100			
	20016 M	58	6.5	EZ-Sensor	33200 A	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only					33500 A, DB	11.5	1.3
	20020	58	6.5		33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	28214	58	6.5
				Service Pack; Does Not Include Stem	20013 S	58	6.5
					20016 M	58	6.5
				Service Pack; Fits Schrader Sensor; Includes Stem Only			
					20020	58	6.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013 S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
S65 AMG (cont'd)				SL500			
2012-2013				2000-2005			
OE Sensor: Mercedes-Benz - 0009054100, 0009057200				EZ-Sensor; Programmable sensor, Rubber Valve. 33500 ^{A, DB} 11.5 1.3			
EZ-Sensor..... 33200 ^A 11.5 1.3				33700 11.5 1.3			
33700 11.5 1.3				Service Pack; Does Not Include Valve..... 20023 35 4			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				Service Pack; W/43mm Silver Insert..... 20037 35 4			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				Service Pack; W/48mm Green Insert..... 20038 35 4			
Sensor..... 28214 58 6.5				Service Pack; W/49mm Black Insert..... 20039 35 4			
Service Pack; Fits Schrader Sensor; Includes				Service Pack; W/51mm Orange Insert..... 20040 35 4			
Stem Only..... 20020 58 6.5				2006			
Service Pack; W/O Valve..... 20013 ^S 58 6.5				OE Sensor: Mercedes-Benz - 0025406817			
20016 ^M 58 6.5				Sensor..... 20094 53 6			
2014-2016				Service Pack; Includes Valve..... 20036 53 6			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				SL55 AMG			
33700 11.5 1.3				2003			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				EZ-Sensor; Programmable sensor, Rubber Valve. 33500 ^{A, DB} 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				33700 11.5 1.3			
2017-2018				EZ-Sensor Service Pack; Aluminum valve..... 34000 62 7			
OE Sensor: Mercedes-Benz - A0009050030				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				Service Pack; Does Not Include Valve..... 20023 35 4			
33700 11.5 1.3				Service Pack; W/43mm Silver Insert..... 20037 35 4			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				Service Pack; W/48mm Green Insert..... 20038 35 4			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				Service Pack; W/49mm Black Insert..... 20039 35 4			
Sensor..... 20213 80 9				Service Pack; W/51mm Orange Insert..... 20040 35 4			
Service Pack..... 20049 ^U 80 9				2004			
SL400				EZ-Sensor; Programmable sensor, Rubber Valve. 33500 ^{A, DB} 11.5 1.3			
2015-2016				33700 11.5 1.3			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				EZ-Sensor Service Pack; Aluminum valve..... 34000 62 7			
33700 11.5 1.3				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				Service Pack; Does Not Include Valve..... 20023 35 4			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				Service Pack; W/43mm Silver Insert..... 20037 35 4			
2017-2018				Service Pack; W/48mm Green Insert..... 20038 35 4			
OE Sensor: Mercedes-Benz - A0009050030				Service Pack; W/49mm Black Insert..... 20039 35 4			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				Service Pack; W/51mm Orange Insert..... 20040 35 4			
33700 11.5 1.3				2005			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				EZ-Sensor; Programmable sensor, Rubber Valve. 33500 ^{A, DB} 11.5 1.3			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				33700 11.5 1.3			
Sensor..... 20213 80 9				EZ-Sensor Service Pack; Aluminum valve..... 34000 62 7			
Service Pack..... 20049 ^U 80 9				EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3			
SL450				Service Pack; Does Not Include Valve..... 20023 35 4			
2017-2018				Service Pack; W/43mm Silver Insert..... 20037 35 4			
OE Sensor: Mercedes-Benz - A0009050030				Service Pack; W/48mm Green Insert..... 20038 35 4			
EZ-Sensor..... 33500 ^{A, DB} 11.5 1.3				Service Pack; W/49mm Black Insert..... 20039 35 4			
33700 11.5 1.3				Service Pack; W/51mm Orange Insert..... 20040 35 4			
EZ-Sensor Service Pack; Aluminium Valve..... 34000 62 7				2006-2008			
EZ-Sensor Service Pack; Rubber Valve..... 20018 ^{C, T} 11.5 1.3				OE Sensor: Mercedes-Benz - 002 540 6817			
Sensor..... 20213 80 9				Sensor..... 20094 53 6			
Service Pack..... 20049 ^U 80 9				Service Pack; Includes Valve..... 20036 53 6			
SL550				SL550			
2017-2018				2007-2009			
OE Sensor: Mercedes-Benz - 0025406817				OE Sensor: Mercedes-Benz - 0025406817			
Sensor..... 20094 53 6				Sensor..... 20094 53 6			
Service Pack; Includes Valve..... 20036 53 6				Service Pack; Includes Valve..... 20036 53 6			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
SL550 (cont'd)				SL600 (cont'd)			
2012				2003			
OE Sensor: Mercedes-Benz - 0009054100				EZ-Sensor; Programmable sensor, Rubber Valve.	33500 A, DB	11.5	1.3
EZ-Sensor	33200 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2004-2005			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor; Programmable sensor, Rubber Valve	33500 A, DB	11.5	1.3
Sensor	28214	58	6.5		33700	11.5	1.3
Service Pack; Does Not Include Stem	20013 S	58	6.5	EZ-Sensor Service Pack; Aluminum valve	34000	62	7
	20016 M	58	6.5	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack; Does Not Include Valve	20023	35	4
2013				Service Pack; W/43mm Silver Insert	20037	35	4
OE Sensor: Mercedes-Benz - 0009057200				Service Pack; W/48mm Green Insert	20038	35	4
EZ-Sensor	33200 A	11.5	1.3	Service Pack; W/49mm Black Insert	20039	35	4
	33500 A, DB	11.5	1.3	Service Pack; W/51mm Orange Insert	20040	35	4
	33700	11.5	1.3	2006-2009			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	OE Sensor: Mercedes-Benz - 0025406817			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20094	53	6
Sensor	28214	58	6.5	Service Pack; Includes Valve	20036	53	6
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	SL63 AMG			
Service Pack; W/O Valve	20013 S	58	6.5	2009			
	20016 M	58	6.5	OE Sensor: Mercedes-Benz - 0025406817			
2014-2016				Sensor	20094	53	6
OE Sensor: Mercedes-Benz - A0009050030				Service Pack; Includes Valve	20036	53	6
EZ-Sensor	33200 A	11.5	1.3	2011			
	33500 A, DB	11.5	1.3	OE Sensor: Mercedes-Benz - 0025407917			
	33700	11.5	1.3	Sensor	20094	53	6
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2012			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	OE Sensor: Mercedes-Benz - 0009054100			
Sensor	20213	80	9	EZ-Sensor	33200 A	11.5	1.3
Service Pack	20049 U	80	9		33500 A, DB	11.5	1.3
2017-2018					33700	11.5	1.3
OE Sensor: Mercedes-Benz - A0009050030				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor	28214	58	6.5
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; Does Not Include Stem	20013 S	58	6.5
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		20016 M	58	6.5
Sensor	20213	80	9	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
Service Pack	20049 U	80	9	2013			
SL600				OE Sensor: Mercedes-Benz - 0009057200			
2000				EZ-Sensor	33200 A	11.5	1.3
EZ-Sensor; Programmable sensor, Rubber Valve	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminum valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28214	58	6.5
2001-2002				Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
EZ-Sensor; Programmable sensor, Rubber Valve	33500 A, DB	11.5	1.3	Service Pack; W/O Valve	20013 S	58	6.5
	33700	11.5	1.3		20016 M	58	6.5
EZ-Sensor Service Pack; Aluminum valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3				
Service Pack; Does Not Include Valve	20023	35	4				
Service Pack; W/43mm Silver Insert	20037	35	4				
Service Pack; W/48mm Green Insert	20038	35	4				
Service Pack; W/49mm Black Insert	20039	35	4				
Service Pack; W/51mm Orange Insert	20040	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013 S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
SL63 AMG (cont'd)				SLC43 AMG			
2014-2016				2017-2018			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20213	80	9
Sensor.....	20213	80	9	Service Pack.....	20049 U	80	9
Service Pack.....	20049 U	80	9				
2017-2018				SLK250			
OE Sensor: Mercedes-Benz - A0009050030				2012			
EZ-Sensor.....				OE Sensor: Mercedes-Benz - 0009054100			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20213	80	9	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20049 U	80	9	Sensor.....	28214	58	6.5
				Service Pack; Does Not Include Stem.....	20013 S	58	6.5
					20016 M	58	6.5
SL65 AMG				Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
2005				20020			
Service Pack; Does Not Include Valve.....	20023	35	4	2013			
Service Pack; W/43mm Silver Insert.....	20037	35	4	OE Sensor: Mercedes-Benz - 0009057200			
Service Pack; W/48mm Green Insert.....	20038	35	4	EZ-Sensor.....			
Service Pack; W/49mm Black Insert.....	20039	35	4		33200 A	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	35	4		33500 A, DB	11.5	1.3
					33700	11.5	1.3
2006-2009				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Mercedes-Benz - 0025406817				34000			
Sensor.....	20094	53	6	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Includes Valve.....	20036	53	6	Sensor.....	28214	58	6.5
2011				Service Pack; Fits Schrader Sensor; Includes Stem Only.....			
OE Sensor: Mercedes-Benz - 0025407917				20020			
Sensor.....	20094	53	6	Service Pack; W/O Valve.....			
2014-2018				20013 S			
OE Sensor: Mercedes-Benz - A0009050030				20016 M			
EZ-Sensor.....	33500 A, DB	11.5	1.3	2014-2016			
	33700	11.5	1.3	OE Sensor: Mercedes-Benz - A0009050030			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33200 A	11.5	1.3
Sensor.....	20213	80	9		33500 A, DB	11.5	1.3
Service Pack.....	20049 U	80	9		33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
SLC300				EZ-Sensor Service Pack; Rubber Valve.....			
2017-2018				20018 C, T			
OE Sensor: Mercedes-Benz - A0009050030				Sensor.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3	20213			
	33700	11.5	1.3	Service Pack.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	20049 U			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2017			
Sensor.....	20213	80	9	OE Sensor: Mercedes-Benz - A0009050030			
Service Pack.....	20049 U	80	9	Sensor.....			
				20213			
				Service Pack.....			
				20049 U			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
SLK280				SLK350 (cont'd)			
2007				2008-2012			
OE Sensor: Mercedes-Benz - 0045421518				OE Sensor: Mercedes-Benz - 0009054100, 0025409017, 0035400217			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor; May & Newer	28214	58	6.5	Sensor	28214	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack; Does Not Include Stem	20013 S	58	6.5
Service Pack; May & Newer; Does Not Include Stem	20013 S	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
	20016 M	58	6.5	2013			
2008				OE Sensor: Mercedes-Benz - 0009057200			
OE Sensor: Mercedes-Benz - 0025409017				EZ-Sensor	33200 A	11.5	1.3
EZ-Sensor	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28214	58	6.5
Sensor	28214	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
Service Pack; Does Not Include Stem	20013 S	58	6.5	Service Pack; W/O Valve	20013 S	58	6.5
	20016 M	58	6.5		20016 M	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	2014-2016			
SLK300				OE Sensor: Mercedes-Benz - A0009050030			
2009-2011				EZ-Sensor	33200 A	11.5	1.3
OE Sensor: Mercedes-Benz - 0025409017, 0035400217					33500 A, DB	11.5	1.3
EZ-Sensor	33200 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor	20213	80	9
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack	20049 U	80	9
Sensor	28214	58	6.5	2017			
Service Pack; Does Not Include Stem	20013 S	58	6.5	OE Sensor: Mercedes-Benz - A0009050030			
	20016 M	58	6.5	Sensor	20213	80	9
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack	20049 U	80	9
SLK350				SLK55 AMG			
2007				2007			
OE Sensor: Mercedes-Benz - 0045421518				OE Sensor: Mercedes-Benz - 0045421518			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor; May & Newer	28214	58	6.5	Sensor; May & Newer	28214	58	6.5
Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5	Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
Service Pack; May & Newer; Does Not Include Stem	20013 S	58	6.5	Service Pack; May & Newer; Does Not Include Stem	20013 S	58	6.5
	20016 M	58	6.5		20016 M	58	6.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013 S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
SLK55 AMG (cont'd)				SLR McLaren (cont'd)			
2008-2010				2008-2009			
OE Sensor: Mercedes-Benz - 0025409017, 0035400217				OE Sensor: Mercedes-Benz - 0025407917			
EZ-Sensor.....	33200 A	11.5	1.3	Sensor.....	20094	53	6
	33500 A, DB	11.5	1.3	Service Pack; Includes Valve.....	20036	53	6
	33700	11.5	1.3	SLS AMG			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2011-2012			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Mercedes-Benz - 0009054100			
Sensor.....	28214	58	6.5	EZ-Sensor.....	33200 A	11.5	1.3
Service Pack; Does Not Include Stem.....	20013 S	58	6.5		33500 A, DB	11.5	1.3
	20016 M	58	6.5		33700	11.5	1.3
Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2012-2013				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3	Sensor.....	28214	58	6.5
	33700	11.5	1.3	Service Pack; Does Not Include Stem.....	20013 S	58	6.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20016 M	58	6.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
2014				2013			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Mercedes-Benz - 0009057200			
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20213	80	9	Sensor.....	28214	58	6.5
Service Pack.....	20049 U	80	9	Service Pack; Fits Schrader Sensor; Includes Stem Only.....	20020	58	6.5
2015-2017				Service Pack; W/O Valve.....	20013 S	58	6.5
OE Sensor: Mercedes-Benz - A0009050030					20016 M	58	6.5
Sensor.....	20213	80	9	2014-2015			
Service Pack.....	20049 U	80	9	OE Sensor: Mercedes-Benz - A0009050030			
SLR McLaren				EZ-Sensor.....			
2004-2006					33200 A	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor; Programmable sensor, Rubber Valve.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20213	80	9
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack.....	20049 U	80	9
Service Pack; W/43mm Silver Insert.....	20037	35	4	2016			
Service Pack; W/48mm Green Insert.....	20038	35	4	EZ-Sensor.....			
Service Pack; W/49mm Black Insert.....	20039	35	4		33200 A	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	35	4		33500 A, DB	11.5	1.3
2007					33700	11.5	1.3
EZ-Sensor.....	33200 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor; Programmable sensor, Rubber Valve.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sprinter 2500			
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	2010			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Mercedes-Benz - 68006771AA			
Service Pack; Does Not Include Valve.....	20023	53	6	EZ-Sensor.....	33000 A		
Service Pack; W/43mm Silver Insert.....	20037	53	6		33500 A, DB	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	53	6		33700	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	53	6	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/51mm Orange Insert.....	20040	53	6	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor.....	20089	53	6
				Service Pack; Includes Valve.....	20036	31-40	3.5-4.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008 U-Interchanges with 20047

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercedes-Benz (cont'd)				Mercedes-Benz (cont'd)			
Sprinter 2500 (cont'd)				Sprinter 3500 (cont'd)			
2011-2012				2013			
OE Sensor: Mercedes-Benz - 68006771AA				EZ-Sensor.....	33500 A,DB	11.5	1.3
EZ-Sensor.....	33500 A,DB	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
Sensor.....	20089	53	6	2014-2016			
Service Pack; Includes Valve.....	20036	31-40	3.5-4.5	OE Sensor: Mercedes-Benz - A0009050030			
2013				EZ-Sensor.....	33200 A	11.5	1.3
EZ-Sensor.....	33500 A,DB	11.5	1.3		33500 A,DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	Sensor.....	20213	80	9
2014-2015				Service Pack; Does Not Include Stem.....	20013 S	58	6.5
OE Sensor: Mercedes-Benz - A0009050030					20016 M	58	6.5
EZ-Sensor.....	33200 A	11.5	1.3	2017			
	33500 A,DB	11.5	1.3	OE Sensor: Mercedes-Benz - A0009050030			
	33700	11.5	1.3	EZ-Sensor.....	33500 A,DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20213	80	9	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
Service Pack; Does Not Include Stem.....	20013 S	58	6.5	Sensor.....	20213	80	9
	20016 M	58	6.5	Service Pack; Does Not Include Stem.....	20013 S	58	6.5
2016					20016 M	58	6.5
OE Sensor: Mercedes-Benz - A0009057200				2018			
EZ-Sensor.....	33200 A	11.5	1.3	OE Sensor: Mercedes-Benz - A0009050030			
	33500 A,DB	11.5	1.3	EZ-Sensor.....	33500 A,DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	Sensor.....	20213	80	9
Sensor.....	28214	80	9	Service Pack; Does Not Include Stem.....	20013 S	58	6.5
Service Pack; Does Not Include Stem.....	20013 S	58	6.5		20016 M	58	6.5
	20016 M	58	6.5	Vito			
2017-2018				2016-2017			
OE Sensor: Mercedes-Benz - A0009057200				OE Sensor: Mercedes-Benz - A4479050500			
EZ-Sensor.....	33500 A,DB	11.5	1.3	EZ-Sensor.....	33500 A,DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
Sensor.....	28214	80	9	Sensor.....	28239		
Service Pack; Does Not Include Stem.....	20013 S	58	6.5	Service Pack.....	20018 C,T		
	20016 M	58	6.5				
Sprinter 3500				Mercury			
2010-2012				Grand Marquis			
OE Sensor: Mercedes-Benz - 68006771AA				2006-2011			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Ford Motor Company - 6F2Z1A189A			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3		33500 A,DB	11.5	1.3
Sensor.....	20089	53	6		33700	11.5	1.3
Service Pack; Includes Valve.....	20036	53	6	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2012				EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
EZ-Sensor.....	33500 A,DB	11.5	1.3	Sensor.....	28385	27	3
	33700	11.5	1.3	Sensor Clip.....	22100		
				Sensor Cradle.....	22101		
				Universal Band.....	22102		

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercury (cont'd)				Mercury (cont'd)			
Mariner				Montego			
2005				2006-2007			
OE Sensor: Ford Motor Company - 6F2Z1A189A				OE Sensor: Ford Motor Company - 7L1Z1A189A			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor: Oct. 3, 2005 & Newer.....	28385	27	3	Sensor.....	28390	27	3
Sensor Clip.....	22100			Sensor Clip.....	22100		
Sensor Cradle.....	22101			Sensor Cradle.....	22101		
Universal Band.....	22102			Universal Band.....	22102		
2006-2008				Monterey			
OE Sensor: Ford Motor Company - 6F2Z1A189A				2004-2005			
EZ-Sensor.....	33000 ^A	11.5	1.3	OE Sensor: Ford Motor Company - 5L1Z 1A150 AA			
	33500 ^{A, DB}	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	28385	27	3	Sensor.....	20135 ^B	44	5
Sensor Clip.....	22100			Service Pack.....	20002 ^E	44	5
Sensor Cradle.....	22101				20004 ^P	44	5
Universal Band.....	22102						
2009-2011				2006-2007			
OE Sensor: Ford Motor Company - 9L3Z1A189A				OE Sensor: Ford Motor Company - 6F2Z1A189A			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	20315	13	1.5	Sensor.....	28385	27	3
Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Sensor Clip.....	22100		
				Sensor Cradle.....	22101		
				Universal Band.....	22102		
Milan				Mountaineer			
2007-2009				2002-2005			
OE Sensor: Ford Motor Company - 6F2Z1A189A				OE Sensor: Ford Motor Company - 4L2Z 1A150 BA			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33200 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	28385	27	3	Sensor.....	20096 ^B	44	5
Sensor Clip.....	22100			Service Pack.....	20002 ^E	44	5
Sensor Cradle.....	22101				20004 ^P	44	5
Universal Band.....	22102						
2010-2011				2006-2010			
OE Sensor: Ford Motor Company - 9L3Z1A189A				OE Sensor: Ford Motor Company - 6F2Z1A189A			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	20315	13	1.5	Sensor.....	28385	27	3
Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Sensor Clip.....	22100		
				Sensor Cradle.....	22101		
				Universal Band.....	22102		

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mercury (cont'd)				Mini (cont'd)			
Sable				Cooper (cont'd)			
2008-2009				2015-2016			
OE Sensor: Ford Motor Company - 7L1Z1A189A				OE Sensor: BMW - 36 10 6 798 872			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		20018 C, T	11.5	1.3
Sensor	28390	27	3	Sensor	28126	40	4.5
Sensor Clip	22100			Service Pack; Does Not Include Valve	20023	35	4
Sensor Cradle	22101			Service Pack; W/43mm Silver Insert	20037	35	4
Universal Band	22102			Service Pack; W/48mm Green Insert	20038	35	4
				Service Pack; W/49mm Black Insert	20039	35	4
				Service Pack; W/51mm Orange Insert	20040	35	4
Mini				2017			
Cooper				EZ-Sensor			
2008-2009				33500 A, DB 11.5 1.3			
OE Sensor: BMW - 36236781847				33700 11.5 1.3			
Sensor; Includes Transmitter Only	20083	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack; Does Not Include Valve	20023	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack; W/43mm Silver Insert	20037	35	4		20018 C, T	11.5	1.3
Service Pack; W/48mm Green Insert	20038	35	4	Cooper Clubman			
Service Pack; W/49mm Black Insert	20039	35	4	2016-2017			
Service Pack; W/51mm Orange Insert	20040	35	4	EZ-Sensor			
2009				33500 A, DB 11.5 1.3			
OE Sensor: BMW - 36 10 6 790 054				33700 11.5 1.3			
Sensor; Includes Transmitter Only	28081	40	4.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
2010-2013				EZ-Sensor Service Pack; Rubber Valve			
OE Sensor: BMW - 36 10 6 790 054				20018 C, T 11.5 1.3			
Sensor; Includes Transmitter Only	28081	40	4.5				
Service Pack; Does Not Include Valve	20023	35	4	Mitsubishi			
Service Pack; W/43mm Silver Insert	20037	35	4	Eclipse			
Service Pack; W/48mm Green Insert	20038	35	4	2006-2007			
Service Pack; W/49mm Black Insert	20039	35	4	OE Sensor: Mitsubishi - 4250A030, MN103081			
Service Pack; W/51mm Orange Insert	20040	35	4	EZ-Sensor			
2014				33000 A 11.5 1.3			
OE Sensor: BMW - 36 10 6 790 054, 36 10 6 798 872				33500 A, DB 11.5 1.3			
EZ-Sensor	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor; W/Alloy Wheels	20034 B	45-53	5-6
	20018 C, T	11.5	1.3	Sensor; W/Steel Wheels	28129	45-53	5-6
Sensor; Includes Transmitter Only	28126	40	4.5	Service Pack; W/Alloy Wheels	20003 F	45-53	5-6
Sensor; Transmitter only	28081	40	4.5		20007 V	45-53	5-6
Sensor; Transmitter only	28126	40	4.5	Service Pack; W/Steel Wheels	20009 R	45-53	5-6
Service Pack; Does Not Include Valve	20023	35	4		20010 L	45-53	5-6
Service Pack; W/43mm Silver Insert	20037	35	4	2008-2010			
Service Pack; W/48mm Green Insert	20038	35	4	OE Sensor: Mitsubishi - MN103081			
Service Pack; W/49mm Black Insert	20039	35	4	EZ-Sensor			
Service Pack; W/51mm Orange Insert	20040	35	4	33000 A 11.5 1.3			
				33500 A, DB 11.5 1.3			
				33700 11.5 1.3			
				EZ-Sensor Service Pack; Aluminium Valve			
				34000 62 7			
				EZ-Sensor Service Pack; Rubber Valve			
				20018 C, T 11.5 1.3			
				Sensor			
				20034 B 45-53 5-6			
				Service Pack			
				20003 F 45-53 5-6			
				20007 V 45-53 5-6			

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 L-Use until depleted, replaced by 20009 R-Interchanges with 20005, 20010 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mitsubishi (cont'd)				Mitsubishi (cont'd)			
Eclipse (cont'd)				Endeavor (cont'd)			
2011				2008			
OE Sensor: Mitsubishi - 4250B877				OE Sensor: Mitsubishi - MN103081			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20034 B	49	5.5	Sensor.....	20034 B	45-53	5-6
Service Pack.....	20003 F	45-53	5-6	Service Pack.....	20003 F	45-53	5-6
	20007 V	45-53	5-6		20007 V	45-53	5-6
2012				2010			
OE Sensor: Mitsubishi - 42508875				OE Sensor: Mitsubishi - MN103081			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; W/Steel Wheels.....	28129	45-53	5-6	Sensor.....	20034 B	45-53	5-6
Service Pack.....	20003 F	45-53	5-6	Service Pack.....	20003 F	45-53	5-6
	20007 V	45-53	5-6		20007 V	45-53	5-6
Endeavor				2011			
2004-2005				OE Sensor: Mitsubishi - 4250B875, 4250B877			
OE Sensor: Mitsubishi - MN103033				EZ-Sensor.....			
EZ-Sensor.....	33200 A	11.5	1.3		33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20028 B	45-53	5-6	Sensor; W/Alloy Wheels.....	20034 B	49	5.5
Service Pack.....	20003 F	45-53	5-6	Sensor; W/Steel Wheels.....	28129	45-53	5-6
	20007 V	45-53	5-6	Service Pack; W/Alloy Wheels.....	20003 F	45-53	5-6
2006					20007 V	45-53	5-6
OE Sensor: Mitsubishi - MN103033, MN103081				Service Pack; W/Steel Wheels.....			
EZ-Sensor.....	33200 A	11.5	1.3		20009 R	45-53	5-6
EZ-Sensor; Sept. 1 & Newer.....	33000 A	11.5	1.3		20010 L	45-53	5-6
	33500 A, DB	11.5	1.3	2012			
	33700	11.5	1.3	EZ-Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....			
Sensor; Aug. & Older.....	20028 B	45-53	5-6				
Sensor; Sept. 1 & Newer.....	20034 B	45-53	5-6	EZ-Sensor Service Pack; Aluminium Valve.....			
Service Pack.....	20003 F	45-53	5-6	EZ-Sensor Service Pack; Rubber Valve.....			
	20007 V	45-53	5-6				
2007				Galant			
OE Sensor: Mitsubishi - MN103081				2004-2006			
EZ-Sensor.....	33200 A	11.5	1.3	OE Sensor: Mitsubishi - MN103033			
EZ-Sensor; W/315 MHz Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....			
	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
Sensor.....	20034 B	45-53	5-6	Sensor.....			
Service Pack.....	20003 F	45-53	5-6	Service Pack.....			
	20007 V	45-53	5-6				

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 L-Use until depleted, replaced by 20009 R-Interchanges with 20005, 20010 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.			
Mitsubishi (cont'd)				Mitsubishi (cont'd)						
Galant (cont'd)				Lancer (cont'd)						
2007-2009				2008-2010						
OE Sensor: Mitsubishi - 4250A030, MN103081				OE Sensor: Mitsubishi - 4250A225						
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3			
	33500 A, DB	11.5	1.3		33700	11.5	1.3			
	33700	11.5	1.3	EZ-Sensor; Caution: Ez-sensor will not support						
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	(Wai) Wheel Arch Initiators	33000 A	11.5	1.3			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7			
Sensor; W/Alloy Wheels	20034 B	45-53	5-6	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3			
Sensor; W/Steel Wheels	28129	45-53	5-6	Sensor	28096	71	8			
Service Pack; W/Alloy Wheels	20003 F	45-53	5-6	Service Pack	20030	71	8			
	20007 V	45-53	5-6	2011						
Service Pack; W/Steel Wheels	20009 R	45-53	5-6	OE Sensor: Mitsubishi - 4250A225						
	20010 L	45-53	5-6	EZ-Sensor						
2010-2012				EZ-Sensor						
OE Sensor: Mitsubishi - 4250B875, 4250B877				33000 A				11.5	1.3	
EZ-Sensor	33000 A	11.5	1.3	33500 A, DB				11.5	1.3	
	33500 A, DB	11.5	1.3	33700				11.5	1.3	
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve				34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve				20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor				28096	71	8
Sensor; W/Alloy Wheels	20034 B	49	5.5	Service Pack				20030	71	8
Sensor; W/Steel Wheels	28129	45-53	5-6	2012						
Service Pack; W/Alloy Wheels	20003 F	45-53	5-6	OE Sensor: Mitsubishi - 4250A225						
	20007 V	45-53	5-6	EZ-Sensor						
Service Pack; W/Steel Wheels	20009 R	45-53	5-6	EZ-Sensor						
	20010 L	45-53	5-6	EZ-Sensor Service Pack; Aluminium Valve				34000	62	7
2013				EZ-Sensor Service Pack; Rubber Valve				20018 C, T	11.5	1.3
EZ-Sensor				Sensor				28096	71	8
	33500 A, DB	11.5	1.3	Service Pack				20030	71	8
	33700	11.5	1.3	Service Pack; Rubber Valve				20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2013-2014						
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	OE Sensor: Mitsubishi - 4250B8975, 4250B975						
i-MiEV				EZ-Sensor						
2012-2016				EZ-Sensor						
OE Sensor: Mercedes-Benz - 4250B668				33000 A				11.5	1.3	
EZ-Sensor	33500 A, DB	11.5	1.3	33500 A, DB				11.5	1.3	
	33700	11.5	1.3	33700				11.5	1.3	
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve				34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve				20018 C, T	11.5	1.3
Sensor	28096	71	8	Sensor				28096	71	8
Service Pack	20030	71	8	Service Pack				20030	71	8
2017				2015-2017						
OE Sensor: Mercedes-Benz - 4250B668				OE Sensor: Mitsubishi - 4250B8975						
Sensor	28096	71	8	EZ-Sensor						
Service Pack	20030	71	8	EZ-Sensor						
Lancer				EZ-Sensor Service Pack; Aluminium Valve				34000	62	7
2006-2007				EZ-Sensor Service Pack; Rubber Valve				20018 C, T	11.5	1.3
OE Sensor: Mitsubishi - 4250A225				Sensor				28096	71	8
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack				20030	71	8
	33700	11.5	1.3	Mirage						
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2014						
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	OE Sensor: Mitsubishi - 4250B8975						
Sensor	28096	71	8	EZ-Sensor						
Mirage				EZ-Sensor						
2014				EZ-Sensor						
OE Sensor: Mitsubishi - 4250B8975				33000 A				11.5	1.3	
EZ-Sensor	33500 A, DB	11.5	1.3	33500 A, DB				11.5	1.3	
	33700	11.5	1.3	33700				11.5	1.3	
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve				34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve				20018 C, T	11.5	1.3
Sensor	28096	71	8	Sensor				28096	71	8
Service Pack	20030	71	8	Service Pack				20030	71	8

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 L-Use until depleted, replaced by 20009 R-Interchanges with 20005, 20010 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mitsubishi (cont'd)				Mitsubishi (cont'd)			
Mirage (cont'd)				Outlander (cont'd)			
2015-2018				2016-2017			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Mitsubishi - 4250B8975			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Mirage G4				EZ-Sensor Service Pack; Rubber Valve.....			
2017-2018				Sensor.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack.....	20030	71	8
	33700	11.5	1.3	Outlander Sport			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2011-2015			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Mitsubishi - 4250A225, 4250B8975			
Montero				EZ-Sensor.....			
2003-2006				33000 A			
OE Sensor: Mitsubishi - MN103081					33500 A, DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28096	71	8
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack.....	20030	71	8
Sensor.....	20034 B	45-53	5-6	2016-2018			
Service Pack.....	20003 F	45-53	5-6	OE Sensor: Mitsubishi - 4250B8975			
	20007 V	45-53	5-6	EZ-Sensor.....			
Montero Sport				33500 A, DB			
2003-2004				33700			
OE Sensor: Mitsubishi - MN103081				34000			
EZ-Sensor.....				20018 C, T			
	33000 A	11.5	1.3	Sensor.....			
	33500 A, DB	11.5	1.3	Service Pack.....			
	33700	11.5	1.3	20003 F			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	20007 V			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Outlander			
Sensor.....	20034 B	45-53	5-6	2007-2010			
Service Pack.....	20003 F	45-53	5-6	OE Sensor: Mitsubishi - 4250A225			
	20007 V	45-53	5-6	EZ-Sensor.....			
Outlander Sport				33500 A, DB			
2003-2004				33700			
OE Sensor: Mitsubishi - MN103081				34000			
EZ-Sensor.....				20018 C, T			
	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....			
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....			
	33700	11.5	1.3	Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Fits Schrader Alum stem sensor.			
Sensor.....	20034 B	45-53	5-6	Does not include stem.....			
Service Pack.....	20003 F	45-53	5-6	Service Pack; Fits Schrader Sensor; Includes			
	20007 V	45-53	5-6	Stem Only.....			
Outlander				20013 S			
2007-2010				20020			
OE Sensor: Mitsubishi - 4250A225				RVR			
EZ-Sensor.....				2011-2014			
	33500 A, DB	11.5	1.3	OE Sensor: Mitsubishi - 4250B8975			
	33700	11.5	1.3	EZ-Sensor.....			
EZ-Sensor; Caution: Ez-sensor will not support				33000 A			
(Wai) Wheel Arch Initiators.....	33000 A	11.5	1.3	33500 A, DB			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33700			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	34000			
Sensor.....	28096	71	8	20018 C, T			
Service Pack.....	20030	71	8	28461 G			
2011-2015				Service Pack: Fits Schrader Alum stem sensor.			
OE Sensor: Mitsubishi - 4250A225, 4250B8975				Does not include stem.....			
EZ-Sensor.....				Service Pack; Fits Schrader Sensor; Includes			
	33000 A	11.5	1.3	Stem Only.....			
	33500 A, DB	11.5	1.3	20013 S			
	33700	11.5	1.3	20020			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	RVR			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2011-2014			
Sensor.....	28096	71	8	OE Sensor: Mitsubishi - 4250B8975			
Service Pack.....	20030	71	8	EZ-Sensor.....			
2011-2015				33000 A			
OE Sensor: Mitsubishi - 4250A225, 4250B8975				33500 A, DB			
EZ-Sensor.....				33700			
	33000 A	11.5	1.3	34000			
	33500 A, DB	11.5	1.3	20018 C, T			
	33700	11.5	1.3	28096			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	20030			
Sensor.....	28096	71	8				
Service Pack.....	20030	71	8				

A-Programming Tool Required B-Magnet may be Required to Activate Sensor C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 G-Supercedes the 28154 G-Use until depleted, replaced by 20007 S-Interchanges with 20016 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Mitsubishi (cont'd)				Nissan (cont'd)			
RVR (cont'd)				370Z (cont'd)			
2015				2014-2016			
OE Sensor: Mitsubishi - 4250B8975				EZ-Sensor.	33000 A	11.5	1.3
EZ-Sensor.	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Sensor.	28096	71	8	2017-2018			
Service Pack.	20030	71	8	EZ-Sensor.	33500 A, DB	11.5	1.3
2016-2017					33700	11.5	1.3
OE Sensor: Mitsubishi - 4250B8975				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Sensor.	28096	71	8	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Service Pack.	20030	71	8	Altima			
Nissan				2006			
350Z				OE Sensor: Nissan - 40700-JA01B			
2003-2006				EZ-Sensor.			
OE Sensor: Nissan - 40700-CD001					33000 A	11.5	1.3
EZ-Sensor.	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Sensor; Oct. 1 & Newer.	28204	71	8
Sensor.	20064	49	5.5	Service Pack; Oct. 1 & Newer.	20014	71	8
Service Pack.	20007 V	49	5.5	2007-2010			
2007-2009				OE Sensor: Nissan - 40700-JA01B, 40700-JA02B			
OE Sensor: Nissan - 40700-JA01B, 40700-JA01C				EZ-Sensor.	33000 A	11.5	1.3
EZ-Sensor.	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Sensor.	28204	71	8
Sensor.	28204	71	8	Service Pack.	20014	71	8
Service Pack.	20014	71	8	2011-2012			
370Z				OE Sensor: Nissan - 40700-1AA0D, 40700-JA01B			
2009-2010				EZ-Sensor.			
OE Sensor: Nissan - 40700-JK00B					33000 A	11.5	1.3
EZ-Sensor.	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Sensor.	28204	49	5.5
Sensor.	28210	71	8	Service Pack.	20014	71	8
Service Pack.	20014	71	8	2013-2015			
2010				EZ-Sensor.			
Service Pack.	20032	50-60	5.6 - 7.		33500 A, DB	11.5	1.3
2011-2013					33700	11.5	1.3
EZ-Sensor.	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
	33700	11.5	1.3	Service Pack.	20050V		
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7		20051		
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	2016-2017			
Service Pack.	20032	50-60	5.6 - 7.	Service Pack.	20050V		
					20051		

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008
V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Nissan (cont'd)				Nissan (cont'd)			
Armada				Armada (cont'd)			
2005-2006				2017-2018			
OE Sensor: Nissan - 40700-CK001, 40700-CK002				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
EZ-Sensor.....	33000 ^A	11.5	1.3		33700	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; W/Alloy Wheels.....	20161	49	5.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Sensor; W/Steel Wheels.....	20069	49	5.5
Sensor; W/Alloy Wheels.....	20161	49	5.5	Service Pack; W/Alloy Wheels.....	20007 ^V	49	5.5
Sensor; W/Steel Wheels.....	20069	49	5.5	Service Pack; W/Steel Wheels.....	20005 ^K	49	5.5
Service Pack; W/Alloy Wheels.....	20007 ^V	49	5.5		20009 ^R	49	5.5
Service Pack; W/Steel Wheels.....	20005 ^K	49	5.5		20009 ^R	49	5.5
	20009 ^R	49	5.5	Cube			
2007				2009-2010			
OE Sensor: Nissan - 40700-CK001				OE Sensor: Nissan - 40700-JA01C			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	20161	49	5.5	Sensor.....	28204	71	8
Service Pack.....	20007 ^V	49	5.5	Service Pack.....	20014	71	8
2008				2011-2012			
OE Sensor: Nissan - 40700-CK001, 40700-JA02B				OE Sensor: Nissan - 40700-1AA0B, 40700-1AA0D			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor; Ikey.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	EZ-Sensor; non-Ikey.....	33000 ^A	11.5	1.3
	33700	11.5	1.3		33500 ^{A, DB}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Ikey; Aluminium Valve..	34000	62	7
Sensor; LE.....	28204	49	5.5	EZ-Sensor Service Pack; Ikey; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor; SE.....	20161	49	5.5	EZ-Sensor Service Pack; non-Ikey; Aluminium Valve.....	34000	62	7
Service Pack; LE.....	20014	49	5.5	EZ-Sensor Service Pack; non-Ikey; Rubber Valve..	20018 ^{C, T}	11.5	1.3
Service Pack; SE.....	20007 ^V	49	5.5	Sensor; non-Ikey.....	28204	49	5.5
2009-2011				2013			
OE Sensor: Nissan - 40700-JA01B				EZ-Sensor.....	33000 ^A	11.5	1.3
EZ-Sensor.....	33000 ^A	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	2014			
Sensor.....	28204	49	5.5	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
Service Pack.....	20014	49	5.5		33700	11.5	1.3
2012-2015				2015			
OE Sensor: Nissan - 40700-1AA0D, 407001AA0D				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	Sensor.....	28204	49	5.5
	33700	11.5	1.3	Service Pack.....	20014	71	8
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2016			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	OE Sensor: Nissan - 40700-1AA0B			
Sensor.....	28204	49	5.5	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
Service Pack.....	20014	71	8		33700	11.5	1.3
2016				Frontier			
OE Sensor: Nissan - 40700-1AA0B				2003-2004			
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	OE Sensor: Nissan - 40700-CD001			
	33700	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 ^{A, DB}	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3		33700	11.5	1.3
Sensor.....	28204	49	5.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20014	71	8	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
2016				2015			
OE Sensor: Nissan - 40700-1AA0B				Sensor.....	20064	36-60	4.1-6.8
EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3	Service Pack.....	20007 ^V	36-60	4.1-6.8
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3				
Sensor.....	28204	49	5.5				
Service Pack.....	20014	71	8				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000, 33100 & 33200 K-Use until depleted, replaced by 20009
R-Interchanges with 20005, 20010 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Nissan (cont'd)				Nissan (cont'd)			
Frontier (cont'd)				GT-R			
2005-2007				2009			
OE Sensor: Nissan - 40700-CK001, 40700-CK002				OE Sensor: Nissan - 40700-JA01C			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor; W/Alloy Wheels	20161	49	5.5	Sensor	28204	71	8
Sensor; W/Steel Wheels	20069	49	5.5	Service Pack	20014	71	8
Service Pack; W/Alloy Wheels	20007 V	49	5.5	2010			
Service Pack; W/Steel Wheels	20005 K	49	5.5	OE Sensor: Nissan - 40700-JA01C			
	20009 R	49	5.5	EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000			
2008				EZ-Sensor			
OE Sensor: Nissan - 40700-CK001, 40700-JA01B				33000 A			
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28204	71	8
Sensor; W/Alloy Wheels	20161	49	5.5	Service Pack	20014	71	8
Sensor; W/Steel Wheels	28204	49	5.5	2011-2016			
Service Pack; W/Alloy Wheels	20007 V	49	5.5	OE Sensor: Nissan - 40700-1AA0B, 40700-1AA0D, 40700-JA01B, 407001AA0B			
Service Pack; W/Steel Wheels	20014	49	5.5	EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000			
2009-2011				EZ-Sensor			
OE Sensor: Nissan - 40700-1AA0B, 40700-JA01B				33000 A			
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28204	49	5.5
Sensor	28204	49	5.5	Service Pack	20014	71	8
Service Pack	20014	49	5.5	2017-2018			
2012-2015				OE Sensor: Nissan - 40700-1AA0B, 40700-JA01B			
OE Sensor: Nissan - 40700-1AA0D, 407001AA0D				EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000			
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28204	49	5.5
Sensor	28204	49	5.5	Service Pack	20014	71	8
Service Pack	20014	71	8	Juke			
2016				2011			
OE Sensor: Nissan - 407001AA0D				OE Sensor: Nissan - 40700-1AA0B			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	28204	49	5.5	Sensor	28204	49	5.5
Service Pack	20014	71	8	Service Pack	20014	49	5.5
2017-2018							
EZ-Sensor	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 K-Use until depleted, replaced by 20009 R-Interchanges with 20005, 20010 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Nissan (cont'd)				Nissan (cont'd)			
Juke (cont'd)				Maxima			
2012				2006			
OE Sensor: Nissan - 40700-1AA0D				OE Sensor: Nissan - 40700-CK001			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor; non-Ikey.....	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28204	49	5.5	Sensor; Jun. & Newer.....	20161	49	5.5
Service Pack.....	20014	49	5.5	Service Pack; Jun. & Newer.....	20007 V	49	5.5
2013-2015				2007			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Nissan - 40700-CK001, 40700-JA01B			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2016-2017				2008-2010			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Nissan - 40700-JA01B, 40700-JA02B			
	33700	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Leaf				2011-2012			
2011-2012				2011-2012			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Nissan - 40700-1AA0D, 40700-JA01B			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2013				2011-2012			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Nissan - 40700-1AA0D, 40700-JA01B			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20050V			EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	20051			Sensor.....	28204	49	5.5
2014-2017				2011-2012			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Nissan - 40700-1AA0D, 40700-JA01B			
	33700	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Service Pack.....	20050V			EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	20051			EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2018				2013			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33200 A	11.5	1.3
	33700	11.5	1.3	EZ-Sensor; exc GCC.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
				2014-2015			
				EZ-Sensor; exc GCC.....			
				33000 A			
				33500 A, DB			
				33700			
				EZ-Sensor Service Pack; exc GCC; Aluminium			
				Valve.....			
				34000			
				EZ-Sensor Service Pack; exc GCC; Rubber Valve.....			
				20018 C, T			
				Service Pack.....			
				20050V			
				20051			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008
V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Nissan (cont'd)				Nissan (cont'd)			
Maxima (cont'd)				Murano (cont'd)			
2016				2012-2014			
Service Pack.	20050V 20051			OE Sensor: Nissan - 40700-1AA0D			
				EZ-Sensor.	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
				Sensor.	28204	49	5.5
				Service Pack.	20014	71	8
				2013-2014			
				Service Pack.	20050V 20051		
				2015-2017			
				Service Pack.	20050V 20051		
				NV			
				2012			
				OE Sensor: Nissan - 40700-1PA0A			
				Sensor.	28342	68	7.7
				Service Pack.	20014	71	8
				2013-2015			
				OE Sensor: Nissan - 40700-1A00D, 40700-1PA0A, 407001PA0A			
				EZ-Sensor.	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
				Sensor.	28342	68	7.7
				Service Pack.	20014	71	8
				2014-2015			
				OE Sensor: Nissan - 40700-1AA0B			
				Sensor.	28204	49	5.5
				2016			
				OE Sensor: Nissan - 40700-1AA0B, 407001PA0A			
				EZ-Sensor.	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
				Sensor.	28204	49	5.5
					28342	68	7.7
					28342		
				Service Pack.	20014	71	8
				2017			
				OE Sensor: Nissan - 407001PA0A			
				EZ-Sensor.	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
				Sensor.	28342	68	7.7
					28342		
				Service Pack.	20014	71	8
				2010			
				OE Sensor: Nissan - 40700-1AA0B			
				EZ-Sensor.	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
				Sensor.	28204	35	4
				Service Pack.	20014	49	5.5
				2011			
				OE Sensor: Nissan - 40700-1AA0B			
				EZ-Sensor.	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
				Sensor.	28204	49	5.5
				Service Pack.	20014	49	5.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008
V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Nissan (cont'd)				Nissan (cont'd)			
NV (cont'd)				Pathfinder (cont'd)			
2018				2008-2011			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Nissan - 40700-1AA0B, 40700-JA01B, 40700-JA02B			
	33700	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Pathfinder				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2003				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
OE Sensor: Nissan - 40700-CD001				Sensor.....	28204	49	5.5
EZ-Sensor.....	33000 A	11.5	1.3	Service Pack.....	20014	49	5.5
	33500 A, DB	11.5	1.3	2012			
	33700	11.5	1.3	OE Sensor: Nissan - 40700-1AA0D			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....	20064	49	5.5		33700	11.5	1.3
Service Pack.....	20007 V	49	5.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2004				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
OE Sensor: Nissan - 40700-CD001, 40700-CK002				Sensor.....	28204	49	5.5
EZ-Sensor.....	33000 A	11.5	1.3	Service Pack.....	20014	71	8
	33500 A, DB	11.5	1.3	2013-2015			
	33700	11.5	1.3	Service Pack.....	20050V		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20051		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Quest			
Sensor; Armada.....	20069	49	5.5	2004			
Sensor; Exc. Armada; Aug. & Newer.....	20069	49	5.5	OE Sensor: Nissan - 40700-CK002			
Sensor; Exc. Armada; Jul. & Older.....	20064	49	5.5	EZ-Sensor.....	33000 A	11.5	1.3
Service Pack; Armada.....	20005 K	49	5.5		33500 A, DB	11.5	1.3
	20009 R	49	5.5		33700	11.5	1.3
Service Pack; Exc. Armada; Aug. & Newer.....	20005 K	49	5.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	20009 R	49	5.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Exc. Armada; Jul. & Older.....	20007 V	49	5.5	Sensor.....	20069	78	8.8
2005-2006				Service Pack.....	20005 K	78	8.8
OE Sensor: Nissan - 40700-CK001					20009 R	78	8.8
EZ-Sensor.....	33000 A	11.5	1.3	2005-2006			
	33500 A, DB	11.5	1.3	OE Sensor: Nissan - 40700-CK001, 40700-CK002			
	33700	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor.....	20161	49	5.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20007 V	49	5.5	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2007				Sensor; W/Alloy Wheels.....	20161	78	8.8
OE Sensor: Nissan - 40700-JA01A, 40700-JA01B				Sensor; W/Steel Wheels.....	20069	78	8.8
EZ-Sensor.....	33000 A	11.5	1.3	Service Pack; W/Alloy Wheels.....	20007 V	78	8.8
	33500 A, DB	11.5	1.3	Service Pack; W/Steel Wheels.....	20005 K	78	8.8
	33700	11.5	1.3		20009 R	78	8.8
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2007-2009			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Nissan - 40700-JA01B, 40700-JA02B			
Sensor; OEM Part No. 40700JA01A.....	28167	49	5.5	EZ-Sensor.....	33000 A	11.5	1.3
Sensor; OEM Part No. 40700JA01B.....	28204	49	5.5		33500 A, DB	11.5	1.3
Service Pack.....	20014	49	5.5		33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor.....	28204	49	5.5
				Service Pack.....	20014	49	5.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 K-Use until depleted, replaced by 20009
R-Interchanges with 20005, 20010 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Nissan (cont'd)				Nissan (cont'd)			
Quest (cont'd)				Rogue (cont'd)			
2011-2016				2017-2018			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	34000	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Rogue Select			
2017				2014-2015			
EZ-Sensor	33500 A, DB	11.5	1.3	OE Sensor: Nissan - 40700-1AA0B			
	33700	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	28204	49	5.5
				Service Pack	20014	68	7.7
Rogue				Sentra			
2008-2009				2007			
OE Sensor: Nissan - 40700-JA01B, 40700-JA01C				OE Sensor: Nissan - 40700-CK001, 40700-JA01B			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	28204	68	7.7	Sensor; W/Alloy Wheels	20161	78	8.8
Service Pack	20014	68	7.7	Sensor; W/Steel Wheels	28204	71	8
2011				Service Pack; W/Alloy Wheels	20007 V	78	8.8
OE Sensor: Nissan - 40700-1AA0B				Service Pack; W/Steel Wheels	20014	71	8
EZ-Sensor	33000 A	11.5	1.3	2008			
	33500 A, DB	11.5	1.3	OE Sensor: Nissan - 40700-JA01B			
	33700	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor	28204	49	5.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack	20014	49	5.5	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
2012				Sensor	28204	71	8
OE Sensor: Nissan - 40700-1AA0D				Service Pack	20014	71	8
EZ-Sensor	33000 A	11.5	1.3	2009-2010			
	33500 A, DB	11.5	1.3	OE Sensor: Nissan - 40700-JA01B			
	33700	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor	28204	49	5.5	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack	20014	71	8	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
2013				Sensor	28204	71	8
EZ-Sensor	33000 A	11.5	1.3	Service Pack	20014	71	8
	33500 A, DB	11.5	1.3	2011-2013			
	33700	11.5	1.3	OE Sensor: Nissan - 40700-1AA0B, 40700-1AA0D			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Service Pack	20050V				33700	11.5	1.3
	20051			EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	28204	49	5.5
				Service Pack	20014	71	8

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008
V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Nissan (cont'd)				Nissan (cont'd)			
Sentra (cont'd)				Titan (cont'd)			
2014-2017				2012-2015			
Service Pack.....	20050V 20051			OE Sensor: Nissan - 40700-1AA0D			
				EZ-Sensor.....	33000 ^A	11.5	1.3
					33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Sensor.....	28204	49	5.5
				Service Pack.....	20014	71	8
				2016-2017			
				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Titan XD			
				2017			
				EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Versa			
				2007			
				OE Sensor: Nissan - 40700-JA01A, 40700-JA01B			
				EZ-Sensor.....	33000 ^A	11.5	1.3
					33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Sensor; OEM Part No. 40700JA01A.....	28167	71	8
				Sensor; OEM Part No. 40700JA01B.....	28204	71	8
				Service Pack.....	20014	71	8
				2008-2010			
				OE Sensor: Nissan - 40700-JA01B			
				EZ-Sensor.....	33000 ^A	11.5	1.3
					33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Sensor.....	28204	71	8
				Service Pack.....	20014	71	8
				2011-2012			
				OE Sensor: Nissan - 40700-1AA0D, 40700-JA01B			
				EZ-Sensor.....	33000 ^A	11.5	1.3
					33500 ^{A, DB}	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
				Sensor.....	28204	49	5.5
				Service Pack.....	20014	71	8
				2014-2017			
				Service Pack.....	20050V 20051		

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 K-Use until depleted, replaced by 20009
R-Interchanges with 20005, 20010 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Nissan (cont'd)				Nissan (cont'd)			
Versa Note				Xterra (cont'd)			
2014-2017				2012-2015			
Service Pack.	20050V 20051			OE Sensor: Nissan - 40700-1AA0D			
				EZ-Sensor.	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
				Sensor.	28204	49	5.5
				Service Pack.	20014	71	8
				2016			
				OE Sensor: Nissan - 40700-JA01B			
				Sensor.	28204	49	5.5
				Service Pack.	20014	71	8
Xterra				Oldsmobile			
2003-2004				Alero			
OE Sensor: Nissan - 40700-CD001				1999-2000			
EZ-Sensor.	33000 A	11.5	1.3	Sensor.	INDIRECT D		
	33500 A, DB	11.5	1.3	Aurora			
	33700	11.5	1.3	2001-2003			
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Sensor.	INDIRECT D		
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Plymouth			
Sensor.	20064	36-60	4.1-6.8	Prowler			
Service Pack.	20007 V	36-60	4.1-6.8	1997			
2005				OE Sensor: Chrysler - 4815132			
OE Sensor: Nissan - 40700-CK001				EZ-Sensor.	33500 A, DB	11.5	1.3
EZ-Sensor.	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Sensor; Exc. Submodel X.	20161	49	5.5
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Sensor; Submodel X.	20069	49	5.5
Sensor.	20161	36-60	4.1-6.8	Service Pack; Exc. Submodel X.	20007 V	49	5.5
Service Pack.	20007 V	36-60	4.1-6.8	Service Pack; Submodel X.	20005 K	49	5.5
2006					20009 R	49	5.5
OE Sensor: Nissan - 40700-CK001, 40700-CK002				2007			
EZ-Sensor.	33000 A	11.5	1.3	OE Sensor: Nissan - 40700-JA01A, 40700-JA01B			
	33500 A, DB	11.5	1.3	EZ-Sensor.	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
Sensor; Exc. Submodel X.	20161	49	5.5	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
Sensor; Submodel X.	20069	49	5.5	Sensor; OEM Part No. 40700JA01A.	28167	49	5.5
Service Pack; Exc. Submodel X.	20007 V	49	5.5	Sensor; OEM Part No. 40700JA01B.	28204	49	5.5
Service Pack; Submodel X.	20005 K	49	5.5	Service Pack.	20014	49	5.5
	20009 R	49	5.5	2008-2011			
2007				OE Sensor: Nissan - 40700-1AA0B, 40700-JA01B			
OE Sensor: Nissan - 40700-JA01A, 40700-JA01B				EZ-Sensor.	33000 A	11.5	1.3
EZ-Sensor.	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Sensor.	28204	49	5.5
Sensor; OEM Part No. 40700JA01A.	28167	49	5.5	Service Pack.	20014	49	5.5
Sensor; OEM Part No. 40700JA01B.	28204	49	5.5	2008-2011			
Service Pack.	20014	49	5.5	OE Sensor: Nissan - 40700-1AA0B, 40700-JA01B			
2008-2011				EZ-Sensor.	33000 A	11.5	1.3
OE Sensor: Nissan - 40700-1AA0B, 40700-JA01B					33500 A, DB	11.5	1.3
EZ-Sensor.	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.	34000	62	7	Sensor.	28004	35	4
EZ-Sensor Service Pack; Rubber Valve.	20018 C, T	11.5	1.3	Service Pack; W/Black Sensor Body.	20012	35	4
Sensor.	28204	49	5.5	Service Pack; W/Red Sensor Body.	20003 F	35	4
Service Pack.	20014	49	5.5		20007 V	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
 F-Use until depleted, replaced by 20007 F-Supercedes the 20066 K-Use until depleted, replaced by 20009 R-Interchanges with 20005, 20010
 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Pontiac				Pontiac (cont'd)			
Aztek				Grand Prix (cont'd)			
2003-2005				2008			
Sensor.....	INDIRECT ^D			OE Sensor: General Motors - 15921013, 15922396			
Bonneville				EZ-Sensor.....	33000 ^A	11.5	1.3
2000-2005					33500 ^{A, DB}	11.5	1.3
Sensor.....	INDIRECT ^D				33700	11.5	1.3
G Series				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2008				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
OE Sensor: General Motors - 15921013, 15922396				Sensor: Clamp-In Style Only; W/Aluminium Valve Stem.....	20158	62	7
EZ-Sensor.....	33000 ^A	11.5	1.3	Sensor: Snap-In Style Only; W/Rubber Valve Stem.....	20153	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	Service Pack; Clamp-In Style Only; W/Aluminium Valve Stem.....	20004 ^P	62	7
	33700	11.5	1.3	Service Pack; Snap-In Style Only; W/Rubber Valve Stem.....	20008 ^{C, N}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Montana			
Sensor.....	20153	62	7	2008			
	20158	62	7	OE Sensor: General Motors - 15268606			
Service Pack.....	20008 ^{C, N}	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	20018 ^{C, T}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
Service Pack; W/Schrader Sensor.....	20004 ^P	62	7		33700	11.5	1.3
Service Pack; W/Siemens Sensor.....	20030	80	9	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2009-2010				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
OE Sensor: General Motors - 15922396, 25920615				Sensor.....	20158	62	7
EZ-Sensor.....	33000 ^A	11.5	1.3	Service Pack; W/Schrader Sensor.....	20004 ^P	62	7
	33500 ^{A, DB}	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	80	9
	33700	11.5	1.3	2009			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: General Motors - 15122618			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Sensor.....	20131	62	7
Sensor.....	20153	11.5	1.3	Service Pack.....	20006	62	7
Service Pack.....	20008 ^{C, N}	11.5	1.3	Solstice			
	20018 ^{C, T}	11.5	1.3	2008-2009			
Grand Am				OE Sensor: General Motors - 15921013			
1999-2002				EZ-Sensor.....	33000 ^A	11.5	1.3
Sensor.....	INDIRECT ^D				33500 ^{A, DB}	11.5	1.3
Grand Prix					33700	11.5	1.3
2004-2006				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	INDIRECT ^D			EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
2007				Sensor.....	20158	62	7
OE Sensor: General Motors - 10394110				Service Pack; W/Schrader Sensor.....	20004 ^P	62	7
EZ-Sensor.....	33000 ^A	11.5	1.3	Service Pack; W/Siemens Sensor.....	20030	80	9
	33500 ^{A, DB}	11.5	1.3	2010			
	33700	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20158	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Service Pack; W/Schrader Sensor.....	20004 ^P	62	7				
Service Pack; W/Siemens Sensor.....	20030	80	9				

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
N-Use until depleted, replaced by 20018 P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Pontiac (cont'd)				Porsche (cont'd)			
Torrent				911			
2007-2009				2005-2006			
OE Sensor: General Motors - 10394110, 15921013				OE Sensor: Porsche - 99760602120			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33200 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	20158	62	7	Sensor; Includes Transmitter Only	28087	31-40	3.5-4.5
Service Pack; W/Schrader Sensor	20004 P	62	7	Service Pack; Does Not Include Valve	20023	31-40	3.5-4.5
Service Pack; W/Siemens Sensor	20030	80	9	Service Pack; W/43mm Silver Insert	20037	35	4
				Service Pack; W/48mm Green Insert	20038	35	4
				Service Pack; W/49mm Black Insert	20039	35	4
				Service Pack; W/51mm Orange Insert	20040	35	4
Vibe				2007-2009			
2005-2007				OE Sensor: Porsche - 997 606 021 00, 99760602120			
Sensor	INDIRECT D			EZ-Sensor	33200 A	11.5	1.3
2008-2010					33500 A, DB	11.5	1.3
OE Sensor: General Motors - 88974915					33700	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor; Includes Transmitter Only	20077	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor; Includes Transmitter Only	28087	31-40	3.5-4.5
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; Does Not Include Valve	20023	31-40	3.5-4.5
Sensor	28360	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack	20032	35	4	Service Pack; W/48mm Green Insert	20038	35	4
				Service Pack; W/49mm Black Insert	20039	35	4
				Service Pack; W/51mm Orange Insert	20040	35	4
Wave				2010			
2008				OE Sensor: Porsche - 958 361 661 00, 99760602120			
OE Sensor: General Motors - 15922396				EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor; Excluding GT3	33200 A	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor; Includes Transmitter Only	20103	35	4
Sensor	20153	11.5	1.3		28087	31-40	3.5-4.5
Service Pack	20008 C, N	11.5	1.3	Service Pack; Does Not Include Valve	20023	31-40	3.5-4.5
	20018 C, T	11.5	1.3	Service Pack; W/43mm Silver Insert	20037	35	4
				Service Pack; W/48mm Green Insert	20038	35	4
2009				Service Pack; W/49mm Black Insert	20039	35	4
EZ-Sensor	33500 A, DB	11.5	1.3	Service Pack; W/51mm Orange Insert	20040	35	4
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	2011			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	OE Sensor: Porsche - 95536105300			
				EZ-Sensor	33200 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor; Includes Transmitter Only	20077	35	4
				Service Pack; Does Not Include Valve	20023	35	4
					20023	31-40	3.5-4.5
				Service Pack; W/43mm Silver Insert	20037	35	4
				Service Pack; W/48mm Green Insert	20038	35	4
				Service Pack; W/49mm Black Insert	20039	35	4
				Service Pack; W/51mm Orange Insert	20040	35	4
Porsche				718 Boxster			
2017-2018				2017-2018			
EZ-Sensor				EZ-Sensor			
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000				EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000			
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
 N-Use until depleted, replaced by 20018 P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Porsche (cont'd)				Porsche (cont'd)			
911 (cont'd)				918 Spyder			
2012				2015-2016			
OE Sensor: Porsche - 99760602120; Volkswagen - 7PP907275F				OE Sensor: Porsche - 95836166100			
EZ-Sensor.....	33200 ^A	11.5	1.3	Sensor.....	20103	35	4
	33500 ^{A, DB}	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
	33700	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
Sensor.....	20103	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
Sensor; Includes Transmitter Only.....	28087	31-40	3.5-4.5	Boxster			
Service Pack.....	20009 ^R	88	10	2005-2007			
Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5	OE Sensor: Porsche - 99760602120			
Service Pack; W/43mm Silver Insert.....	20037	35	4	EZ-Sensor.....	33200 ^A	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	35	4		33500 ^{A, DB}	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	35	4		33700	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2013-2014				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
OE Sensor: Volkswagen - 7PP907275F				Sensor; Includes Transmitter Only.....	28087	31-40	3.5-4.5
EZ-Sensor.....	33200 ^A	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/43mm Silver Insert.....	20037	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	35	4
Sensor.....	20103	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	2008-2010			
Service Pack; W/48mm Green Insert.....	20038	35	4	OE Sensor: Porsche - 99760602120			
Service Pack; W/49mm Black Insert.....	20039	35	4	EZ-Sensor.....	33200 ^A	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2015				EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
OE Sensor: Volkswagen - 7PP907275F				Sensor; Includes Transmitter Only.....	28087	31-40	3.5-4.5
Sensor.....	20103	35	4	Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	2011			
2016				OE Sensor: Porsche - 95536105300			
OE Sensor: Volkswagen - 7PP907275F				EZ-Sensor.....	33200 ^A	11.5	1.3
EZ-Sensor.....	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.....	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; Includes Transmitter Only.....	20077	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	35	4
Sensor.....	20103	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	2012-2013			
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack; Does Not Include Valve.....			
2017-2018				Service Pack; W/43mm Silver Insert.....			
EZ-Sensor.....				Service Pack; W/48mm Green Insert.....			
EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.....				Service Pack; W/49mm Black Insert.....			
with Schrader Aluminium valve kit 34000.....				Service Pack; W/51mm Orange Insert.....			
EZ-Sensor Service Pack; Aluminium Valve.....							
EZ-Sensor Service Pack; Rubber Valve.....							

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 R-Interchanges with 20005, 20010
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Porsche (cont'd)				Porsche (cont'd)			
Boxster (cont'd)				Cayenne (cont'd)			
2014-2016				2011-2013			
OE Sensor: Porsche - 95836166100				OE Sensor: Porsche - 95836166100			
Sensor	20103	35	4	Sensor; Includes Transmitter Only	20103	35	4
Service Pack; Does Not Include Valve	20023	35	4	Service Pack; Does Not Include Valve	20023	31-40	3.5-4.5
Service Pack; W/43mm Silver Insert	20037	35	4	Service Pack; W/43mm Silver Insert	20037	35	4
Service Pack; W/48mm Green Insert	20038	35	4	Service Pack; W/48mm Green Insert	20038	35	4
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; W/49mm Black Insert	20039	35	4
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/51mm Orange Insert	20040	35	4
Carrera GT				2014-2016			
2004-2005				OE Sensor: Porsche - 95836166100			
OE Sensor: Porsche - 99760602120				Sensor			
EZ-Sensor	33200 A	11.5	1.3	Service Pack; Does Not Include Valve	20023	31-40	3.5-4.5
	33500 A, DB	11.5	1.3	Service Pack; W/43mm Silver Insert	20037	35	4
	33700	11.5	1.3	Service Pack; W/48mm Green Insert	20038	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/49mm Black Insert	20039	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; W/51mm Orange Insert	20040	35	4
Sensor; Includes Transmitter Only	28087	31-40	3.5-4.5	2017			
Service Pack; Does Not Include Valve	20023	31-40	3.5-4.5	OE Sensor: Porsche - 95836166100			
Service Pack; W/43mm Silver Insert	20037	35	4	EZ-Sensor			
Service Pack; W/48mm Green Insert	20038	35	4	EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000			
Service Pack; W/49mm Black Insert	20039	35	4	EZ-Sensor Service Pack; Aluminium Valve			
Service Pack; W/51mm Orange Insert	20040	35	4	EZ-Sensor Service Pack; Rubber Valve			
2006-2011				Sensor			
EZ-Sensor				Service Pack; Does Not Include Valve			
	33200 A	11.5	1.3	Service Pack; W/43mm Silver Insert			
	33500 A, DB	11.5	1.3	Service Pack; W/48mm Green Insert			
	33700	11.5	1.3	Service Pack; W/49mm Black Insert			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; W/51mm Orange Insert			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2018			
Cayenne				EZ-Sensor			
2002				EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000			
EZ-Sensor				EZ-Sensor Service Pack; Aluminium Valve			
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve			
	33700	11.5	1.3	2005-2007			
2003-2006				OE Sensor: Porsche - 99760602101			
OE Sensor: Porsche - 99760602120				EZ-Sensor			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve			
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve			
	33700	11.5	1.3	Sensor; Includes Transmitter Only			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; Does Not Include Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; W/43mm Silver Insert			
Sensor; Includes Transmitter Only	28087	31-40	3.5-4.5	Service Pack; W/48mm Green Insert			
Service Pack; Does Not Include Valve	20023	31-40	3.5-4.5	Service Pack; W/49mm Black Insert			
Service Pack; W/43mm Silver Insert	20037	35	4	Service Pack; W/51mm Orange Insert			
Service Pack; W/48mm Green Insert	20038	35	4	2008-2010			
Service Pack; W/49mm Black Insert	20039	35	4	Service Pack; Does Not Include Valve			
Service Pack; W/51mm Orange Insert	20040	35	4	Service Pack; W/43mm Silver Insert			
2008-2010				Service Pack; W/48mm Green Insert			
Service Pack; Does Not Include Valve				Service Pack; W/49mm Black Insert			
Service Pack; W/43mm Silver Insert				Service Pack; W/51mm Orange Insert			
Service Pack; W/48mm Green Insert							
Service Pack; W/49mm Black Insert							
Service Pack; W/51mm Orange Insert							

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Porsche (cont'd)				Porsche (cont'd)			
Cayman (cont'd)				Macan (cont'd)			
2008				2016-2017			
OE Sensor: Porsche - 99760602101				OE Sensor: Porsche - 95836166100			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only.....	20077	31-40	3.5-4.5	Sensor.....	20103	35	4
Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5	Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
2009-2010				2018			
OE Sensor: Porsche - 99760602120				EZ-Sensor.....	33500 A, DB	11.5	1.3
Sensor; Includes Transmitter Only.....	28087	31-40	3.5-4.5		33700	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; W/43mm Silver Insert.....	20037	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	35	4				
Service Pack; W/49mm Black Insert.....	20039	35	4	Panamera			
Service Pack; W/51mm Orange Insert.....	20040	35	4	2010			
2011				OE Sensor: Porsche - 99760602120			
OE Sensor: Porsche - 95536105300, 99760602120				Sensor; Includes Transmitter Only.....	28087	31-40	3.5-4.5
Sensor; Includes Transmitter Only.....	20077	35	4	Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
	28087	31-40	3.5-4.5	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	2011			
Service Pack; W/51mm Orange Insert.....	20040	35	4	OE Sensor: Porsche - 99760602120			
2012-2016				Sensor; Includes Transmitter Only.....			
OE Sensor: Porsche - 95836166100					28087	31-40	3.5-4.5
Sensor.....	20103			Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	2014			
Service Pack; W/51mm Orange Insert.....	20040	35	4	OE Sensor: Porsche - 95836166100			
2017-2018				EZ-Sensor.....			
EZ-Sensor.....	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor; When installing EZ-Sensor the rubber valve MUST be removed and replaced with Schrader Aluminium valve kit 34000.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Macan				Sensor.....			
2014-2015				Service Pack; Does Not Include Valve.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
	33700	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/49mm Black Insert.....	20039	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	35	4
				2015-2016			
				OE Sensor: Porsche - 95836166100			
				EZ-Sensor.....			
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor.....	20103	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Porsche (cont'd)				Ram (cont'd)			
Panamera (cont'd)				ProMaster (cont'd)			
2017-2018				2016-2018			
EZ-Sensor	33500 A, DB	11.5	1.3	OE Sensor: Chrysler - 5154876AA			
	33700	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Ram				EZ-Sensor Service Pack; exc Hybrid; Rubber Valve			
4500				Valve			
2012				Sensor			
OE Sensor: Chrysler - 56029398AB				Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor	33200 A	11.5	1.3	Promaster City			
	33500 A, DB	11.5	1.3	2015-2016			
	33700	11.5	1.3	OE Sensor: Chrysler - 5154876AA			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor	33200 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor	20398	11.5	1.3		33700	11.5	1.3
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
5500				EZ-Sensor Service Pack; exc Hybrid; Rubber Valve			
2012				Valve			
OE Sensor: Chrysler - 56029398AB				2017-2018			
Sensor	20398	11.5	1.3	OE Sensor: Chrysler - 5154876AA			
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
C/V							
2012							
OE Sensor: Chrysler - 68241067AB					33700	11.5	1.3
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; exc Hybrid; Rubber Valve	20018 C, T	11.5	1.3
	33700	11.5	1.3	Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Sensor	20398	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor; Rubber Valve	20398	11.5	1.3	Ram Series			
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2011			
2013-2015				OE Sensor: Chrysler - 56029398AB			
OE Sensor: Chrysler - 68241067AB				EZ-Sensor	33200 A	11.5	1.3
EZ-Sensor	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor; W/Rubber Stem Snap-in Sensor	20398	11.5	1.3
Sensor	20398	11.5	1.3	Service Pack; W/Rubber Stem Snap-in Sensor	20018 C, T	11.5	1.3
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	2012-2013			
ProMaster				OE Sensor: Chrysler - 56029398AB			
2014-2015				EZ-Sensor			
OE Sensor: Chrysler - 5154876AA					33200 A	11.5	1.3
EZ-Sensor	33200 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; exc Hybrid; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20398	11.5	1.3
Valve	20018 C, T	11.5	1.3	Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	20398	11.5	1.3				
Service Pack; Rubber Valve	20018 C, T	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Ram (cont'd)				Rolls Royce (cont'd)			
Ram Series (cont'd)				Phantom			
2014-2015				2007-2011			
OE Sensor: Chrysler - 68157568AA, 68239720AA, 68249197AA				Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
EZ-Sensor.....	33500 A, DB	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
	33700	11.5	1.3	Service Pack; W/48mm Green Insert.....	20038	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; W/49mm Black Insert.....	20039	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/51mm Orange Insert.....	20040	35	4
Sensor.....	28984	35	4	2012-2015			
Service Pack.....	20635	11.5	1.3	OE Sensor: BMW - 36 10 6 790 054			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
2016-2017					33700	11.5	1.3
OE Sensor: Chrysler - 68249197AA				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	Sensor; Includes Transmitter Only.....	28081	40	4.5
	33700	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; W/43mm Silver Insert.....	20037	35	4
Sensor.....	28984	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack.....	20635	11.5	1.3	Service Pack; W/49mm Black Insert.....	20039	35	4
				Service Pack; W/51mm Orange Insert.....	20040	35	4
Rolls Royce				2016-2017			
Dawn				OE Sensor: BMW - 36 10 6 790 054			
2017				EZ-Sensor.....			
OE Sensor: BMW - 36106798872					33500 A, DB	11.5	1.3
EZ-Sensor.....	33700	11.5	1.3		33700	11.5	1.3
	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28126			Sensor; Includes Transmitter Only.....	28081	40	4.5
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
				Service Pack; W/43mm Silver Insert.....	20037	35	4
				Service Pack; W/48mm Green Insert.....	20038	35	4
				Service Pack; W/49mm Black Insert.....	20039	35	4
				Service Pack; W/51mm Orange Insert.....	20040	35	4
Ghost				Silver Dawn			
2011-2016				2016			
OE Sensor: BMW - 36 10 6 790 054				OE Sensor: BMW - 36 10 6 790 054			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; Includes Transmitter Only.....	28081	40	4.5	Sensor; Includes Transmitter Only.....	28081	40	4.5
Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5	Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack; W/51mm Orange Insert.....	20040	35	4
2017				Wraith			
OE Sensor: BMW - 36 10 6 790 054				2014-2015			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: BMW - 36 10 6 790 054			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; Includes Transmitter Only.....	28081	40	4.5	Sensor; Includes Transmitter Only.....	28081	40	4.5
Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5	Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5
Service Pack; W/43mm Silver Insert.....	20037	35	4	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack; W/43mm Silver Insert.....	20037	35	4
Service Pack; W/49mm Black Insert.....	20039	35	4	Service Pack; W/48mm Green Insert.....	20038	35	4
Service Pack; W/51mm Orange Insert.....	20040	35	4	Service Pack; W/49mm Black Insert.....	20039	35	4
				Service Pack; W/51mm Orange Insert.....	20040	35	4

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Rolls Royce (cont'd)				Saab (cont'd)			
Wraith (cont'd)				9-5			
2016-2017				2003-2007			
OE Sensor: BMW - 36 10 6 790 054				OE Sensor: Saab - 13172567, 24437708			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only.....	28081	40	4.5	Sensor.....	28078	62	7
Service Pack; Does Not Include Valve.....	20023	31-40	3.5-4.5	Service Pack.....	20009 R	62	7
Service Pack; W/43mm Silver Insert.....	20037	35	4	2008-2011			
Service Pack; W/48mm Green Insert.....	20038	35	4	OE Sensor: Saab - 13227143			
Service Pack; W/49mm Black Insert.....	20039	35	4	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	35	4		33700	11.5	1.3
Saab				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
9-3				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2003-2007				Sensor.....	20159	88	10
OE Sensor: Saab - 13172567, 24437708				Service Pack.....	20009 R	88	10
EZ-Sensor.....	33500 A, DB	11.5	1.3	2012			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28078	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20009 R	62	7	9-7x			
2008-2011				2005-2009			
OE Sensor: Saab - 13227143				OE Sensor: General Motors - 25774006			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20159	88	10	Sensor.....	20116	62	7
Service Pack.....	20009 R	88	10	Service Pack.....	20004 P	62	7
2012				Saturn			
EZ-Sensor.....	33500 A, DB	11.5	1.3	Astra			
	33700	11.5	1.3	2008-2009			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: General Motors - 13172567; Saab - 13172567			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
9-3X					33700	11.5	1.3
2010-2011				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: Saab - 13227143				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20159	88	10	Sensor.....	28078	80	9
Service Pack.....	20009 R	88	10	Service Pack.....	20009 R	80	9
9-4X				2010			
2011				EZ-Sensor.....	33500 A, DB	11.5	1.3
OE Sensor: General Motors - 20922900					33700	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Saturn			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Astra			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2008-2009			
Sensor.....	28206	11.5	1.3	OE Sensor: General Motors - 13172567; Saab - 13172567			
Service Pack.....	20008 C, N	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	20018 C, T	11.5	1.3		33700	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
P-Interchanges with 20002 R-Interchanges with 20005, 20010 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Saturn (cont'd)				Saturn (cont'd)			
Aura				Sky			
2007				2008-2010			
OE Sensor: General Motors - 10394110				OE Sensor: General Motors - 15921013			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20158	62	7	Sensor.....	20158	62	7
Service Pack; W/Schrader Sensor.....	20004 P	62	7	Service Pack; W/Schrader Sensor.....	20004 P	62	7
Service Pack; W/Siemens Sensor.....	20030	62	7	Service Pack; W/Siemens Sensor.....	20030	80	9
2008-2009				Vue			
OE Sensor: General Motors - 15922396, 25920615				2007-2010			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: General Motors - 15922396, 25920615			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	20153	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	Sensor.....	20153	11.5	1.3
	20018 C, T	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
2010				Scion			
EZ-Sensor.....	33500 A, DB	11.5	1.3	FR-S			
	33700	11.5	1.3	2013			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Toyota - 4260706020			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor.....	28360	35	4
				Service Pack.....	20032	35	4
				2014-2016			
				OE Sensor: Toyota - 4260706020, 42607CA000, SU00300754			
				EZ-Sensor.....	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor.....	28360	35	4
				Service Pack.....	20032	35	4
Outlook				iM			
2007-2008				2015-2016			
OE Sensor: General Motors - 10394110, 15921013				OE Sensor: Toyota - 4260706020			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28360	35	4
Sensor.....	20158	62	7	Service Pack.....	20032	35	4
Service Pack; W/Schrader Sensor.....	20004 P	62	7				
Service Pack; W/Siemens Sensor.....	20030	62	7				
2009-2010							
OE Sensor: General Motors - 25920615							
EZ-Sensor.....	33000 A	11.5	1.3				
	33500 A, DB	11.5	1.3				
	33700	11.5	1.3				
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Sensor.....	20153	11.5	1.3				
Service Pack.....	20008 C, N	11.5	1.3				
	20018 C, T	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 N-Use until depleted, replaced by 20018
P-Interchanges with 20002 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Scion (cont'd)				Scion (cont'd)			
iQ				xB (cont'd)			
2012-2014				2015-2016			
OE Sensor: Toyota - 4260733011				OE Sensor: Toyota - 4260733011			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	28365	35	4
Sensor	28365	35	4	Service Pack	20032	35	4
Service Pack	20032	35	4				
2015				xD			
OE Sensor: Toyota - 4260733011				2008-2014			
EZ-Sensor	33500 A, DB	11.5	1.3	OE Sensor: Toyota - 4260733011			
	33700	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor	28365	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Service Pack	20032	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	28365	35	4
				Service Pack	20032	35	4
tC				2015			
2006				EZ-Sensor	33500 A, DB	11.5	1.3
OE Sensor: Toyota - 4260733011					33700	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor; May & Newer	28365	35	4
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Service Pack; May & Newer	20032	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3				
Sensor; May & Newer	28365	35	4	2007-2014			
Service Pack; May & Newer	20032	35	4	OE Sensor: Toyota - 4260733011			
				EZ-Sensor	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	28365	35	4
				Service Pack	20032	35	4
				2015-2016			
				OE Sensor: Toyota - 4260733011			
				EZ-Sensor	33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	28365	35	4
				Service Pack	20032	35	4
				xB			
				2008-2014			
				OE Sensor: Toyota - 4260733011			
				EZ-Sensor	33000 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	28365	35	4
				Service Pack	20032	35	4
				Smart			
				Fortwo			
				2008-2012			
				OE Sensor: Mercedes-Benz - 0025409017, 0045421518			
				EZ-Sensor	33200 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	28214	58	6.5
				Service Pack; Does Not Include Stem	20013 S	53	6
					20016 M	53	6
				Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	53	6
				2013			
				OE Sensor: Mercedes-Benz - 0009057200			
				EZ-Sensor	33200 A	11.5	1.3
					33500 A, DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
				Sensor	28214	58	6.5
				Service Pack; Fits Schrader Sensor; Includes Stem Only	20020	58	6.5
				Service Pack; W/O Valve	20013 S	58	6.5
					20016 M	58	6.5

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 M-Use until depleted, replaced by 20013
S-Interchanges with 20016 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Smart (cont'd)				Subaru (cont'd)			
Fortwo (cont'd)				BRZ			
2014				2013-2014			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Subaru - 4260706020			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20213			Sensor.....	28360	35	4
Service Pack.....	20049 U	80	9	Service Pack.....	20032	35	4
2015				2015-2017			
OE Sensor: Mercedes-Benz - A0009050030				OE Sensor: Subaru - 4260706020			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28360	35	4
Sensor.....	20213	80	9	Service Pack.....	20032	35	4
Service Pack.....	20049 U	80	9				
2016-2017				Crosstrek			
OE Sensor: Mercedes-Benz - A0009057200				2016			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2017			
Sensor.....	28214	80	9	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack.....	20049 U	80	9		33700	11.5	1.3
2018				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	20018 C, T		
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20602		
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2018			
				Sensor.....	20018 C, T		
Subaru					20602		
B9 Tribeca				Forester			
2006-2007				2008-2015			
OE Sensor: Subaru - 28103AG00A				OE Sensor: Subaru - 28103AG01B, 28103AG01C, 28103SA001, 28103SG000, 28103SG010			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20081	66	7.5	Sensor.....	28203	11.5	1.3
Service Pack.....	20007 V	66	7.5	Service Pack.....	20008 C, N	11.5	1.3
	20011 G	66	7.5		20018 C, T	11.5	1.3
2008-2011				2016			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Subaru - 28103SA002			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor.....	28203	11.5	1.3
				Service Pack.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 G-Use until depleted, replaced by 20007
 G-Supercedes the 28154 N-Use until depleted, replaced by 20018 T-Interchanges with 20008 U-Interchanges with 20047 V-Interchanges with 20003, 20011,
 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Subaru (cont'd)				Subaru (cont'd)			
Forester (cont'd)				Legacy (cont'd)			
2017-2018				2009-2015			
Sensor.....	20018 C,T 20602			OE Sensor: Subaru - 28103AG01B, 28103AG01C, 28103AJ00A			
				EZ-Sensor.....	33000 A	11.5	1.3
					33500 A,DB	11.5	1.3
					33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
				Sensor.....	28203	11.5	1.3
				Service Pack.....	20008 C,N	11.5	1.3
					20018 C,T	11.5	1.3
Impreza				2016			
2008-2015				OE Sensor: Subaru - 28103AJ00A			
OE Sensor: Subaru - 28103AG01A, 28103AG01B, 28103AG01C, 28103SA002, 28103SG000				EZ-Sensor.....			
EZ-Sensor.....	33000 A	11.5	1.3		33500 A,DB	11.5	1.3
	33500 A,DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	Sensor.....	28203	11.5	1.3
Sensor.....	28203	11.5	1.3	Service Pack.....	20008 C,N	11.5	1.3
Service Pack.....	20008 C,N	11.5	1.3		20018 C,T	11.5	1.3
	20018 C,T	11.5	1.3	2017-2018			
2016				Outback			
OE Sensor: Subaru - 28103SA002				2004-2007			
EZ-Sensor.....	33500 A,DB	11.5	1.3	OE Sensor: Subaru - 28103AG00A			
	33700	11.5	1.3	EZ-Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3		33500 A,DB	11.5	1.3
Sensor.....	28203	11.5	1.3		33700	11.5	1.3
Service Pack.....	20008 C,N	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
2017-2018				Sensor.....			
EZ-Sensor.....	33500 A,DB	11.5	1.3		20081	66	7.5
	33700	11.5	1.3	Service Pack.....	20007 V	66	7.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20011 G	66	7.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	2008-2015			
Sensor.....	20018 C,T	11.5	1.3	OE Sensor: Subaru - 28103AG01A, 28103AG01B, 28103AG01C, 28103AJ00A			
Service Pack.....	20602			EZ-Sensor.....			
					33000 A	11.5	1.3
Legacy					33500 A,DB	11.5	1.3
2004-2007					33700	11.5	1.3
OE Sensor: Subaru - 28103AG00A				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
	33500 A,DB	11.5	1.3	Sensor.....	20081	66	7.5
	33700	11.5	1.3	Service Pack.....	20007 V	66	7.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20011 G	66	7.5
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	2008			
Sensor.....	20081	66	7.5	OE Sensor: Subaru - 28103AG00A, 28103AG01A			
Service Pack.....	20007 V	66	7.5	EZ-Sensor.....			
	20011 G	66	7.5		33000 A	11.5	1.3
2008					33500 A,DB	11.5	1.3
OE Sensor: Subaru - 28103AG00A, 28103AG01A					33700	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33500 A,DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
	33700	11.5	1.3	Sensor; W/16" Or 17" Wheels.....	20081	66	7.5
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; W/18" Wheels.....	28203	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	Service Pack; W/16" Or 17" Wheels.....	20007 V	66	7.5
Sensor; W/16" Or 17" Wheels.....	20081	66	7.5		20011 G	66	7.5
Sensor; W/18" Wheels.....	28203	11.5	1.3	Service Pack; W/18" Wheels.....	20008 C,N	11.5	1.3
Service Pack; W/16" Or 17" Wheels.....	20007 V	66	7.5		20018 C,T	11.5	1.3
	20011 G	66	7.5	2016-2017			
Service Pack; W/18" Wheels.....	20008 C,N	11.5	1.3	OE Sensor: Subaru - 28103AJ00A			
	20018 C,T	11.5	1.3	EZ-Sensor.....			
2017-2018					33500 A,DB	11.5	1.3
EZ-Sensor.....	33500 A,DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	Sensor.....	28203	11.5	1.3
Sensor.....	28203	11.5	1.3	Service Pack.....	20008 C,N	11.5	1.3
Service Pack.....	20008 C,N	11.5	1.3		20018 C,T	11.5	1.3
	20018 C,T	11.5	1.3	2017			
				Sensor.....			
					20602		

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 G-Use until depleted, replaced by 20007
G-Supersedes the 28154 N-Use until depleted, replaced by 20018 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Subaru (cont'd)				Subaru (cont'd)			
Outback (cont'd)				Tribeca (cont'd)			
2018				2012-2014			
Sensor.....	20602			OE Sensor: Subaru - 28103AG01C			
Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
Tribeca					33500 A, DB	11.5	1.3
2008					33700	11.5	1.3
OE Sensor: Subaru - 28103AG00A, 28103AG01A				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor.....	28203	11.5	1.3
	33700	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	WRX			
Sensor; W/Metal Stem Clamp-in Sensor.....	20081	66	7.5	2013-2015			
Sensor; W/Rubber Stem Snap-in Sensor.....	28203	11.5	1.3	OE Sensor: Subaru - 28103SA002, 28103SG000			
Service Pack.....	20008 C, N	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Service Pack; W/Metal Stem Clamp-in Sensor....	20007 V	66	7.5		33700	11.5	1.3
	20011 G	66	7.5	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2009				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
OE Sensor: Subaru - 28103AG00A, 28103AG01B				Sensor.....	28203	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
	33500 A, DB	11.5	1.3		20018 C, T	11.5	1.3
	33700	11.5	1.3	2016			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Subaru - 28103AJ00A			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
Sensor; W/Metal Stem Clamp-in Sensor.....	20081	66	7.5		33700	11.5	1.3
Sensor; W/Rubber Stem Snap-in Sensor.....	28203	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Rubber Valve.....	20008 C, N	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	20018 C, T	11.5	1.3	Sensor.....	28203	11.5	1.3
Service Pack; W/Metal Stem Clamp-in Sensor....	20007 V	66	7.5	Service Pack.....	20008 C, N	11.5	1.3
	20011 G	66	7.5		20018 C, T	11.5	1.3
2010				2017-2018			
OE Sensor: Subaru - 28103AG00A, 28103AG01C				Sensor.....	20602		
EZ-Sensor.....	33000 A	11.5	1.3	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	XV Crosstrek			
	33700	11.5	1.3	2013-2015			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Subaru - 28103AG01C, 28103SG000			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
Sensor; W/Metal Stem Clamp-in Sensor.....	20081	66	7.5		33500 A, DB	11.5	1.3
Sensor; W/Rubber Stem Snap-in Sensor.....	28203	11.5	1.3		33700	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/Metal Stem Clamp-in Sensor....	20007 V	66	7.5	Sensor.....	28203	11.5	1.3
	20011 G	66	7.5	Service Pack.....	20008 C, N	11.5	1.3
2011					20018 C, T	11.5	1.3
OE Sensor: Subaru - 28103AG00A, 28103AG01C				2016			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Subaru - 28103AJ00A			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; W/Metal Stem Clamp-in Sensor.....	20081	66	7.5	Sensor.....	28203	11.5	1.3
Sensor; W/Rubber Stem Snap-in Sensor.....	28203	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
Service Pack; Rubber Valve.....	20008 C, N	11.5	1.3		20018 C, T	11.5	1.3
	20018 C, T	11.5	1.3				
Service Pack; W/Metal Stem Clamp-in Sensor....	20007 V	66	7.5				
	20011 G	66	7.5				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 G-Use until depleted, replaced by 20007
 G-Supercedes the 28154 N-Use until depleted, replaced by 20018 T-Interchanges with 20008 V-Interchanges with 20003, 20011, 20015

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Suzuki				Suzuki (cont'd)			
Equator				Reno			
2009-2012				2007-2008			
OE Sensor: Suzuki - 4321182Z10				OE Sensor: Suzuki - 4313085Z00			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28204	49	5.5	Sensor.....	20153	11.5	1.3
Service Pack.....	20014	49	5.5	Service Pack.....	20008 C, N	11.5	1.3
					20018 C, T	11.5	1.3
2013-2014				SX4			
EZ-Sensor.....	33500 A, DB	11.5	1.3	2007-2013			
	33700	11.5	1.3	OE Sensor: Suzuki - 4313054J20, 4313054J21, 4313054J22			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....	20153	11.5	1.3		33700	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
				Sensor.....	20087	80	9
				Service Pack.....	20009 R	80	9
Forenza				SX4 Crossover			
2007-2008				2012			
OE Sensor: Suzuki - 4313085Z00				OE Sensor: Suzuki - 4313054J21			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20153	11.5	1.3	Sensor.....	20087	80	9
Service Pack.....	20008 C, N	11.5	1.3	Service Pack.....	20009 R	80	9
	20018 C, T	11.5	1.3				
				Verona			
Grand Vitara				2005-2006			
2007-2013				OE Sensor: Suzuki - 4313086Z20			
OE Sensor: Suzuki - 4313054J20, 4313054J21, 4313054J22				EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20082	80	9
Sensor.....	20087	80	9	Service Pack.....	20009 R	80	9
Service Pack.....	20009 R	80	9				
				XL-7			
Kizashi				2005-2006			
2010-2012				OE Sensor: Suzuki - 4313054J20			
OE Sensor: Original Equipment Manufacturer - 43130-57L00				EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20087	80	9
Sensor.....	28308 F	11.5	1.3	Service Pack.....	20009 R	80	9
Service Pack; Fits Schrader Alum stem sensor.							
Does not include stem.....	20013 S	58	6.5				
Service Pack; Fits Schrader Sensor; Includes							
Stem Only.....	20020	58	6.5				
Service Pack; W/Siemens Sensor.....	20030	71	8				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 F-Use until depleted, replaced by 20007
 F-Supercedes the 20066 N-Use until depleted, replaced by 20018 R-Interchanges with 20005, 20010 S-Interchanges with 20016 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Suzuki (cont'd)				Toyota (cont'd)			
XL-7 (cont'd)				4Runner (cont'd)			
2007-2009				2007			
OE Sensor: Suzuki - 4313078J10				OE Sensor: Toyota - 4260733011, 4260733021			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20158	62	7	Sensor; W/O Valve Cap.....	28370	35	4
Service Pack; W/Schrader Sensor.....	20004 P	62	7	Sensor; W/Valve Cap.....	28365	35	4
Service Pack; W/Siemens Sensor.....	20030	62	7	Service Pack.....	20032	35	4
2010-2011				2008			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Toyota - 4260733011, 4260733021			
	33700	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Tesla				EZ-Sensor Service Pack; Aluminium Valve.....			
S				EZ-Sensor Service Pack; Rubber Valve.....			
2014-2015				Sensor; W/O Valve Cap; OEM Part No.			
EZ-Sensor.....	33500 A, DB	11.5	1.3	4260733021.....	28370	35	4
	33700	11.5	1.3	Sensor; W/Valve Cap; OEM Part No. 4260733011.	28365	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20032	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2009			
X				OE Sensor: Toyota - 4260733011, 4260733021			
2016-2017				EZ-Sensor.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3		33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Toyota				EZ-Sensor Service Pack; Rubber Valve.....			
4Runner				Sensor; W/O Valve Cap.....			
2003-2005				Sensor; W/Valve Cap.....			
OE Sensor: Toyota - 4260735010				Service Pack.....			
EZ-Sensor.....	33000 A	11.5	1.3		20032	35	4
	33500 A, DB	11.5	1.3	2010-2016			
	33700	11.5	1.3	OE Sensor: Toyota - 4260733021			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33000 A	11.5	1.3
Sensor.....	28345	35	4		33500 A, DB	11.5	1.3
Service Pack.....	20031	35	4		33700	11.5	1.3
2006				EZ-Sensor Service Pack; Aluminium Valve.....			
OE Sensor: Toyota - 4260730030, 4260733011, 4260733021, 4260735010				EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor.....	33000 A	11.5	1.3		20018 C, T	11.5	1.3
	33500 A, DB	11.5	1.3	Sensor.....	28370	35	4
	33700	11.5	1.3	Service Pack.....	20032	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2017			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	OE Sensor: Toyota - 4260733021			
Sensor; OEM Part No. 4260730030.....	28335	35	4	EZ-Sensor.....			
Sensor; OEM Part No. 4260733011.....	28365	35	4		33500 A, DB	11.5	1.3
Sensor; OEM Part No. 4260733021.....	28370	35	4		33700	11.5	1.3
Sensor; OEM Part No. 4260735010.....	28345	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack; Jun. & Newer.....	20032	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; May & Older.....	20031	35	4	Sensor.....	28370	35	4
				Service Pack.....			
				20032			
				35			
				4			
				2018			
				EZ-Sensor.....			
				33500 A, DB			
				11.5			
				1.3			
				33700			
				11.5			
				1.3			
				EZ-Sensor Service Pack; Aluminium Valve.....			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 C, T			
				11.5			
				1.3			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 P-Interchanges with 20002
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Toyota (cont'd)				Toyota (cont'd)			
86				Camry (cont'd)			
2017				2012-2014			
EZ-Sensor	33500 A, DB	11.5	1.3	OE Sensor: Toyota - 42607-06011			
	33700	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33700	11.5	1.3
Avalon				EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
2006				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
OE Sensor: Toyota - 4260706011				Sensor	28360	35	4
EZ-Sensor	33000 A	11.5	1.3	Service Pack	20032	35	4
	33500 A, DB	11.5	1.3	2015			
	33700	11.5	1.3	OE Sensor: Toyota - 42607-06020			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor; Aug. & Newer	28360	35	4		33700	11.5	1.3
Service Pack; Aug. & Newer	20032	35	4	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
2007-2014				EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
OE Sensor: Toyota - 4260706011, 4260706020				Sensor; Lo Line Sensor	28360	35	4
EZ-Sensor	33000 A	11.5	1.3	Service Pack	20032	35	4
	33500 A, DB	11.5	1.3	2016-2017			
	33700	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	28360	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack	20032	35	4	Corolla			
2015				2007			
OE Sensor: Toyota - 4260706020				OE Sensor: Toyota - 4260706011, 4260733011			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
Sensor	28360	35	4	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Service Pack	20032	35	4	Sensor; Models made in Japan; OEM Part No.			
2016				4260733011; Jun. & Newer	28365	35	4
OE Sensor: Toyota - 4260706020				Sensor; Models made in USA; OEM Part No.			
Sensor	28360	35	4	4260706011; Jun. & Newer	28360	35	4
Service Pack	20032	35	4	Service Pack; Jun. & Newer	20032	35	4
Camry				2008			
2007-2011				OE Sensor: Toyota - 4260706011, 4260733011			
OE Sensor: Toyota - 42607-06011, 42607-33011				EZ-Sensor	33000 A	11.5	1.3
EZ-Sensor	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor; Models made in Japan; OEM Part No.			
Sensor; Models made in Japan; OEM Part No.				4260733011	28365	35	4
4260733011	28365	35	4	Sensor; Models made in USA; OEM Part No.			
Sensor; Models made in USA; OEM Part No.				4260706011	28360	35	4
4260706011	28360	35	4	Service Pack	20032	35	4
Service Pack	20032	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Toyota (cont'd)				Toyota (cont'd)			
Corolla (cont'd)				FJ Cruiser			
2009-2012				2008-2014			
OE Sensor: Toyota - 4260702010, 4260706011, 4260733011, 4260733021				OE Sensor: Toyota - 4260733011			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Models made in Japan; OEM Part No. 4260733011.....	28365	35	4	Sensor.....	28365	35	4
Sensor; Models made in Japan; OEM Part No. 4260733021.....	28370	35	4	Service Pack.....	20032	35	4
Sensor; Models made in USA; W/15" Wheels.....	28365	35	4	2015			
Sensor; Models made in USA; W/16" Or 17"				OE Sensor: Toyota - 4260706011			
Wheels.....	28360	35	4	Sensor; Models made in USA; W/16" Or 17"			
Service Pack.....	20032	35	4	Wheels.....	28360	35	4
2013				Service Pack.....	20032	35	4
OE Sensor: Toyota - 4260706011, 4260733011				Highlander			
EZ-Sensor.....	33000 A	11.5	1.3	2007			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	OE Sensor: Toyota - 4260733011			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
Sensor; Models made in Japan.....	28365	35	4		33500 A, DB	11.5	1.3
Sensor; Models made in USA; W/16" Or 17"					33700	11.5	1.3
Wheels.....	28360	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20032	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2014				Sensor; May & Newer.....	28365	35	4
OE Sensor: Toyota - 4260706011				Service Pack; May & Newer.....	20032	35	4
EZ-Sensor.....	33000 A	11.5	1.3	2008-2010			
	33500 A, DB	11.5	1.3	OE Sensor: Toyota - 4260733011			
	33700	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor; Models made in USA; W/16" Or 17"				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Wheels.....	28360	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20032	35	4	Sensor.....	28365	35	4
2015-2018				Service Pack.....	20032	35	4
OE Sensor: Toyota - 4260706011				2011-2013			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Toyota - 4260706011			
	33700	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33700	11.5	1.3
Sensor; Models made in USA; W/16" Or 17"				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Wheels.....	28360	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20032	35	4	Sensor.....	28360	35	4
Corolla iM				Service Pack.....	20032	35	4
2017				2014-2017			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Toyota - 4260706011			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2018				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3	Sensor.....	28360	35	4
	33700	11.5	1.3	Service Pack.....	20032	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7				
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				
Sensor.....	28360						

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Toyota (cont'd)				Toyota (cont'd)			
Land Cruiser				Matrix			
2005				2007			
OE Sensor: Toyota - 4260733011				OE Sensor: Toyota - 4260706011, 4260733011			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; May & Newer.....	28365	35	4	Sensor; Models made in Japan; OEM Part No. 4260733011; Jun. & Newer.....	28365	35	4
Service Pack; May & Newer.....	20031	35	4	Sensor; Models made in USA; OEM Part No. 4260706011; Jun. & Newer.....	28360	35	4
2006				2008-2013			
OE Sensor: Toyota - 4260733011				OE Sensor: Toyota - 4260706011, 4260733011			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28365	35	4	Sensor; Models made in Japan; OEM Part No. 4260733011.....	28365	35	4
Service Pack; Apr. 1 & Newer.....	20032	35	4	Sensor; Models made in USA; OEM Part No. 4260706011.....	28360	35	4
Service Pack; Mar. & Older.....	20031	35	4	Service Pack.....	20032	35	4
2007-2011				Mirai			
OE Sensor: Toyota - 4260733011				2016-2017			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Toyota - 4260706011			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	28365	35	4	Sensor; Models made in USA; W/16" Or 17" Wheels.....	28360	35	4
Service Pack.....	20032	35	4	Service Pack.....	20032	35	4
2013-2014				Prius			
OE Sensor: Toyota - 4260733011				2005-2013			
EZ-Sensor.....	33000 A	11.5	1.3	OE Sensor: Toyota - 4260733011			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28365	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20032	35	4	Sensor.....	28365	35	4
2015				2013			
OE Sensor: Toyota - 4260733011				Sensor.....	28360	35	4
EZ-Sensor.....	33500 A, DB	11.5	1.3	2014-2016			
	33700	11.5	1.3	OE Sensor: Toyota - 4260733011			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3		33500 A, DB	11.5	1.3
Sensor.....	28365	35	4		33700	11.5	1.3
Service Pack.....	20032	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
2016-2017				2016-2017			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	28365	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20032	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3				

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Toyota (cont'd)				Toyota (cont'd)			
Prius (cont'd)				RAV4 (cont'd)			
2015-2016				2013			
Sensor.....	28360			OE Sensor: Toyota - 4260733021			
Service Pack.....	20032			EZ-Sensor.....	33500 A, DB	11.5	1.3
2016					33700	11.5	1.3
OE Sensor: Toyota - 4260733011				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28360	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
2017				Sensor; exc Electric.....	28370	35	4
OE Sensor: Toyota - 4260733011				Service Pack; exc Electric.....	20032	35	4
EZ-Sensor.....	33500 A, DB	11.5	1.3	2014-2015			
	33700	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor.....	28360	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	28360			2016-2017			
Service Pack.....	20032	35	4	OE Sensor: Toyota - 4260706011			
	20032			EZ-Sensor.....	33500 A, DB	11.5	1.3
Prius Prime					33700	11.5	1.3
2017				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
OE Sensor: Toyota - 4260706011				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor; Models made in USA; W/16" Or 17"				Sensor; Electric.....	28360	35	4
Wheels.....	28360	35	4	Service Pack.....	20032	35	4
Service Pack.....	20032	35	4	Sequoia			
RAV4				2004-2007			
2006				OE Sensor: Toyota - 426070C010, 426070C020			
OE Sensor: Toyota - 4260733011				EZ-Sensor.....	33000 A	11.5	1.3
EZ-Sensor; exc Electric.....	33000 A	11.5	1.3		33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; exc Electric; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; exc Electric; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor; W/Alloy Wheels.....	28305	35	4
Sensor; exc Electric.....	28365	35	4	Sensor; W/Steel Wheels; W/20 Deg. Angled Valve Sensor.....	28305	35	4
Service Pack; exc Electric.....	20032	35	4	Sensor; W/Steel Wheels; W/40 Deg. Angled Valve Sensor.....	28300	35	4
2007-2011				Service Pack.....	20031	35	4
OE Sensor: Toyota - 4260733021				2008-2013			
EZ-Sensor; exc Electric.....	33000 A	11.5	1.3	OE Sensor: Toyota - 4260708010, 426070C050			
	33500 A, DB	11.5	1.3	EZ-Sensor.....	33000 A	11.5	1.3
	33700	11.5	1.3		33500 A, DB	11.5	1.3
EZ-Sensor Service Pack; exc Electric; Aluminium Valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; exc Electric; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Sensor; exc Electric.....	28370	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; exc Electric.....	20032	35	4	Sensor.....	28670	35	4
2012				Service Pack.....	20022	35	4
OE Sensor: Toyota - 4260706011, 4260733021				2014-2017			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sienna			
Sensor; Electric.....	28360	35	4	2005			
Sensor; exc Electric.....	28370	35	4	Sensor.....	INDIRECT D		
Service Pack.....	20032	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Toyota (cont'd)				Toyota (cont'd)			
Sienna (cont'd)				Tacoma (cont'd)			
2006-2014				2006			
OE Sensor: Toyota - 4260708010, 426070C030, 426070C050				OE Sensor: Toyota - 4260704010, 4260706011, 42607AD020			
EZ-Sensor	33000 A	11.5	1.3	EZ-Sensor	33000 A	11.5	1.3
	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve	34000	62	7
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor	28670	35	4	Sensor; W/Alloy Wheels; W/20 Deg. Angled			
Service Pack	20022	35	4	Valve Sensor; Aug. & Newer	28360	35	4
2015-2016				Sensor; W/Alloy Wheels; W/20 Deg. Angled			
EZ-Sensor	33500 A, DB	11.5	1.3	Valve Sensor; Jul. & Older	28355	35	4
	33700	11.5	1.3	Sensor; W/Steel Wheels; W/40 Deg. Angled			
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	Valve Sensor	28380	35	4
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Service Pack; Aug. & Newer	20032	35	4
				Service Pack; Jul. & Older			
				20031			
				2007-2013			
				OE Sensor: Toyota - 4260704010, 4260706011			
				EZ-Sensor			
				33000 A			
				11.5			
				1.3			
				33500 A, DB			
				11.5			
				1.3			
				33700			
				11.5			
				1.3			
				EZ-Sensor Service Pack; Aluminium Valve			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; Rubber Valve			
				20018 C, T			
				11.5			
				1.3			
				Sensor; May & Newer			
				28360			
				35			
				4			
				Service Pack; May & Newer			
				20032			
				35			
				4			
				2014			
				OE Sensor: Toyota - 4260704010, 4260706011			
				EZ-Sensor			
				33000 A			
				11.5			
				1.3			
				33500 A, DB			
				11.5			
				1.3			
				33700			
				11.5			
				1.3			
				EZ-Sensor Service Pack; Aluminium Valve			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; Rubber Valve			
				20018 C, T			
				11.5			
				1.3			
				Sensor; W/Alloy Wheels; W/20 Deg. Angled			
				Valve Sensor			
				28360			
				35			
				4			
				Sensor; W/Steel Wheels; W/40 Deg. Angled			
				Valve Sensor			
				28380			
				35			
				4			
				Service Pack			
				20032			
				35			
				4			
				2015			
				OE Sensor: Toyota - 4260704010, 4260706011			
				EZ-Sensor			
				33500 A, DB			
				11.5			
				1.3			
				33700			
				11.5			
				1.3			
				EZ-Sensor Service Pack; Aluminium Valve			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; Rubber Valve			
				20018 C, T			
				11.5			
				1.3			
				Sensor; W/Alloy Wheels; W/20 Deg. Angled			
				Valve Sensor			
				28360			
				35			
				4			
				Sensor; W/Steel Wheels; W/20 Deg. Angled			
				Valve Sensor			
				28380			
				35			
				4			
				Service Pack			
				20032			
				35			
				4			
				2015			
				OE Sensor: Toyota - 4260704010, 4260706011			
				EZ-Sensor			
				33500 A, DB			
				11.5			
				1.3			
				33700			
				11.5			
				1.3			
				Sensor; W/Alloy Wheels; W/20 Deg. Angled			
				Valve Sensor			
				28360			
				35			
				4			
				Sensor; W/Steel Wheels; W/20 Deg. Angled			
				Valve Sensor			
				28380			
				35			
				4			
				Service Pack			
				20032			
				35			
				4			

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Toyota (cont'd)				Toyota (cont'd)			
Tundra				Tundra (cont'd)			
2005				2013			
OE Sensor: Toyota - 426070C010, 426070C020				OE Sensor: Toyota - 4260708010			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor.....	28305	35	4	Sensor; W/Alloy Wheels; W/TRW Sensor.....	28670	35	4
Sensor; W/Steel Wheels; W/40 Deg. Angled Valve Sensor.....	28300	35	4	Sensor; W/Steel Wheels; W/TRW Sensor.....	28380	35	4
Service Pack.....	20031	35	4	Service Pack.....	20022	35	4
2006				2014			
OE Sensor: Toyota - 4260708010, 426070C010, 426070C020				OE Sensor: Toyota - 426070C030, 426070C040			
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor.....	33000 ^A	11.5	1.3
	33500 ^{A, DB}	11.5	1.3		33500 ^{A, DB}	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
Sensor.....	28380			Sensor; W/Alloy Wheels.....	28670	35	4
Sensor; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor.....	28305	35	4	Sensor; W/Steel Wheels.....	28380	35	4
Sensor; W/Alloy Wheels; W/TRW Sensor.....	28670	35	4	Service Pack.....	20022	35	4
Sensor; W/Steel Wheels; W/40 Deg. Angled Valve Sensor.....	28300	35	4	2015			
Service Pack; Nov. 1 & Newer.....	20022	35	4	OE Sensor: Toyota - 4260708010, 426070C060			
Service Pack; Oct. 31 & Older.....	20031	35	4	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
2007					33700	11.5	1.3
OE Sensor: Toyota - 426070C050				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	Sensor.....	28380	35	4
	33700	11.5	1.3	Sensor; W/Alloy Wheels; W/TRW Sensor.....	28670	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor; W/Steel Wheels.....	28380	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack.....	20022	35	4
Sensor.....	28380			Venza			
Sensor; W/Alloy Wheels; W/TRW Sensor.....	28670	35	4	2009-2014			
Service Pack; W/Alloy Wheels; W/TRW Sensor...	20022	35	4	OE Sensor: Toyota - 42607-06011			
2008-2011				EZ-Sensor.....	33000 ^A	11.5	1.3
OE Sensor: Toyota - 4260708010, 426070C050					33500 ^{A, DB}	11.5	1.3
EZ-Sensor.....	33000 ^A	11.5	1.3		33700	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	28360	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	Service Pack.....	20032	35	4
Sensor; W/Alloy Wheels; W/TRW Sensor.....	28670	35	4	2015-2016			
Sensor; W/Steel Wheels; W/TRW Sensor.....	28380	35	4	OE Sensor: Toyota - 42607-06011			
Service Pack.....	20022	35	4	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
2012					33700	11.5	1.3
OE Sensor: Toyota - 4260708010				EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor.....	33000 ^A	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3
	33500 ^{A, DB}	11.5	1.3	Sensor.....	28360	35	4
	33700	11.5	1.3	Service Pack.....	20032	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2017			
EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3	EZ-Sensor.....	33500 ^{A, DB}	11.5	1.3
Sensor.....	28670	35	4		33700	11.5	1.3
Sensor; W/Steel Wheels; W/TRW Sensor.....	28380	35	4	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
Service Pack.....	20022	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 ^{C, T}	11.5	1.3

A-Programming Tool Required C-20018 and 20008 are interchangeable. DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Toyota (cont'd)				Volkswagen			
Yaris				Beetle			
2007				2007-2010			
OE Sensor: Toyota - 4260733011				OE Sensor: Volkswagen - 1K0907253D			
EZ-Sensor.....	33000 A	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20088	71	8
Sensor; Aug. & Newer.....	28365	35	4	Service Pack.....	20017	71	8
Service Pack; Aug. & Newer.....	20032	35	4	2011			
2008-2012				EZ-Sensor.....			
OE Sensor: Toyota - 4260733011					33500 A, DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	2013-2018			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	INDIRECT ^D		
Sensor.....	28365	35	4	CC			
Service Pack.....	20032	35	4	2009-2014			
2013				OE Sensor: Volkswagen - 1K0907253D, 3AA-907-275			
OE Sensor: Toyota - 4260706011				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33000 A	11.5	1.3		33700	11.5	1.3
	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Sensor.....	20088	71	8
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Service Pack.....	20017	71	8
Sensor.....	28360	35	4	2015-2017			
Service Pack.....	20032	35	4	EZ-Sensor.....	33500 A, DB	11.5	1.3
2014-2015					33700	11.5	1.3
OE Sensor: Toyota - 4260706011				EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	33700	11.5	1.3	Sensor.....	28360	35	4
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	Service Pack.....	20032	35	4
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2015			
Sensor.....	28360	35	4	Sensor.....			
Service Pack.....	20032	35	4	INDIRECT ^D			
2016-2018				Eos			
OE Sensor: Toyota - 4260706011				2007-2016			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Volkswagen - 1K0907253D			
	33700	11.5	1.3	EZ-Sensor.....			
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	33500 A, DB			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	33700			
Sensor.....	28360	35	4	11.5			
Service Pack.....	20032	35	4	1.3			
Yaris iA				EZ-Sensor Service Pack; Aluminum valve.....			
2017-2018				34000			
Sensor.....				62			
INDIRECT ^D				7			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 C, T			
				11.5			
				1.3			
				Sensor.....			
				20088			
				71			
				8			
				Service Pack.....			
				20017			
				71			
				8			
				2017			
				EZ-Sensor.....			
				33500 A, DB			
				11.5			
				1.3			
				EZ-Sensor Service Pack; Aluminum valve.....			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 C, T			
				11.5			
				1.3			
				GLI			
				2008-2011			
				EZ-Sensor.....			
				33500 A, DB			
				11.5			
				1.3			
				33700			
				11.5			
				1.3			
				EZ-Sensor Service Pack; Aluminum valve.....			
				34000			
				62			
				7			
				EZ-Sensor Service Pack; Rubber Valve.....			
				20018 C, T			
				11.5			
				1.3			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Volkswagen (cont'd)				Volkswagen (cont'd)			
Golf				Jetta			
2006-2007				2006-2007			
OE Sensor: Volkswagen - 1K0907253D				OE Sensor: Volkswagen - 1K0907253D			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20088	71	8	Sensor.....	20088	71	8
Service Pack.....	20017	71	8	Service Pack.....	20017	71	8
2010				2008-2009			
OE Sensor: Volkswagen - 1K0907253D				OE Sensor: Volkswagen - 1K0907253D			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor.....	33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20088	71	8	Sensor.....	20088	71	8
Service Pack.....	20017	71	8	Sensor; exc GLL.....	20088	71	8
2013-2017				2010			
Sensor.....	INDIRECT ^D			OE Sensor: Volkswagen - 1K0907253D			
Golf Alltrack				EZ-Sensor.....			
2017				33500 A, DB 11.5 1.3			
Sensor.....	INDIRECT ^D			33700 11.5 1.3			
Golf R				EZ-Sensor Service Pack; Aluminum valve.....			
2015-2017				34000 62 7			
Sensor.....	INDIRECT ^D			EZ-Sensor Service Pack; Rubber Valve.....			
Golf SportWagen				20018 C, T 11.5 1.3			
2015-2017				Sensor.....			
Sensor.....	INDIRECT ^D			20088 71 8			
GTI				Service Pack.....			
2006-2007				20017 71 8			
OE Sensor: Volkswagen - 1K0907253D				2013-2017			
EZ-Sensor.....	33500 A, DB	11.5	1.3	Sensor.....			
	33700	11.5	1.3	INDIRECT ^D			
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	Passat			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2006-2008			
Sensor; W/16" Or 17" Wheels.....	20088	71	8	OE Sensor: Volkswagen - 1K0907253D			
Service Pack; W/16" Or 17" Wheels.....	20017	71	8	EZ-Sensor.....			
2008-2010				33500 A, DB 11.5 1.3			
OE Sensor: Volkswagen - 1K0907253D				33700 11.5 1.3			
EZ-Sensor.....	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve.....			
	33700	11.5	1.3	34000 62 7			
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	20018 C, T 11.5 1.3			
Sensor.....	20088	71	8	Sensor; W/16" Or 17" Wheels.....			
Service Pack.....	20017	71	8	20088 71 8			
2011				Service Pack; W/16" Or 17" Wheels.....			
EZ-Sensor.....	33500 A, DB	11.5	1.3	20017 71 8			
	33700	11.5	1.3	2009-2011			
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	OE Sensor: Volkswagen - 1K0907253D			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor.....			
Sensor.....	20088	71	8	33500 A, DB 11.5 1.3			
Service Pack.....	20017	71	8	33700 11.5 1.3			
2013-2015				EZ-Sensor Service Pack; Aluminum valve.....			
Sensor.....	INDIRECT ^D			34000 62 7			
Phaeton				EZ-Sensor Service Pack; Rubber Valve.....			
2002-2003				20018 C, T 11.5 1.3			
EZ-Sensor.....				Sensor.....			
33500 A, DB 11.5 1.3				INDIRECT ^D			
33700 11.5 1.3				Phaeton			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Volkswagen (cont'd)				Volkswagen (cont'd)			
Phaeton (cont'd)				Routan (cont'd)			
2004-2006				2011-2013			
OE Sensor: Volkswagen - 4D0907275C, 4F0907275B				OE Sensor: Chrysler - 56029398AB; Volkswagen - 7B0-907-253B, 7B0-907-253C			
EZ-Sensor	33200 A	11.5	1.3	EZ-Sensor	33500 A, DB	11.5	1.3
	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve	34000	62	7
EZ-Sensor Service Pack; Aluminium Valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor	20398	11.5	1.3
Sensor; Includes Transmitter Only; W/315 MHz	20077	35	4	Service Pack; Rubber Valve	20018 C, T	11.5	1.3
Sensor; Includes Transmitter Only; W/433 MHz	20078	35	4	2012-2013			
Sensor	20078	35	4	EZ-Sensor	33200 A	11.5	1.3
Service Pack; Does Not Include Valve	20023	35	4	2014			
Service Pack; W/43mm Silver Insert	20037	35	4	OE Sensor: Volkswagen - 56029398AA			
Service Pack; W/48mm Green Insert	20038	35	4	EZ-Sensor	33200 A	11.5	1.3
Service Pack; W/49mm Black Insert	20039	35	4		33500 A, DB	11.5	1.3
Service Pack; W/51mm Orange Insert	20040	35	4		33700	11.5	1.3
R32				EZ-Sensor Service Pack; Aluminum valve			
2008-2011				EZ-Sensor Service Pack; Rubber Valve			
OE Sensor: Volkswagen - 1K0907253D				Sensor			
EZ-Sensor	33500 A, DB	11.5	1.3	2015			
	33700	11.5	1.3	Service Pack			
EZ-Sensor Service Pack; Aluminum valve	34000	62	7	INDIRECT ^D			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Tiguan			
Sensor	20088	71	8	2008-2012			
Service Pack	20017	71	8	OE Sensor: Volkswagen - 1K0907253D			
Rabbit				EZ-Sensor			
2006-2007				EZ-Sensor Service Pack; Aluminum valve			
OE Sensor: Volkswagen - 1K0907253D				EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor	33500 A, DB	11.5	1.3	Sensor			
	33700	11.5	1.3	Service Pack			
EZ-Sensor Service Pack; Aluminum valve	34000	62	7	2013			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor			
Sensor; W/15" Wheels	20088	71	8	EZ-Sensor Service Pack; Aluminum valve			
Service Pack; W/15" Wheels	20017	71	8	EZ-Sensor Service Pack; Rubber Valve			
2008-2009				2014-2017			
OE Sensor: Volkswagen - 1K0907253D				EZ-Sensor			
EZ-Sensor	33500 A, DB	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve			
	33700	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor Service Pack; Aluminum valve	34000	62	7	EZ-Sensor Service Pack; Rubber Valve			
EZ-Sensor Service Pack; Rubber Valve	20018 C, T	11.5	1.3	Sensor			
Sensor	20088	71	8	INDIRECT ^D			
Service Pack	20017	71	8	Touareg			
Routan				2001-2003			
2009-2010				EZ-Sensor			
OE Sensor: Volkswagen - 7B0-907-253, 7B0-907-253A				EZ-Sensor			
Sensor	28434 E	11.5	1.3	EZ-Sensor			
Service Pack; Rubber Valve	20018 C, T	11.5	1.3	EZ-Sensor			

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
 E-Use until depleted, replaced by 20004 E-Supercedes the 28155 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Volkswagen (cont'd)				Volvo			
Touareg (cont'd)				C30,C70,S40			
2004-2006				2007-2013			
OE Sensor: Volkswagen - 4F0907275B				OE Sensor: Volvo - 312802970, 313020960			
EZ-Sensor.....	33200 A	11.5	1.3	Sensor.....	20097	71	8
	33500 A, DB	11.5	1.3	Service Pack.....	20050	71	8
	33700	11.5	1.3		20050V	71	8
EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7	S60 Cross Country			
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2017			
Sensor; Includes Transmitter Only; W/433 MHz				Sensor..... INDIRECT D			
Sensor.....	20078	35	4	S60,S80			
Service Pack; Does Not Include Valve.....	20023	62	7	2004-2005			
Service Pack; W/43mm Silver Insert.....	20037	62	7	OE Sensor: Volvo - 86517000			
Service Pack; W/48mm Green Insert.....	20038	62	7	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/49mm Black Insert.....	20039	62	7		33700	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	62	7	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
2007				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; Does Not Include Valve.....	20023	62	7	Sensor.....	20156	44	5
Service Pack; W/43mm Silver Insert.....	20037	62	7	Sensor; W/315 MHz Sensor.....	20156	44	5
Service Pack; W/48mm Green Insert.....	20038	62	7	Service Pack.....	20009 R	44	5
Service Pack; W/49mm Black Insert.....	20039	62	7		20010 L	44	5
Service Pack; W/51mm Orange Insert.....	20040	62	7	Service Pack; W/315 MHz Sensor.....	20009 R	44	5
2008-2009					20010 L	44	5
OE Sensor: Volkswagen - 4F0907275B				2006-2009			
Sensor; Includes Transmitter Only.....	20078	35	4	OE Sensor: Volvo - 307489910, 312009230, 86517000			
Service Pack; Does Not Include Valve.....	20023	35	4	EZ-Sensor.....	33500 A, DB	11.5	1.3
Service Pack; W/43mm Silver Insert.....	20037	35	4		33700	11.5	1.3
Service Pack; W/48mm Green Insert.....	20038	35	4	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
Service Pack; W/49mm Black Insert.....	20039	35	4	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack; W/51mm Orange Insert.....	20040	35	4	Sensor.....	20156	44	5
2010				Service Pack.....	20009 R	44	5
OE Sensor: Volkswagen - 4F0907275D					20010 L	44	5
Sensor; Includes Transmitter Only.....	20103	35	4	2007-2009			
Service Pack; Does Not Include Valve.....	20023	35	4	OE Sensor: Volvo - 312802970			
Service Pack; W/43mm Silver Insert.....	20037	35	4	Sensor.....	20097	71	8
Service Pack; W/48mm Green Insert.....	20038	35	4	Service Pack.....	20050	71	8
Service Pack; W/49mm Black Insert.....	20039	35	4		20050V	71	8
Service Pack; W/51mm Orange Insert.....	20040	35	4	2010			
2011-2013				OE Sensor: Volvo - 313020960			
OE Sensor: Volkswagen - 7P0907275, 7P0907275A				EZ-Sensor.....	33500 A, DB	11.5	1.3
Sensor; W/315 MHz Sensor; Includes					33700	11.5	1.3
Transmitter Only.....	20077	35	4	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
Sensor; W/433 MHz Sensor; Includes				EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Transmitter Only.....	20103	35	4	Sensor.....	20097	71	8
Service Pack; Does Not Include Valve.....	20023	35	4	Service Pack.....	20050	71	8
Service Pack; W/43mm Silver Insert.....	20037	35	4		20050V	71	8
Service Pack; W/48mm Green Insert.....	20038	35	4	2011-2013			
Service Pack; W/49mm Black Insert.....	20039	35	4	OE Sensor: Volvo - 313020960			
Service Pack; W/51mm Orange Insert.....	20040	35	4	Sensor.....	20097	71	8
2014-2017				Service Pack.....	20050	71	8
OE Sensor: Volkswagen - 7P0907275					20050V	71	8
Sensor; W/433 MHz Sensor; Includes							
Transmitter Only.....	20103	35	4				
Service Pack; Does Not Include Valve.....	20023	35	4				
Service Pack; W/43mm Silver Insert.....	20037	35	4				
Service Pack; W/48mm Green Insert.....	20038	35	4				
Service Pack; W/49mm Black Insert.....	20039	35	4				
Service Pack; W/51mm Orange Insert.....	20040	35	4				

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
L-Use until depleted, replaced by 20009 R-Interchanges with 20005, 20010 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Volvo (cont'd)				Volvo (cont'd)			
S60,S80 (cont'd)				V90			
2014				2016			
OE Sensor: Volvo - 313020960				EZ-Sensor.....	33500 A,DB	11.5	1.3
EZ-Sensor.....	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
Sensor.....	20097	71	8	2017			
Service Pack.....	20050	71	8	EZ-Sensor.....	33500 A,DB	11.5	1.3
	20050V	71	8		33700	11.5	1.3
2015				EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor.....	33500 A,DB	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
	33700	11.5	1.3	Sensor.....	INDIRECT ^D		
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	2018			
2017				Sensor.....	INDIRECT ^D		
Sensor.....	INDIRECT ^D			XC60			
S90				2010-2014			
2017-2018				OE Sensor: Volvo - 313020960			
Sensor.....	INDIRECT ^D			Sensor.....	20097	71	8
V50				Service Pack.....	20050	71	8
2005-2011					20050V	71	8
OE Sensor: Volvo - 312802970, 313020960	20097	71	8	2015			
Sensor.....	20050	71	8	EZ-Sensor.....	33500 A,DB	11.5	1.3
Service Pack.....	20050V	71	8		33700	11.5	1.3
V60				EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
2015-2016				EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
EZ-Sensor.....	33500 A,DB	11.5	1.3	2017			
	33700	11.5	1.3	EZ-Sensor.....	33500 A,DB	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7		33700	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
2017-2018				EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
Sensor.....	INDIRECT ^D			Sensor.....	INDIRECT ^D		
V60 Cross Country				2016			
2017-2018				EZ-Sensor.....	33500 A,DB	11.5	1.3
Sensor.....	INDIRECT ^D				33700	11.5	1.3
V70				EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
2004-2007				EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
OE Sensor: Volvo - 307489910, 86517000				2017			
EZ-Sensor.....	33500 A,DB	11.5	1.3	EZ-Sensor.....	33500 A,DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
Sensor; W/315 MHz Sensor.....	20156	44	5	Sensor.....	INDIRECT ^D		
Service Pack; W/315 MHz Sensor.....	20009 R	44	5	2018			
	20010 L	44	5	Sensor.....	INDIRECT ^D		
2008-2010				XC70			
OE Sensor: Volvo - 312802970, 313020960				2004-2007			
Sensor.....	20097	71	8	OE Sensor: Volvo - 307489910, 86517000			
Service Pack.....	20050	71	8	EZ-Sensor.....	33500 A,DB	11.5	1.3
	20050V	71	8		33700	11.5	1.3
				EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
				EZ-Sensor Service Pack; Rubber Valve.....	20018 C,T	11.5	1.3
				Sensor; W/315 MHz Sensor.....	20156	44	5
				Service Pack; W/315 MHz Sensor.....	20009 R	44	5
					20010 L	44	5
				2008-2014			
				OE Sensor: Volvo - 312802970, 313020960			
				Sensor.....	20097	71	8
				Service Pack.....	20050	71	8
					20050V	71	8

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
L-Use until depleted, replaced by 20009 R-Interchanges with 20005, 20010 T-Interchanges with 20008

Sensors/Transmitters & Service Packs for Passenger Cars & Light Trucks

Application	Part No.	Torque in-lbs	Torque N.m.	Application	Part No.	Torque in-lbs	Torque N.m.
Volvo (cont'd)				VPG			
XC70 (cont'd)				MV-1			
2015				2011			
EZ-Sensor.....	33500 A, DB	11.5	1.3	OE Sensor: Ford Motor Company - 9L3Z1A189A			
	33700	11.5	1.3	Sensor.....	20315	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	2012			
XC90				OE Sensor: Ford Motor Company - 9L3Z1A189A			
2004				EZ-Sensor.....			
OE Sensor: Volvo - 86517000					33000 A	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33500 A, DB	11.5	1.3
	33700	11.5	1.3		33700	11.5	1.3
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Sensor.....	20156	44	5	Sensor.....	20315	11.5	1.3
Service Pack.....	20009 R	44	5	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
	20010 L	44	5	2013-2016			
2005-2007				OE Sensor: Ford Motor Company - 9L3Z1A189A			
OE Sensor: Volvo - 307489910, 86517000				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminium Valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20315	11.5	1.3
Sensor.....	20156	44	5	Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
Service Pack.....	20009 R	44	5	2017			
	20010 L	44	5	EZ-Sensor.....			
2008-2011							
OE Sensor: Volvo - 31200923					33500 A, DB	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	20156	44	5
Sensor; W/315 MHz Sensor.....	20156	44	5	Service Pack.....	20009 R	44	5
Service Pack.....	20009 R	44	5		20010 L	44	5
	20010 L	44	5	2012-2015			
2012-2015				OE Sensor: Volvo - 31200923			
OE Sensor: Volvo - 31200923				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28362	11.5	1.3
Sensor.....	28362	11.5	1.3	Service Pack.....	20008 C, N	11.5	1.3
Service Pack.....	20008 C, N	11.5	1.3		20018 C, T	11.5	1.3
	20018 C, T	11.5	1.3	2016			
2016				OE Sensor: Volvo - 31662304			
OE Sensor: Volvo - 31662304				EZ-Sensor.....	33500 A, DB	11.5	1.3
EZ-Sensor.....	33500 A, DB	11.5	1.3		33700	11.5	1.3
	33700	11.5	1.3	EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7
EZ-Sensor Service Pack; Aluminum valve.....	34000	62	7	EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3
EZ-Sensor Service Pack; Rubber Valve.....	20018 C, T	11.5	1.3	Sensor.....	28304		
Sensor.....	28304			2017-2018			
2017-2018				Sensor.....			
Sensor.....	INDIRECT ^D						

A-Programming Tool Required C-20018 and 20008 are interchangeable. D-Indirect TPMS system. No sensor in wheel DB-33500 Replaces 33000,33100 & 33200
L-Use until depleted, replaced by 20009 N-Use until depleted, replaced by 20018 R-Interchanges with 20005, 20010 T-Interchanges with 20008

Numerical Listing

Sensor

20028 (433 MHz)



Chrysler: 300M; 2002-2004
 Chrysler: Concorde; 2002-2004
 Chrysler: Crossfire; 2004
 Chrysler: Crossfire; 2005
 Chrysler: Crossfire; 2006-2008
 Chrysler: Intrepid; 2002-2004
 Chrysler: Pacifica; 2004; OEM Part No. 58088990AC (433 MHz)
 Chrysler: Prowler; 2002
 Chrysler: Town & Country; 2002-2003
 Chrysler: Voyager; 2002-2003
 Dodge: Caravan; 2002-2003
 Dodge: Grand Caravan; 2002-2003
 Dodge: Intrepid; 2002-2004
 Dodge: Viper; 2003-2006
 Dodge: Viper; 2008-2010
 Isuzu: Rodeo; 2004
 Jeep: Grand Cherokee; 2002-2004
 Jeep: Liberty; 2002-2004
 Mitsubishi: Endeavor; 2004-2005
 Mitsubishi: Endeavor; 2006; Aug. & Older
 Mitsubishi: Galant; 2004-2006

20034 315 MHz



Mitsubishi: Eclipse; 2006-2007; W/Alloy Wheels
 Mitsubishi: Eclipse; 2008-2010
 Mitsubishi: Eclipse; 2011
 Mitsubishi: Endeavor; 2006; Sept. 1 & Newer
 Mitsubishi: Endeavor; 2007
 Mitsubishi: Endeavor; 2008
 Mitsubishi: Endeavor; 2010
 Mitsubishi: Endeavor; 2011; W/Alloy Wheels
 Mitsubishi: Galant; 2007-2009; W/Alloy Wheels
 Mitsubishi: Galant; 2010-2012; W/Alloy Wheels
 Mitsubishi: Montero; 2003-2006
 Mitsubishi: Montero Sport; 2003-2004

Sensor

20064 315 MHz



Infiniti: FX35; 2003-2006
 Infiniti: FX35; 2007; Jun. & Older
 Infiniti: FX45; 2003-2006
 Infiniti: FX45; 2007; Jun. & Older
 Infiniti: G35; 2003; Jun. & Newer
 Infiniti: G35; 2004-2006
 Infiniti: M35; 2006-2007
 Infiniti: M45; 2003-2004
 Infiniti: M45; 2006-2007
 Infiniti: Q45; 2003-2005
 Infiniti: Q45; 2006; Jul. & Older
 Infiniti: QX4; 2003
 Nissan: 350Z; 2003-2006
 Nissan: Frontier; 2003-2004
 Nissan: Murano; 2003-2006
 Nissan: Pathfinder; 2003
 Nissan: Pathfinder; 2004; Exc. Armada; Jul. & Older
 Nissan: Xterra; 2003-2004

20069 (315 MHz)



Infiniti: QX56; 2004
 Infiniti: QX56; 2005-2006; W/Steel Wheels
 Nissan: Armada; 2005-2006; W/Steel Wheels
 Nissan: Frontier; 2005-2007; W/Steel Wheels
 Nissan: Pathfinder; 2004; Armada
 Nissan: Pathfinder; 2004; Exc. Armada; Aug. & Newer
 Nissan: Quest; 2004
 Nissan: Quest; 2005-2006; W/Steel Wheels
 Nissan: Titan; 2004
 Nissan: Titan; 2005; Mar. & Older
 Nissan: Xterra; 2006; Submodel X

20076 (315 MHz)



Cadillac: STS; 2005; OEM Part No. 25758220
 Cadillac: STS; 2006-2008
 Cadillac: XLR; 2004; OEM Part No. 25758220
 Cadillac: XLR; 2005-2009
 Chevrolet: Corvette; 2005-2009

Numerical Listing

Sensor 20077 (433 MHz)	Sensor 20078 (433 MHz)
	
<p> Audi; A6; 2011; Includes Transmitter Only Audi; A6 Quattro; 2011; Includes Transmitter Only Audi; A8; 2006-2011; Includes Transmitter Only Audi; A8 Quattro; 2003; Includes Transmitter Only; Chassis No. 4E3000001 & After Audi; A8 Quattro; 2004-2011; Includes Transmitter Only Audi; Q7; 2011; Includes Transmitter Only Audi; RS6; 2003; Includes Transmitter Only Audi; S6; 2011; Includes Transmitter Only Audi; S8; 2003; Includes Transmitter Only; Chassis No. 4E3000001 & After Audi; S8; 2004-2006; Includes Transmitter Only; Chassis No. 4E3000001 & After Audi; S8; 2007-2008; Includes Transmitter Only Audi; S8; 2009; Includes Transmitter Only; Chassis No. 4E3000001 & After Audi; S8; 2015; Includes Transmitter Only; Chassis No. 4E3000001 & After Bentley; Continental; 2003-2005; Includes Transmitter Only Ferrari; 612 Scaglietti; 2004-2011; Includes Transmitter Only Ferrari; F430; 2006-2007; Includes Transmitter Only Ferrari; F430; 2008-2009; Includes Transmitter Only Ferrari; Maranello; 1998-2006; Includes Transmitter Only Maserati; Quattroporte; 2004-2008; Includes Transmitter Only Porsche; 911; 2007-2009; Includes Transmitter Only Porsche; 911; 2011; Includes Transmitter Only Porsche; Boxster; 2011; Includes Transmitter Only Porsche; Cayman; 2005-2007; Includes Transmitter Only Porsche; Cayman; 2008; Includes Transmitter Only Porsche; Cayman; 2011; Includes Transmitter Only Volkswagen; Phaeton; 2004-2006; Includes Transmitter Only; W/315 MHz Sensor Volkswagen; Touareg; 2011-2013; W/315 MHz Sensor; Includes Transmitter Only </p>	<p> Aston Martin; DB9; 2018 Audi; A3, A4, A5 & Quattro; 2002-2005; Includes Transmitter Only Audi; A3, A4, A5 & Quattro; 2006-2007; Includes Transmitter Only Audi; A3, A4, A5 & Quattro; 2008; Includes Transmitter Only Audi; A6; 2006-2008; Includes Transmitter Only Audi; A6 Quattro; 2006-2008; Includes Transmitter Only Audi; Q7; 2007-2009; Includes Transmitter Only Audi; R8; 2008-2009; Includes Transmitter Only Audi; RS4; 2007-2008; Includes Transmitter Only Audi; S4; 2004-2009; Includes Transmitter Only Audi; S6; 2007-2009; Includes Transmitter Only Bentley; Arnage; 2008; Includes Transmitter Only Bentley; Brooklands; 2008; Includes Transmitter Only Bentley; Continental; 2006-2010; Includes Transmitter Only Bentley; Mulsanne; 2009; Includes Transmitter Only Ferrari; FF; 2011; Includes Transmitter Only Ferrari; LaFerrari; 2014; Includes Transmitter Only Lamborghini; Aventador; 2011; Includes Transmitter Only Maserati; GranTurismo; 2014; Does Not Include Valve Maserati; GranTurismo; 2015; Includes Transmitter Only Volkswagen; Phaeton; 2004-2006; Includes Transmitter Only; W/433 MHz Sensor Volkswagen; Touareg; 2004-2006; Includes Transmitter Only; W/433 MHz Sensor Volkswagen; Touareg; 2008-2009; Includes Transmitter Only </p>

Numerical Listing

Sensor

20079 (315 MHz)



Audi; A6; 2002-2004; Includes Transmitter Only
 Audi; A8; 2000; Includes Transmitter Only
 Audi; A8; 2001-2003; Includes Transmitter Only
 Audi; A8 Quattro; 2000-2002; Includes Transmitter Only
 Audi; A8 Quattro; 2003; Includes Transmitter Only; Chassis No. 4D3004999 & Before
 Audi; Allroad Quattro; 2001-2005; Includes Transmitter Only
 Audi; S4; 2002; Includes Transmitter Only
 Audi; S4; 2003; Includes Transmitter Only
 Audi; S8; 2000; Includes Transmitter Only
 Audi; S8; 2001-2002; Includes Transmitter Only
 Audi; S8; 2003; Includes Transmitter Only; Chassis No. 4D3004999 & Before
 BMW; 325; 2001-2002; Includes Transmitter Only; W/433 MHz Sensor
 BMW; 325; 2003-2006; Includes Transmitter Only
 BMW; 525i; 2002; Includes Transmitter Only
 BMW; 530; 2001; Includes Transmitter Only
 BMW; 530; 2002; Includes Transmitter Only
 BMW; 740i; 1999-2001; Includes Transmitter Only
 BMW; 740iL; 1999-2000; Includes Transmitter Only
 BMW; 740iL; 2001; Includes Transmitter Only
 BMW; 750iL; 1999-2000; Includes Transmitter Only
 BMW; 750iL; 2001; Includes Transmitter Only
 BMW; 750iL; 2002; Includes Transmitter Only
 Maybach; 57,62; 2003-2011; Includes Transmitter Only
 Mercedes-Benz; S500; 2000; Includes Transmitter Only
 Mercedes-Benz; S500; 2001; Includes Transmitter Only
 Mercedes-Benz; S500; 2002-2006; Includes Transmitter Only

Sensor

20080 (433 MHz)








BMW; 320i; 2001-2002; Includes Transmitter Only; W/433 MHz Sensor
 BMW; 320i; 2003-2005; Includes Transmitter Only
 BMW; 323Ci; 2000; Includes Transmitter Only
 BMW; 323i; 2000; Includes Transmitter Only
 BMW; 323i; 2003; Includes Transmitter Only
 BMW; 323i; 2006; Includes Transmitter Only
 BMW; 328Ci; 2000; Includes Transmitter Only
 BMW; 328i; 2000; Includes Transmitter Only; W/433 MHz Sensor
 BMW; 330; 2001-2002; Includes Transmitter Only; W/433 MHz Sensor
 BMW; 330; 2003-2006; Includes Transmitter Only
 BMW; 525i; 2002; Includes Transmitter Only; W/433 MHz Sensor
 BMW; 525i; 2003-2005; Includes Transmitter Only
 BMW; 530; 2002; Includes Transmitter Only; W/433 MHz Sensor
 BMW; 530; 2003-2005; Includes Transmitter Only
 BMW; 540i; 2002; Includes Transmitter Only; W/433 MHz Sensor
 BMW; 540i; 2003; Includes Transmitter Only
 BMW; 545i; 2004-2005; Includes Transmitter Only
 BMW; 645Ci; 2004-2005; Includes Transmitter Only
 BMW; 740i; 1999-2001
 BMW; 740iL; 1999-2000
 BMW; 740iL; 2001
 BMW; 745; 2002; Includes Transmitter Only; W/433 MHz Sensor
 BMW; 745; 2003; Includes Transmitter Only
 BMW; 745; 2004-2005; Includes Transmitter Only
 BMW; 750iL; 1999-2000
 BMW; 750iL; 2001
 BMW; 750iL; 2002
 BMW; 760i; 2004-2005; Includes Transmitter Only
 BMW; 760Li; 2003; Includes Transmitter Only
 BMW; Alpina B7L; 2011; Includes Transmitter Only
 BMW; M; 2000-2001; Includes Transmitter Only; W/433 MHz Sensor
 BMW; M; 2002; Includes Transmitter Only; W/433 MHz Sensor
 BMW; M; 2003; Includes Transmitter Only
 BMW; M; 2003; Includes Transmitter Only; W/433 MHz Sensor
 BMW; Z8; 2003; Includes Transmitter Only; W/433 MHz Sensor

20081 (315 MHz)



BMW; X; 2011
 Subaru; B9 Tribeca; 2006-2007
 Subaru; Legacy; 2004-2007
 Subaru; Legacy; 2008; W/16" Or 17" Wheels
 Subaru; Outback; 2004-2007
 Subaru; Tribeca; 2008; W/Metal Stem Clamp-in Sensor
 Subaru; Tribeca; 2009; W/Metal Stem Clamp-in Sensor
 Subaru; Tribeca; 2010; W/Metal Stem Clamp-in Sensor
 Subaru; Tribeca; 2011; W/Metal Stem Clamp-in Sensor

Numerical Listing

Sensor 20082 (315 MHz)	Sensor 20084 (433 MHz)
 <p>Suzuki; Verona; 2005-2006</p>	 <p>Ferrari; Enzo; 2003-2004; Includes Transmitter Only</p>
20083 (315 MHz)	20085 (315 MHz)
	
<p>BMW; 1 Series; 2008; Includes Transmitter Only BMW; 1 Series; 2009-2010; Includes Transmitter Only BMW; 323i; 2007-2010; Includes Transmitter Only BMW; 325; 2007; Includes Transmitter Only BMW; 328i; 2007-2008; Includes Transmitter Only BMW; 328xi; 2007-2008; Includes Transmitter Only BMW; 335d; 2009; Includes Transmitter Only BMW; 335i; 2007-2008; Includes Transmitter Only BMW; 335xi; 2007-2008; Includes Transmitter Only BMW; 525i; 2006-2007; Includes Transmitter Only BMW; 525xi; 2006-2007; Includes Transmitter Only BMW; 528; 2008; Includes Transmitter Only BMW; 528; 2009-2011; Includes Transmitter Only BMW; 528xi; 2008; Includes Transmitter Only BMW; 530; 2006-2007; Includes Transmitter Only BMW; 535; 2008-2010; Includes Transmitter Only BMW; 535; 2011; Includes Transmitter Only BMW; 535xi; 2008; Includes Transmitter Only BMW; 540i; 2008-2011 BMW; 550; 2006-2010; Includes Transmitter Only BMW; 550; 2011; Includes Transmitter Only BMW; 650; 2006-2010; Includes Transmitter Only BMW; 750; 2006-2010; Includes Transmitter Only BMW; 750; 2011; Includes Transmitter Only BMW; 760i; 2006; Includes Transmitter Only BMW; 760Li; 2004-2008; Includes Transmitter Only BMW; 760Li; 2010; Includes Transmitter Only BMW; Alpina B7; 2007-2008; Includes Transmitter Only BMW; M; 2004-2010; Includes Transmitter Only BMW; M; 2011-2012; Includes Transmitter Only BMW; M; 2013; Includes Transmitter Only BMW; X; 2005-2007; Includes Transmitter Only BMW; X; 2008-2010; Includes Transmitter Only BMW; X; 2011; Includes Transmitter Only BMW; Z4; 2003-2010; Includes Transmitter Only BMW; Z4; 2011; Includes Transmitter Only Mini; Cooper; 2008-2009; Includes Transmitter Only</p>	<p>Hyundai; Entourage; 2007-2009; Includes Transmitter Only Hyundai; Santa Fe; 2007; Includes Transmitter Only Hyundai; Santa Fe; 2008; Includes Transmitter Only Hyundai; Veracruz; 2006-2007; Includes Transmitter Only Hyundai; Veracruz; 2008; Includes Transmitter Only Kia; Sedona; 2006-2008; Includes Transmitter Only</p>
	20086 (315 MHz)
	
	<p>Hyundai; Azera; 2006; Includes Transmitter Only Hyundai; Azera; 2007-2012; Includes Transmitter Only Hyundai; Azera; 2013 Hyundai; Elantra; 2007-2009; Includes Transmitter Only Hyundai; Elantra; 2010; exc Touring; Includes Transmitter Only Hyundai; Elantra; 2011; exc Touring; Includes Transmitter Only Hyundai; Elantra; 2012; exc Touring; W/Transmitter Only Hyundai; Elantra; 2013; W/Transmitter Only Hyundai; Elantra Coupe; 2013; W/Transmitter Only Hyundai; Santa Fe; 2008; Includes Transmitter Only Hyundai; Santa Fe; 2009; Includes Transmitter Only Hyundai; Veracruz; 2008 Hyundai; Veracruz; 2009-2012; Includes Transmitter Only Kia; Magentis; 2008; Includes Transmitter Only Kia; Magentis; 2009; Includes Transmitter Only Kia; Magentis; 2010; Includes Transmitter Only Kia; Optima; 2006-2010; Includes Transmitter Only Kia; Rio; 2017 Kia; Rondo; 2007-2011; Includes Transmitter Only Kia; Sedona; 2009-2012; Includes Transmitter Only</p>

Numerical Listing

Sensor 20087 (315 MHz)



Suzuki; Grand Vitara; 2007-2013
Suzuki; SX4; 2007-2013
Suzuki; SX4 Crossover; 2012
Suzuki; XL-7; 2005-2006

20088 (315 MHz)



Audi; A3, A4, A5 & Quattro; 2008
Audi; A3, A4, A5 & Quattro; 2009-2012
Audi; Q5; 2009-2012
Audi; S4; 2010-2011
Audi; S5; 2008-2012
Audi; TT; 2008-2009
Audi; TT Quattro; 2008-2009
Volkswagen; Beetle; 2007-2010
Volkswagen; CC; 2009-2014
Volkswagen; Eos; 2007-2016
Volkswagen; Golf; 2006-2007
Volkswagen; Golf; 2010
Volkswagen; GTI; 2006-2007; W/16" Or 17" Wheels
Volkswagen; GTI; 2008-2010
Volkswagen; Jetta; 2006-2007
Volkswagen; Jetta; 2008
Volkswagen; Jetta; 2008; exc GLI
Volkswagen; Jetta; 2009
Volkswagen; Jetta; 2009; exc GLI
Volkswagen; Jetta; 2010
Volkswagen; Passat; 2006-2008; W/16" Or 17" Wheels
Volkswagen; Passat; 2009-2011
Volkswagen; R32; 2008-2011
Volkswagen; Rabbit; 2006-2007; W/15" Wheels
Volkswagen; Rabbit; 2008-2009
Volkswagen; Tiguan; 2008-2012

Sensor 20089 (315 MHz)



Dodge; Sprinter; 2007-2009
Freightliner; Sprinter; 2007-2008
Freightliner; Sprinter; 2013
Mercedes-Benz; Sprinter 2500; 2010
Mercedes-Benz; Sprinter 2500; 2011-2012
Mercedes-Benz; Sprinter 3500; 2010-2012

20090 (315 MHz)



Jaguar; Jaguar; 2004-2012; W/315 MHz Sensor
Land Rover; LR2; 2008-2015
Land Rover; LR3; 2006-2009; W/315 MHz Sensor
Land Rover; LR4; 2010-2011; W/315 MHz Sensor
Land Rover; LR4; 2012-2014
Land Rover; Range Rover; 2006-2009; W/315 MHz Sensor
Land Rover; Range Rover; 2010-2011; W/315 MHz Sensor
Land Rover; Range Rover; 2012-2014
Land Rover; Range Rover Evoque; 2012-2015
Land Rover; Range Rover Sport; 2006-2009; W/315 MHz Sensor
Land Rover; Range Rover Sport; 2010-2011; W/315 MHz Sensor
Land Rover; Range Rover Sport; 2012-2014

20091 (433 MHz)



Jaguar; Jaguar; 2004-2012; W/433 MHz Sensor
Land Rover; LR3; 2006-2009; W/433 MHz Sensor
Land Rover; LR4; 2010-2011; W/433 MHz Sensor
Land Rover; Range Rover; 2006-2009; W/433 MHz Sensor
Land Rover; Range Rover; 2010-2011; W/433 MHz Sensor
Land Rover; Range Rover Sport; 2006-2009; W/433 MHz Sensor
Land Rover; Range Rover Sport; 2010-2011; W/433 MHz Sensor

Numerical Listing

Sensor

20092 (315 MHz)



Hyundai; Accent; 2012-2014
 Hyundai; Elantra; 2010; Touring; Includes Transmitter Only
 Hyundai; Elantra; 2011; Touring; Includes Transmitter Only
 Hyundai; Elantra; 2012; Touring; W/Transmitter Only
 Hyundai; Elantra; 2014
 Hyundai; Elantra GT; 2013-2015
 Hyundai; Elantra GT; 2016-2017
 Hyundai; Equus; 2014-2015
 Hyundai; Equus; 2016
 Hyundai; Genesis Coupe; 2010-2012
 Hyundai; Genesis Coupe; 2013
 Hyundai; Genesis Coupe; 2014-2015
 Hyundai; Genesis Coupe; 2016
 Hyundai; Santa Fe; 2013
 Hyundai; Santa Fe; 2014-2016
 Hyundai; Sonata; 2011-2013
 Hyundai; Sonata; 2014
 Kia; Cadenza; 2014-2015
 Kia; Cadenza; 2016
 Kia; Forte; 2010-2013
 Kia; Forte Koup; 2010-2013
 Kia; Forte Koup; 2014
 Kia; Forte5; 2012-2013
 Kia; Optima; 2011-2015
 Kia; Rio5; 2012
 Kia; Sorento; 2011-2014
 Kia; Sorento; 2015
 Kia; Soul; 2010-2013

20093 (315 MHz)



Fiat; 124 Spider; 2017
 Mazda; 2; 2011-2013
 Mazda; 3; 2004
 Mazda; 3; 2005-2012
 Mazda; 3; 2013
 Mazda; 5; 2006-2010
 Mazda; 5; 2012-2013
 Mazda; 6; 2008-2013
 Mazda; CX-5; 2017
 Mazda; CX-7; 2007-2011
 Mazda; CX-9; 2007-2013
 Mazda; MX-5 Miata; 2006-2015
 Mazda; RX-8; 2004
 Mazda; RX-8; 2005-2011


Sensor

20094 (433 MHz)



Mercedes-Benz; C Series; 2007
 Mercedes-Benz; C Series; 2008-2009
 Mercedes-Benz; CL; 2008-2009
 Mercedes-Benz; CLS; 2006
 Mercedes-Benz; CLS550; 2007-2011
 Mercedes-Benz; E320; 2006-2009
 Mercedes-Benz; E350; 2006-2009; W/315 MHz Sensor
 Mercedes-Benz; E500; 2006
 Mercedes-Benz; E55 AMG; 2006
 Mercedes-Benz; E550; 2007-2009; W/315 MHz Sensor
 Mercedes-Benz; E63 AMG; 2007-2009
 Mercedes-Benz; S Series; 2010
 Mercedes-Benz; S550; 2007-2010
 Mercedes-Benz; S600; 2007-2010
 Mercedes-Benz; S63 AMG; 2008-2010
 Mercedes-Benz; S65 AMG; 2007-2010
 Mercedes-Benz; SL500; 2006
 Mercedes-Benz; SL55 AMG; 2006-2008
 Mercedes-Benz; SL550; 2007-2009
 Mercedes-Benz; SL600; 2006-2009
 Mercedes-Benz; SL63 AMG; 2009
 Mercedes-Benz; SL63 AMG; 2011
 Mercedes-Benz; SL65 AMG; 2006-2009
 Mercedes-Benz; SL65 AMG; 2011
 Mercedes-Benz; SLR McLaren; 2008-2009

20095 (433 MHz)

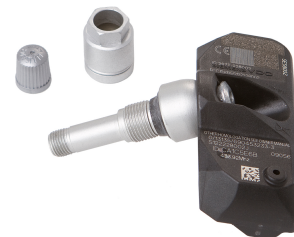

Mercedes-Benz; E350; 2006-2009; W/433 MHz Sensor
 Mercedes-Benz; E550; 2007-2009; W/433 MHz Sensor
 Mercedes-Benz; GL; 2007-2009
 Mercedes-Benz; GL320; 2007-2009
 Mercedes-Benz; ML320; 2007-2009
 Mercedes-Benz; ML350; 2006-2009
 Mercedes-Benz; ML500; 2006-2007
 Mercedes-Benz; ML550; 2008-2009
 Mercedes-Benz; ML63 AMG; 2007-2009
 Mercedes-Benz; R320; 2007-2009
 Mercedes-Benz; R350; 2006-2009
 Mercedes-Benz; R500; 2006-2007
 Mercedes-Benz; R63 AMG; 2007

Numerical Listing


Sensor

20096 (433 MHz)



Ford; Expedition; 2003-2004
 Ford; Explorer; 2002-2003; Exc. Sport
 Ford; Explorer; 2004-2005
 Lincoln; Aviator; 2003-2005
 Lincoln; Navigator; 2003-2004
 Mercury; Mountaineer; 2002-2005

20097 (433 MHz)

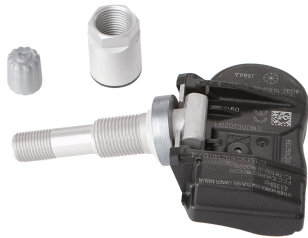

Volvo; C30,C70,S40; 2007-2013
 Volvo; S60,S80; 2007-2009
 Volvo; S60,S80; 2010
 Volvo; S60,S80; 2011-2013
 Volvo; S60,S80; 2014
 Volvo; V50; 2005-2011
 Volvo; V70; 2008-2010
 Volvo; XC60; 2010-2014
 Volvo; XC70; 2008-2014

20098 (315 MHz)



Acura; MDX, RDX; 2007-2012
 Acura; MDX, RDX; 2013
 Acura; TSX; 2007-2014
 Honda; Pilot; 2009; W/Alloy Wheels
 Honda; Pilot; 2010-2011; Exc. LX
 Honda; Pilot; 2012-2014; W/Alloy Wheels
 Honda; Pilot; 2015; W/Alloy Wheels

Sensor

20099 (315 MHz)



Honda; Accord; 2008-2012
 Honda; CR-V; 2007-2011
 Honda; Fit; 2008

20100 (315 MHz)



Honda; Accord Crosstour; 2010-2015
 Honda; Crosstour; 2010-2015
 Honda; CR-V; 2012-2013

Numerical Listing

Sensor 20103 (433 MHz)	Sensor 20107 (315 MHz)
<p>Aston Martin; DB11; 2017 Audi; A6; 2009; Includes Transmitter Only; Quattro Audi; A6; 2010; Includes Transmitter Only Audi; A6 Quattro; 2010; Includes Transmitter Only Audi; Q7; 2010; Includes Transmitter Only Audi; Q7; 2012; Includes Transmitter Only Audi; R8; 2010; Includes Transmitter Only Audi; R8; 2011 Audi; R8; 2012; Includes Transmitter Only Audi; R8; 2014-2015; Includes Transmitter Only Audi; R8; 2017-2018; Includes Transmitter Only Audi; RS7; 2014-2016 Audi; RS7; 2017-2018 Audi; S6; 2010; Includes Transmitter Only Audi; TT RS; 2018 Bentley; Azure; 2007-2009; Includes Transmitter Only Bentley; Bentayga; 2017-2018; Includes Transmitter Only Bentley; Continental; 2012-2017; Includes Transmitter Only Bentley; Continental; 2018; Includes Transmitter Only Bentley; Flying Spur; 2014-2018 Bentley; Mulsanne; 2011-2017; Includes Transmitter Only Ferrari; 488 GTB; 2017 Ferrari; 488 Spider; 2017 Ferrari; California T; 2017 Ferrari; F12 Berlinetta; 2017 Ferrari; GTC4Lusso; 2017 Lamborghini; Aventador; 2017 Lamborghini; Huracan; 2017 Maserati; GranTurismo; 2016-2017 Porsche; 911; 2010; Includes Transmitter Only Porsche; 911; 2012 Porsche; 911; 2013-2014 Porsche; 911; 2015 Porsche; 911; 2016 Porsche; 918 Spyder; 2015-2016 Porsche; Boxster; 2014-2016 Porsche; Cayenne; 2011-2013; Includes Transmitter Only Porsche; Cayenne; 2014-2016 Porsche; Cayenne; 2017 Porsche; Cayman; 2012-2016 Porsche; Macan; 2016-2017 Porsche; Panamera; 2014 Porsche; Panamera; 2015-2016 Volkswagen; Touareg; 2010; Includes Transmitter Only Volkswagen; Touareg; 2011-2013; W/433 MHz Sensor; Includes Transmitter Only Volkswagen; Touareg; 2014-2017; W/433 MHz Sensor; Includes Transmitter Only</p>	<p>Cadillac; Escalade; 2005-2006 Chevrolet; Silverado Series; 2005-2006 Chevrolet; Silverado Series; 2007; Classic Chevrolet; Suburban; 2005-2006 Chevrolet; Tahoe; 2005-2006 GMC; Sierra Series; 2005-2006 GMC; Sierra Series; 2007; Classic GMC; Yukon; 2005-2006</p>
	<h3>20115 (315 MHz)</h3>
	<p>Cadillac; Escalade; 2004 Chevrolet; Silverado Series; 2004 Chevrolet; Suburban; 2004 Chevrolet; Tahoe; 2004 GMC; Sierra Series; 2004 GMC; Yukon; 2004</p>
	<h3>20116 (315 MHz)</h3>
	<p>Buick; Rainier; 2006-2007; OEM Part No. 25774006 Cadillac; CTS; 2004-2007 Cadillac; SRX; 2004-2006 Chevrolet; SSR; 2006; OEM Part No. 25774006 Chevrolet; Trailblazer; 2006-2009; OEM Part No. 25774006 GMC; Envoy; 2006 GMC; Envoy; 2007-2009 Isuzu; Ascender; 2006-2008 Saab; 9-7x; 2005-2009</p>

Numerical Listing

Sensor

20117 (315 MHz)



Cadillac; DeVille; 2001-2005
Cadillac; Seville; 2001-2004
Chevrolet; Corvette; 2001-2004

20131 (315 MHz)



Chevrolet; Colorado; 2007-2012
GMC; Canyon; 2007-2012
Hummer; H3; 2006-2010
Hummer; H3T; 2009-2010
Isuzu; i-290; 2007-2008
Isuzu; i-370; 2007-2008
Pontiac; Montana; 2009

20135 (315 MHz)



Ford; Expedition; 2005-2006
Ford; Freestar; 2004-2005; W/Aluminium Valve Stem
Lincoln; Navigator; 2005-2006
Mercury; Monterey; 2004-2005

Sensor

20153 (315 MHz)



Buick; Allure; 2009
Buick; Enclave; 2009-2015
Buick; Enclave; 2016
Buick; LaCrosse; 2009
Buick; Lucerne; 2007-2011
Cadillac; CTS; 2008
Cadillac; CTS; 2009-2011; OEM Part No. 25920615; Exc. CTS V
Cadillac; CTS; 2012; OEM Part No. 25920615; Exc. CTS V
Cadillac; CTS; 2013; OEM Part No. 25920615; Exc. CTS V
Cadillac; DTS; 2007-2011
Cadillac; Escalade; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
Cadillac; Escalade; 2008; OEM Part No. 25799331; OEM Part No. 15922396
Cadillac; Escalade; 2009-2011
Cadillac; Escalade; 2012-2013
Cadillac; SRX; 2007-2009
Cadillac; STS; 2009; OEM Part No. 25920615; Exc. STS V
Cadillac; STS; 2010; OEM Part No. 15922396; OEM Part No. 25920615
Cadillac; STS; 2011
Chevrolet; Avalanche; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
Chevrolet; Avalanche; 2008; OEM Part No. 25799331; OEM Part No. 15922396
Chevrolet; Avalanche; 2009-2013
Chevrolet; Aveo; 2007; Hatchback
Chevrolet; Aveo; 2008-2011
Chevrolet; Aveo5; 2007; Hatchback
Chevrolet; Aveo5; 2008-2011
Chevrolet; Captiva Sport; 2012-2013
Chevrolet; Captiva Sport; 2017
Chevrolet; Cobalt; 2008; Snap-In Style Only; W/Rubber Valve Stem
Chevrolet; Cobalt; 2009; Snap-In Style Only; W/Rubber Valve Stem
Chevrolet; Express; 2010-2015
Chevrolet; Express; 2016-2018
Chevrolet; HHR; 2008-2009; Snap-In Style Only; W/Rubber Valve Stem
Chevrolet; HHR; 2011
Chevrolet; Impala; 2007; Snap-In Style Only; W/Rubber Valve Stem
Chevrolet; Impala; 2008-2013
Chevrolet; Malibu; 2008; Snap-In Style Only; W/Rubber Valve Stem
Chevrolet; Malibu; 2009
Chevrolet; Malibu; 2011-2012
Chevrolet; Monte Carlo; 2007; Snap-In Style Only; W/Rubber Valve Stem
Chevrolet; Silverado Series; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic
Chevrolet; Silverado Series; 2008
Chevrolet; Silverado Series; 2008; W/Single Rear Wheels
Chevrolet; Silverado Series; 2009
Chevrolet; Silverado Series; 2009; W/Single Rear Wheels
Chevrolet; Silverado Series; 2010
Chevrolet; Silverado Series; 2010; W/Single Rear Wheels
Chevrolet; Silverado Series; 2011
Chevrolet; Silverado Series; 2011; W/Single Rear Wheels
Chevrolet; Silverado Series; 2012
Chevrolet; Silverado Series; 2012; W/Single Rear Wheels
Chevrolet; Silverado Series; 2013; W/Single Rear Wheels
Chevrolet; Suburban; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
Chevrolet; Suburban; 2008-2014
Chevrolet; Tahoe; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
Chevrolet; Tahoe; 2008-2013

Numerical Listing

Chevrolet; Traverse; 2009-2015
 Chevrolet; Traverse; 2016-2018
 GMC; Acadia; 2009-2015
 GMC; Acadia; 2016-2017
 GMC; Savana Series; 2010-2015
 GMC; Savana Series; 2016-2018
 GMC; Sierra Series; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic
 GMC; Sierra Series; 2008
 GMC; Sierra Series; 2008; W/Single Rear Wheels
 GMC; Sierra Series; 2009
 GMC; Sierra Series; 2009; W/Single Rear Wheels
 GMC; Sierra Series; 2010
 GMC; Sierra Series; 2010; W/Single Rear Wheels
 GMC; Sierra Series; 2011
 GMC; Sierra Series; 2011; W/Single Rear Wheels
 GMC; Sierra Series; 2012
 GMC; Sierra Series; 2012; W/Single Rear Wheels
 GMC; Sierra Series; 2013; W/Single Rear Wheels
 GMC; Yukon; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
 GMC; Yukon; 2008-2013
 Hummer; H2; 2008-2009
 Pontiac; G Series; 2008
 Pontiac; G Series; 2009-2010
 Pontiac; Grand Prix; 2008; Snap-In Style Only; W/Rubber Valve Stem
 Pontiac; Wave; 2008
 Saturn; Aura; 2008-2009
 Saturn; Outlook; 2009-2010
 Saturn; Vue; 2007-2010
 Suzuki; Foreza; 2007-2008
 Suzuki; Reno; 2007-2008

20154 (433)



Cadillac; CT6; 2016; Exc. ZL1
 Chevrolet; Cruze; 2016
 Chevrolet; Malibu; 2016-2018
 Chevrolet; Malibu Limited; 2015-2018
 Chevrolet; Volt; 2017-2018; Exc. ZL1

20156 (315 MHz)



Volvo; S60,S80; 2004
 Volvo; S60,S80; 2004; W/315 MHz Sensor
 Volvo; S60,S80; 2005
 Volvo; S60,S80; 2005; W/315 MHz Sensor
 Volvo; S60,S80; 2006-2009
 Volvo; V70; 2004-2007; W/315 MHz Sensor
 Volvo; XC70; 2004-2007; W/315 MHz Sensor
 Volvo; XC90; 2004
 Volvo; XC90; 2005-2007; W/315 MHz Sensor
 Volvo; XC90; 2008-2011; W/315 MHz Sensor

Sensor

20158 (315 MHz)



Buick; Allure; 2007-2008
 Buick; Enclave; 2008
 Buick; LaCrosse; 2006
 Buick; LaCrosse; 2007-2008
 Cadillac; CTS; 2009-2011; OEM Part No. 15268606; CTS V; W/315 MHz Sensor
 Cadillac; CTS; 2012; OEM Part No. 15268606; CTS V; W/315 MHz Sensor
 Cadillac; CTS; 2013; OEM Part No. 15268606; CTS V; W/315 MHz Sensor
 Cadillac; DTS; 2006
 Cadillac; Escalade; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Chevrolet; Avalanche; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Chevrolet; Caprice; 2011-2013
 Chevrolet; Cobalt; 2008; Clamp-In Style Only; W/Aluminium Valve Stem
 Chevrolet; Corvette; 2010-2011
 Chevrolet; Corvette; 2012; Z06; Base
 Chevrolet; Corvette; 2013
 Chevrolet; Equinox; 2007-2009
 Chevrolet; Express; 2008-2009
 Chevrolet; HHR; 2008-2009; Clamp-In Style Only; W/Aluminium Valve Stem
 Chevrolet; Impala; 2006; W/Alloy Wheels
 Chevrolet; Impala; 2007; Clamp-In Style Only; W/Aluminium Valve Stem
 Chevrolet; Malibu; 2008; Clamp-In Style Only; W/Aluminium Valve Stem
 Chevrolet; Monte Carlo; 2006; W/Alloy Wheels
 Chevrolet; Monte Carlo; 2007; Clamp-In Style Only; W/Aluminium Valve Stem
 Chevrolet; Silverado Series; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic
 Chevrolet; Suburban; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Chevrolet; Tahoe; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Chevrolet; Uplander; 2008-2009
 GMC; Acadia; 2007-2008
 GMC; Savana Series; 2008-2009
 GMC; Sierra Series; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic
 GMC; Yukon; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Pontiac; G Series; 2008
 Pontiac; Grand Prix; 2007
 Pontiac; Grand Prix; 2008; Clamp-In Style Only; W/Aluminium Valve Stem
 Pontiac; Montana; 2008
 Pontiac; Solstice; 2008-2009
 Pontiac; Torrent; 2007-2009
 Saturn; Aura; 2007
 Saturn; Outlook; 2007-2008
 Saturn; Sky; 2008-2010
 Suzuki; XL-7; 2007-2009

Numerical Listing

Sensor

20159 (433 MHz)



Lotus; Elise; 2008-2015
 Lotus; Evora; 2010-2013
 Lotus; Evora; 2015
 Lotus; Exige; 2008-2015
 Saab; 9-3; 2008-2011
 Saab; 9-3X; 2010-2011
 Saab; 9-5; 2008-2011

20161 (315 MHz)



Infiniti; QX56; 2005-2006; W/Alloy Wheels
 Infiniti; QX56; 2007; Mar. & Older
 Nissan; Armada; 2005-2006; W/Alloy Wheels
 Nissan; Armada; 2007
 Nissan; Armada; 2008; SE
 Nissan; Frontier; 2005-2007; W/Alloy Wheels
 Nissan; Frontier; 2008; W/Alloy Wheels
 Nissan; Maxima; 2006; Jun. & Newer
 Nissan; Maxima; 2007; Mar. & Older
 Nissan; Pathfinder; 2005-2006
 Nissan; Quest; 2005-2006; W/Alloy Wheels
 Nissan; Sentra; 2007; W/Alloy Wheels
 Nissan; Titan; 2005; Apr. 1 & Newer
 Nissan; Titan; 2006
 Nissan; Titan; 2007; Mar. & Older
 Nissan; Xterra; 2005
 Nissan; Xterra; 2006; Exc. Submodel X

Sensor

20213 (433 MHz)



Infiniti; Q30; 2016
 Infiniti; QX30; 2016
 Mercedes-Benz; B200; 2014
 Mercedes-Benz; B200; 2015-2016
 Mercedes-Benz; B200; 2017-2018
 Mercedes-Benz; B250; 2015
 Mercedes-Benz; B250; 2016
 Mercedes-Benz; B250; 2017-2018
 Mercedes-Benz; B250e; 2016-2018
 Mercedes-Benz; C Series; 2014-2015
 Mercedes-Benz; C Series; 2016-2018
 Mercedes-Benz; C250; 2014-2018
 Mercedes-Benz; C350e; 2016-2018
 Mercedes-Benz; C63 AMG S; 2015-2018
 Mercedes-Benz; CLA250; 2014-2016
 Mercedes-Benz; CLA250; 2017-2018
 Mercedes-Benz; CLA45 AMG; 2014-2016
 Mercedes-Benz; CLA45 AMG; 2017-2018
 Mercedes-Benz; CLS550; 2014-2016
 Mercedes-Benz; CLS63 AMG S; 2014-2016
 Mercedes-Benz; E250; 2014-2016
 Mercedes-Benz; E250; 2017
 Mercedes-Benz; E350; 2014-2016
 Mercedes-Benz; E350; 2017
 Mercedes-Benz; E400; 2014-2016
 Mercedes-Benz; E400; 2017
 Mercedes-Benz; E550; 2014-2016
 Mercedes-Benz; E550; 2017
 Mercedes-Benz; E63 AMG; 2014-2016
 Mercedes-Benz; E63 AMG; 2017
 Mercedes-Benz; E63 AMG S; 2014-2016
 Mercedes-Benz; E63 AMG S; 2017
 Mercedes-Benz; G550; 2014-2016
 Mercedes-Benz; G550; 2017-2018
 Mercedes-Benz; G63 AMG; 2014-2016
 Mercedes-Benz; G63 AMG; 2017-2018
 Mercedes-Benz; G65 AMG; 2016-2018
 Mercedes-Benz; GL; 2014-2016
 Mercedes-Benz; GL; 2017-2018
 Mercedes-Benz; GL350; 2014-2015
 Mercedes-Benz; GL350; 2016-2018
 Mercedes-Benz; GL63 AMG; 2014-2016
 Mercedes-Benz; GL63 AMG; 2017-2018
 Mercedes-Benz; GLA250; 2015-2018
 Mercedes-Benz; GLA45 AMG; 2015-2018
 Mercedes-Benz; GLC300; 2016-2018
 Mercedes-Benz; GLC43 AMG; 2017-2018
 Mercedes-Benz; GLE300d; 2016-2018
 Mercedes-Benz; GLE350; 2016-2018
 Mercedes-Benz; GLE350d; 2016-2018
 Mercedes-Benz; GLE400; 2016-2018
 Mercedes-Benz; GLE43 AMG; 2017-2018
 Mercedes-Benz; GLE450 AMG; 2016-2018
 Mercedes-Benz; GLE550; 2016-2018
 Mercedes-Benz; GLE550e; 2016-2018
 Mercedes-Benz; GLE63 AMG; 2016-2018
 Mercedes-Benz; GLE63 AMG S; 2016-2018
 Mercedes-Benz; GLK250; 2014-2016
 Mercedes-Benz; GLK250; 2017
 Mercedes-Benz; GLK350; 2014-2016

Numerical Listing

Mercedes-Benz; GLK350; 2017
 Mercedes-Benz; GLS350d; 2017
 Mercedes-Benz; GLS450; 2017
 Mercedes-Benz; ML250; 2015-2018
 Mercedes-Benz; ML350; 2015
 Mercedes-Benz; ML350; 2016-2018
 Mercedes-Benz; ML400; 2015-2018
 Mercedes-Benz; ML550; 2015-2016
 Mercedes-Benz; ML550; 2017-2018
 Mercedes-Benz; ML63 AMG; 2014-2016
 Mercedes-Benz; ML63 AMG; 2017-2018
 Mercedes-Benz; S Series; 2013
 Mercedes-Benz; S Series; 2014-2016
 Mercedes-Benz; S Series; 2017-2018
 Mercedes-Benz; S550; 2014-2016
 Mercedes-Benz; S550; 2017-2018
 Mercedes-Benz; S550e; 2017-2018
 Mercedes-Benz; S600; 2014-2016
 Mercedes-Benz; S600; 2017-2018
 Mercedes-Benz; S63 AMG; 2014-2016
 Mercedes-Benz; S63 AMG; 2017-2018
 Mercedes-Benz; S65 AMG; 2017-2018
 Mercedes-Benz; SL400; 2017-2018
 Mercedes-Benz; SL450; 2017-2018
 Mercedes-Benz; SL550; 2014-2016
 Mercedes-Benz; SL550; 2017-2018
 Mercedes-Benz; SL63 AMG; 2014-2016
 Mercedes-Benz; SL63 AMG; 2017-2018
 Mercedes-Benz; SL65 AMG; 2014-2018
 Mercedes-Benz; SLC300; 2017-2018
 Mercedes-Benz; SLC43 AMG; 2017-2018
 Mercedes-Benz; SLK250; 2014-2016
 Mercedes-Benz; SLK250; 2017
 Mercedes-Benz; SLK350; 2014-2016
 Mercedes-Benz; SLK350; 2017
 Mercedes-Benz; SLK55 AMG; 2014
 Mercedes-Benz; SLK55 AMG; 2015-2017
 Mercedes-Benz; SLS AMG; 2014-2015
 Mercedes-Benz; Sprinter 2500; 2014-2015
 Mercedes-Benz; Sprinter 3500; 2014-2016
 Mercedes-Benz; Sprinter 3500; 2017
 Mercedes-Benz; Sprinter 3500; 2018
 Smart; Fortwo; 2014
 Smart; Fortwo; 2015


20218 (433 MHz)



Kia; Sedona; 2015-2017
 Kia; Sedona; 2018
 Kia; Soul; 2014
 Kia; Soul; 2015-2016
 Kia; Soul; 2017-2018
 Kia; Soul EV; 2017

Sensor

20223 (433 MHz WAL)

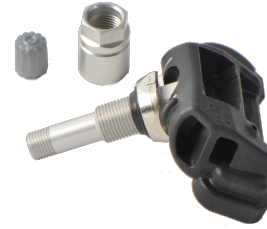

Chevrolet; Corvette; 2014-2015
 Chevrolet; Corvette; 2016-2018

20228 (314.9 MHz)



Chevrolet; Caprice; 2014
 Chevrolet; Caprice; 2015

20280 (315 MHz)



Ford; Edge; 2015-2017
 Ford; Edge; 2018
 Ford; Expedition; 2018
 Ford; Explorer; 2016-2017
 Ford; Explorer; 2018
 Ford; F-150; 2015-2018
 Ford; Mustang; 2015
 Ford; Mustang; 2016
 Ford; Mustang; 2017
 Lincoln; Continental; 2017
 Lincoln; Mark LT; 2015-2016
 Lincoln; MKX; 2015-2017

20281 (433 MHz)



Hyundai; Sonata; 2015-2017
 Hyundai; Sonata; 2018
 Hyundai; Tucson; 2015-2017
 Hyundai; Tucson; 2018

Numerical Listing

Sensor

20283 (314.9 MHz)



GMC; Sierra Series; 2018; W/Single Rear Wheels
 GMC; Terrain; 2018
 GMC; Yukon; 2018
 GMC; Yukon XL; 2017-2018

20284 (433 MHz)



Alfa Romeo; 4C; 2017
 Maserati; Ghibli; 2014-2016
 Maserati; Quattroporte; 2014-2016

Sensor

20315 (315 MHz)



Ford; C-Max; 2012-2015
 Ford; C-Max; 2016-2018
 Ford; Edge; 2011-2014
 Ford; Escape; 2009-2010
 Ford; Escape; 2011
 Ford; Escape; 2012-2015
 Ford; Escape; 2016-2018
 Ford; E-Series Van; 2010
 Ford; E-Series Van; 2010; W/Steel Wheels
 Ford; E-Series Van; 2011-2013
 Ford; E-Series Van; 2014-2015
 Ford; E-Series Van; 2016-2018
 Ford; Expedition; 2011-2015
 Ford; Expedition; 2016-2017
 Ford; Explorer; 2011-2014
 Ford; Explorer; 2015
 Ford; F-150; 2009-2014
 Ford; F-250 Super Duty; 2011-2015
 Ford; F-250 Super Duty; 2016
 Ford; F-250 Super Duty; 2017; Rubber Valve
 Ford; F-350 Super Duty; 2011-2015
 Ford; F-350 Super Duty; 2016
 Ford; F-450 Super Duty; 2014-2016
 Ford; Fiesta; 2011-2015
 Ford; Fiesta; 2016-2018
 Ford; Flex; 2011-2015
 Ford; Flex; 2016-2018
 Ford; Focus; 2010
 Ford; Focus; 2011
 Ford; Focus; 2012-2015
 Ford; Focus; 2016
 Ford; Focus; 2017-2018
 Ford; Fusion; 2010-2015
 Ford; Fusion; 2016
 Ford; Mustang; 2010-2011
 Ford; Mustang; 2012; exc Shelby GT500
 Ford; Mustang; 2013; exc Shelby GT500
 Ford; Mustang; 2014; exc Shelby GT500
 Ford; Taurus; 2010; May & Newer
 Ford; Taurus; 2011-2015
 Ford; Taurus; 2016-2018
 Ford; Transit; 2014-2015
 Ford; Transit; 2016-2018
 Ford; Transit Connect; 2010-2015
 Ford; Transit Connect; 2016-2018
 Lincoln; Cuv; 2014-2016
 Lincoln; Cuv; 2017
 Lincoln; Mark LT; 2013-2014
 Lincoln; MKC; 2015
 Lincoln; MKC; 2016-2017
 Lincoln; MKS; 2011-2015
 Lincoln; MKS; 2016
 Lincoln; MKS; 2017
 Lincoln; MKT; 2011-2016
 Lincoln; MKT; 2017-2018
 Lincoln; MKX; 2011-2014
 Lincoln; MKZ; 2010-2015
 Lincoln; MKZ; 2016
 Lincoln; Navigator; 2011-2015
 Lincoln; Navigator; 2016-2017

Numerical Listing

Lincoln; Town Car; 2011
 Mazda; Tribute; 2009-2011
 Mercury; Mariner; 2009-2011
 Mercury; Milan; 2010-2011
 VPG; MV-1; 2011
 VPG; MV-1; 2012
 VPG; MV-1; 2013-2016

20335 (315 MHz)



Chrysler; Pacifica; 2004; OEM Part No. 04727392AD (315 MHz)
 Chrysler; Pacifica; 2005
 Chrysler; Town & Country; 2004-2005
 Dodge; Caravan; 2004-2005
 Dodge; Grand Caravan; 2004-2005

Sensor

20398 (433 MHz)



Alfa Romeo; 4C; 2012-2016
 Chrysler; 300; 2010
 Chrysler; 300; 2011
 Chrysler; 300; 2012; W/Rubber Stem Snap-in Sensor
 Chrysler; 300; 2013-2015
 Chrysler; 300; 2016-2018
 Chrysler; Town & Country; 2011-2015
 Chrysler; Town & Country; 2016-2018
 Dodge; Challenger; 2010-2012; W/Rubber Stem Snap-in Sensor
 Dodge; Challenger; 2013-2015; W/Rubber Stem Snap-in Sensor
 Dodge; Challenger; 2016-2018; W/Rubber Stem Snap-in Sensor
 Dodge; Charger; 2010; W/Rubber Stem Snap-in Sensor
 Dodge; Charger; 2011; W/Rubber Stem Snap-in Sensor
 Dodge; Charger; 2012-2015
 Dodge; Charger; 2016-2018
 Dodge; Durango; 2011-2015
 Dodge; Grand Caravan; 2011-2015
 Dodge; Grand Caravan; 2016-2018
 Dodge; Journey; 2010; OEM No. 56029398AA; Rubber Valve
 Dodge; Journey; 2011-2015
 Dodge; Journey; 2016-2018
 Dodge; Ram 4500; 2010; W/Rubber Stem Snap-in Sensor
 Dodge; Ram 5500; 2010; W/Rubber Stem Snap-in Sensor
 Dodge; Ram Series; 2010; W/Rubber Stem Snap-in Sensor
 Fiat; 500; 2012-2015
 Fiat; 500; 2016-2018
 Fiat; 500X; 2017
 Jeep; Grand Cherokee; 2011-2015
 Jeep; Wrangler; 2013-2015
 Jeep; Wrangler; 2016-2018
 Ram; 4500; 2012
 Ram; 5500; 2012
 Ram; C/V; 2012; Rubber Valve
 Ram; C/V; 2013-2015
 Ram; ProMaster; 2014-2015
 Ram; ProMaster; 2016-2018
 Ram; Promaster City; 2015-2016
 Ram; Promaster City; 2017-2018
 Ram; Ram Series; 2011; W/Rubber Stem Snap-in Sensor
 Ram; Ram Series; 2012-2013
 Volkswagen; Routan; 2011-2013
 Volkswagen; Routan; 2014

Numerical Listing

Sensor 20602



Subaru; Crosstrek; 2017
 Subaru; Crosstrek; 2018
 Subaru; Forester; 2017-2018
 Subaru; Impreza; 2017-2018
 Subaru; Legacy; 2017-2018
 Subaru; Outback; 2017
 Subaru; Outback; 2018
 Subaru; WRX; 2017-2018

20720 (433 MHz)



Acura; TL; 2009-2013
 Acura; ZDX; 2010-2013

28004 (315 MHz)



Chrysler; Prowler; 2001
 Plymouth; Prowler; 1997
 Plymouth; Prowler; 1998
 Plymouth; Prowler; 1999-2001

28006 (315 MHz)



Chevrolet; Corvette; 1997-2000

Sensor 28070 (315 MHz)



Kia; Forte; 2014-2015

28078 (433 MHz)



Saab; 9-3; 2003-2007
 Saab; 9-5; 2003-2007
 Saturn; Astra; 2008-2009

Numerical Listing

Sensor

28081 (433 MHz)



BMW; 1 Series; 2008; Includes Transmitter Only
 BMW; 1 Series; 2011-2013; Includes Transmitter Only
 BMW; 328i; 2009; Includes Transmitter Only
 BMW; 328i; 2010-2013; Includes Transmitter Only
 BMW; 328i xDrive; 2009; Includes Transmitter Only
 BMW; 328i xDrive; 2010-2013; Includes Transmitter Only
 BMW; 335d; 2010-2011; Includes Transmitter Only
 BMW; 335i; 2009; Includes Transmitter Only
 BMW; 335i; 2010-2012; Includes Transmitter Only
 BMW; 335i xDrive; 2009; Includes Transmitter Only
 BMW; 335i xDrive; 2010-2012; Includes Transmitter Only
 BMW; 335is; 2012-2013; Includes Transmitter Only
 BMW; 528; 2012-2014; Includes Transmitter Only
 BMW; 528; 2015-2016
 BMW; 535; 2011; Includes Transmitter Only
 BMW; 535; 2012-2014; Includes Transmitter Only
 BMW; 535d; 2014; Includes Transmitter Only
 BMW; 535d xDrive; 2014; Includes Transmitter Only
 BMW; 550; 2012-2014; Includes Transmitter Only
 BMW; 640; 2012-2015; Includes Transmitter Only
 BMW; 640; 2016
 BMW; 650; 2012-2015; Includes Transmitter Only
 BMW; 650; 2016
 BMW; 740i; 2011; Includes Transmitter Only
 BMW; 740i; 2012-2014; Includes Transmitter Only
 BMW; 740i; 2015-2016; Includes Transmitter Only
 BMW; 740Li; 2011; Includes Transmitter Only
 BMW; 740Li; 2012-2016; Includes Transmitter Only
 BMW; 740Li xDrive; 2013-2016; Includes Transmitter Only
 BMW; 750; 2011; Includes Transmitter Only
 BMW; 750; 2012-2016; Includes Transmitter Only
 BMW; 760Li; 2011; Includes Transmitter Only
 BMW; 760Li; 2012-2014
 BMW; ActiveHybrid 3; 2013-2014
 BMW; ActiveHybrid 3; 2015
 BMW; ActiveHybrid 5; 2012-2014; Includes Transmitter Only
 BMW; ActiveHybrid 5; 2015
 BMW; ActiveHybrid 7; 2013-2015; Includes Transmitter Only
 BMW; Alpina B7; 2011-2015; Includes Transmitter Only
 BMW; Alpina B7 xDrive; 2011; Includes Transmitter Only
 BMW; Alpina B7L xDrive; 2011; Includes Transmitter Only
 BMW; M; 2011-2012; Includes Transmitter Only
 BMW; M; 2013; Includes Transmitter Only
 BMW; M; 2014; Includes Transmitter Only
 BMW; X; 2011
 BMW; X; 2011; Includes Transmitter Only
 BMW; X; 2012-2014; Includes Transmitter Only
 BMW; X; 2015; Includes Transmitter Only
 BMW; X; 2016
 BMW; Z4; 2012-2015; Includes Transmitter Only
 BMW; Z4; 2016
 Mini; Cooper; 2009; Includes Transmitter Only
 Mini; Cooper; 2010-2013; Includes Transmitter Only
 Mini; Cooper; 2014; Transmitter only
 Rolls Royce; Ghost; 2011-2016; Includes Transmitter Only
 Rolls Royce; Ghost; 2017; Includes Transmitter Only
 Rolls Royce; Phantom; 2012-2015; Includes Transmitter Only
 Rolls Royce; Phantom; 2016-2017; Includes Transmitter Only
 Rolls Royce; Silver Dawn; 2016; Includes Transmitter Only
 Rolls Royce; Wraith; 2014-2015; Includes Transmitter Only

Rolls Royce; Wraith; 2016-2017; Includes Transmitter Only

28082 (433 MHz)



BMW; X; 1999-2004; Includes Transmitter Only
 Land Rover; LR3; 2002-2004; Includes Transmitter Only
 Land Rover; LR3; 2005; Includes Transmitter Only
 Land Rover; Range Rover; 2002; Includes Transmitter Only
 Land Rover; Range Rover; 2003-2005; Includes Transmitter Only

28087 (433 MHz)



Porsche; 911; 2005-2006; Includes Transmitter Only
 Porsche; 911; 2007-2009; Includes Transmitter Only
 Porsche; 911; 2010; Includes Transmitter Only
 Porsche; 911; 2012; Includes Transmitter Only
 Porsche; Boxster; 2005-2007; Includes Transmitter Only
 Porsche; Boxster; 2008-2010; Includes Transmitter Only
 Porsche; Carrera GT; 2004-2005; Includes Transmitter Only
 Porsche; Cayenne; 2003-2006; Includes Transmitter Only
 Porsche; Cayman; 2009-2010; Includes Transmitter Only
 Porsche; Cayman; 2011; Includes Transmitter Only
 Porsche; Panamera; 2010; Includes Transmitter Only
 Porsche; Panamera; 2011; Includes Transmitter Only

28096 (315 MHz)



Mitsubishi; i-MiEV; 2012-2016
 Mitsubishi; i-MiEV; 2017
 Mitsubishi; Lancer; 2006-2007
 Mitsubishi; Lancer; 2008-2010
 Mitsubishi; Lancer; 2011
 Mitsubishi; Lancer; 2012
 Mitsubishi; Lancer; 2013-2014
 Mitsubishi; Lancer; 2015-2017
 Mitsubishi; Mirage; 2014
 Mitsubishi; Outlander; 2007-2010
 Mitsubishi; Outlander; 2011-2015
 Mitsubishi; Outlander; 2016-2017
 Mitsubishi; Outlander Sport; 2011-2015
 Mitsubishi; Outlander Sport; 2016-2018
 Mitsubishi; RVR; 2011-2014
 Mitsubishi; RVR; 2015
 Mitsubishi; RVR; 2016-2017

Numerical Listing

Sensor

28126 (433 MHz)



BMW; 228i; 2014
 BMW; 228i; 2015
 BMW; 320i; 2014
 BMW; 320i xDrive; 2014
 BMW; 328d; 2014
 BMW; 328d xDrive; 2014
 BMW; 328i; 2014-2016; Includes Transmitter Only
 BMW; 328i GT xDrive; 2014-2016; Includes Transmitter Only
 BMW; 328i xDrive; 2014-2015; Includes Transmitter Only
 BMW; 335i; 2013-2014; Includes Transmitter Only
 BMW; 335i GT xDrive; 2014-2015; Includes Transmitter Only
 BMW; 335i xDrive; 2013-2015; Includes Transmitter Only
 BMW; 428i; 2014; Includes Transmitter Only
 BMW; 428i; 2015
 BMW; 428i; 2016
 BMW; 428i xDrive; 2014
 BMW; 428i xDrive; 2015
 BMW; 435i; 2014
 BMW; 435i; 2015
 BMW; 435i; 2016
 BMW; 435i xDrive; 2014
 BMW; 435i xDrive; 2015
 BMW; 528; 2015-2016
 BMW; 535; 2015-2016
 BMW; 535d; 2015-2016
 BMW; 535d xDrive; 2015-2016
 BMW; 550; 2015-2016
 BMW; 640; 2016
 BMW; 650; 2016
 BMW; 650i Gran Coupe xDrive; 2016
 BMW; 750; 2015-2016; Includes Transmitter Only
 BMW; 760Li; 2015
 BMW; 760Li; 2016
 BMW; M; 2015
 BMW; M; 2015; Includes Transmitter Only
 BMW; M; 2016
 BMW; M; 2016; Includes Transmitter Only
 BMW; X; 2015
 BMW; X; 2015; Includes Transmitter Only
 BMW; X; 2016
 BMW; X; 2016; Includes Transmitter Only
 Mini; Cooper; 2014; Includes Transmitter Only
 Mini; Cooper; 2014; Transmitter only
 Mini; Cooper; 2015-2016
 Rolls Royce; Dawn; 2017

Sensor

28128 (315 MHz)



Acura; MDX, RDX; 2013
 Acura; MDX, RDX; 2014-2015
 Acura; RLX; 2014-2017
 Acura; RLX; 2018

28129 (315 MHz)





Mitsubishi; Eclipse; 2006-2007; W/Steel Wheels
 Mitsubishi; Eclipse; 2012; W/Steel Wheels
 Mitsubishi; Endeavor; 2011; W/Steel Wheels
 Mitsubishi; Galant; 2007-2009; W/Steel Wheels
 Mitsubishi; Galant; 2010-2012; W/Steel Wheels

28167 (315 MHz)



Nissan; Pathfinder; 2007; OEM Part No. 40700JA01A
 Nissan; Versa; 2007; OEM Part No. 40700JA01A
 Nissan; Xterra; 2007; OEM Part No. 40700JA01A

Numerical Listing

Sensor 28203 (315 MHz)	Sensor 28204 (315 MHz)
	
<p>Subaru; Forester; 2008-2015 Subaru; Forester; 2016 Subaru; Impreza; 2008-2015 Subaru; Impreza; 2016 Subaru; Legacy; 2008; W/18" Wheels Subaru; Legacy; 2009-2015 Subaru; Legacy; 2016 Subaru; Outback; 2008-2015 Subaru; Outback; 2016-2017 Subaru; Tribeca; 2008; W/Rubber Stem Snap-in Sensor Subaru; Tribeca; 2009; W/Rubber Stem Snap-in Sensor Subaru; Tribeca; 2010; W/Rubber Stem Snap-in Sensor Subaru; Tribeca; 2011; W/Rubber Stem Snap-in Sensor Subaru; Tribeca; 2012-2014 Subaru; WRX; 2013-2015 Subaru; WRX; 2016 Subaru; XV Crosstrek; 2013-2015 Subaru; XV Crosstrek; 2016</p>	<p>Infiniti; FX35; 2007; Jul. & Newer Infiniti; FX35; 2008 Infiniti; FX45; 2007; Jul. & Newer Infiniti; FX45; 2008 Infiniti; G35; 2007; Coupe Infiniti; M35; 2008-2010 Infiniti; M35h; 2012 Infiniti; M37; 2011-2012 Infiniti; M45; 2008-2009 Infiniti; M45; 2010 Infiniti; M56; 2011-2012 Infiniti; Q45; 2006; Aug. & Newer Infiniti; QX56; 2007; Apr. 1 & Newer Infiniti; QX56; 2008-2010 Nissan; 350Z; 2007-2009 Nissan; Altima; 2006; Oct. 1 & Newer Nissan; Altima; 2007-2010 Nissan; Altima; 2011-2012 Nissan; Armada; 2008; LE Nissan; Armada; 2009-2011 Nissan; Armada; 2012-2015 Nissan; Armada; 2016 Nissan; Cube; 2009-2010 Nissan; Cube; 2011-2012; non-Ikey Nissan; Frontier; 2008; W/Steel Wheels Nissan; Frontier; 2009-2011 Nissan; Frontier; 2012-2015 Nissan; Frontier; 2016 Nissan; GT-R; 2009 Nissan; GT-R; 2010 Nissan; GT-R; 2011-2016 Nissan; GT-R; 2017-2018 Nissan; Juke; 2011 Nissan; Juke; 2012 Nissan; Maxima; 2007; Apr. 1 & Newer Nissan; Maxima; 2008-2010 Nissan; Maxima; 2011-2012 Nissan; Murano; 2007 Nissan; Murano; 2009 Nissan; Murano; 2010 Nissan; Murano; 2011 Nissan; Murano; 2012-2014 Nissan; NV; 2014-2015 Nissan; NV; 2016 Nissan; Pathfinder; 2007; OEM Part No. 40700JA01B Nissan; Pathfinder; 2008-2011 Nissan; Pathfinder; 2012 Nissan; Quest; 2007-2009 Nissan; Rogue; 2008-2009 Nissan; Rogue; 2011 Nissan; Rogue; 2012 Nissan; Rogue Select; 2014-2015 Nissan; Sentra; 2007; W/Steel Wheels Nissan; Sentra; 2008 Nissan; Sentra; 2009-2010 Nissan; Sentra; 2011-2013 Nissan; Titan; 2007; Apr. 1 & Newer Nissan; Titan; 2008-2011 Nissan; Titan; 2012-2015 Nissan; Versa; 2007; OEM Part No. 40700JA01B</p>

Numerical Listing

Nissan; Versa; 2008-2010
 Nissan; Versa; 2011-2012
 Nissan; Xterra; 2007; OEM Part No. 40700JA01B
 Nissan; Xterra; 2008-2011
 Nissan; Xterra; 2012-2015
 Nissan; Xterra; 2016
 Suzuki; Equator; 2009-2012

Sensor

28206 (314.9 MHz)



Buick; Allure; 2010
 Buick; Cascada; 2016-2017
 Buick; Encore; 2013-2015
 Buick; Encore; 2016-2018
 Buick; Envision; 2016-2018
 Buick; LaCrosse; 2010-2015
 Buick; LaCrosse; 2016
 Buick; Regal; 2011-2016
 Buick; Regal; 2017
 Buick; Verano; 2012-2015
 Buick; Verano; 2016-2018
 Cadillac; ATS; 2013; exc V
 Cadillac; ATS; 2014; exc V
 Cadillac; ATS; 2015; exc V
 Cadillac; ATS; 2016-2018; exc V
 Cadillac; CTS; 2014-2015; exc V
 Cadillac; CTS; 2016-2018; exc V
 Cadillac; ELR; 2014
 Cadillac; ELR; 2015-2017
 Cadillac; Escalade; 2014-2015
 Cadillac; Escalade; 2016-2018
 Cadillac; SRX; 2010-2015
 Cadillac; SRX; 2016
 Cadillac; XTS; 2013-2015
 Cadillac; XTS; 2016-2018
 Chevrolet; Bolt EV; 2017-2018; Exc. ZL1
 Chevrolet; Camaro; 2010-2011
 Chevrolet; Camaro; 2012; exc ZL1; OEM Part No. 20922900; OEM Part No. 22854866
 Chevrolet; Camaro; 2013-2015; Exc. ZL1
 Chevrolet; Caprice; 2017
 Chevrolet; Cobalt; 2010
 Chevrolet; Colorado; 2015
 Chevrolet; Colorado; 2016-2018
 Chevrolet; Cruze; 2011-2015
 Chevrolet; Cruze; 2016
 Chevrolet; Equinox; 2010-2014
 Chevrolet; Equinox; 2015-2018
 Chevrolet; HHR; 2010
 Chevrolet; Impala; 2014-2015
 Chevrolet; Impala; 2016-2018
 Chevrolet; Malibu; 2010
 Chevrolet; Malibu; 2013-2015
 Chevrolet; Orlando; 2012-2014
 Chevrolet; Orlando; 2017
 Chevrolet; Silverado Series; 2014-2015; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2016-2018; W/Single Rear Wheels
 Chevrolet; Sonic; 2012-2015
 Chevrolet; Sonic; 2016-2018
 Chevrolet; Spark; 2013-2015
 Chevrolet; Spark; 2016-2017
 Chevrolet; Suburban; 2014
 Chevrolet; Suburban; 2015
 Chevrolet; Suburban; 2016-2018
 Chevrolet; Tahoe; 2014-2015
 Chevrolet; Tahoe; 2016-2017
 Chevrolet; Trax; 2013-2015
 Chevrolet; Trax; 2016-2017
 Chevrolet; Trax; 2018
 Chevrolet; Volt; 2011-2015

Numerical Listing

Chevrolet; Volt; 2016
 GMC; Canyon; 2015-2018
 GMC; Sierra Series; 2014; W/Single Rear Wheels
 GMC; Sierra Series; 2015; W/Single Rear Wheels
 GMC; Sierra Series; 2016-2017; W/Single Rear Wheels
 GMC; Terrain; 2010-2014
 GMC; Terrain; 2015
 GMC; Terrain; 2016-2017
 GMC; Yukon; 2014-2015
 GMC; Yukon; 2016-2017
 Saab; 9-4X; 2011

28210 (315 MHz)



Infiniti; EX35; 2008-2010
 Infiniti; FX35; 2009-2010
 Infiniti; FX50; 2009-2010
 Infiniti; G35; 2007; Sedan
 Infiniti; G35; 2008
 Infiniti; G37; 2008-2010
 Nissan; 370Z; 2009-2010

28211



Buick; Cascada; 2018
 Chevrolet; Camaro; 2016-2017; ZL1

Sensor

28214 (433 MHz)



Mercedes-Benz; 550,63AMG; 2007-2009
 Mercedes-Benz; C Series; 2007; Jun. & Newer
 Mercedes-Benz; C Series; 2008-2009
 Mercedes-Benz; C Series; 2010-2012
 Mercedes-Benz; C Series; 2013
 Mercedes-Benz; C250; 2012
 Mercedes-Benz; C250; 2013
 Mercedes-Benz; C280; 2007; Mar. & Newer
 Mercedes-Benz; CLK; 2006
 Mercedes-Benz; CLK350; 2006-2009
 Mercedes-Benz; CLS550; 2012
 Mercedes-Benz; CLS550; 2013
 Mercedes-Benz; E350; 2010-2012
 Mercedes-Benz; E350; 2013
 Mercedes-Benz; E550; 2010-2011
 Mercedes-Benz; E550; 2012-2013
 Mercedes-Benz; E63 AMG; 2010-2011
 Mercedes-Benz; E63 AMG; 2012-2013
 Mercedes-Benz; G500; 2007; Mar. & Newer
 Mercedes-Benz; G500; 2008
 Mercedes-Benz; G55 AMG; 2007; Mar. & Newer
 Mercedes-Benz; G55 AMG; 2008-2010
 Mercedes-Benz; G55 AMG; 2011
 Mercedes-Benz; G550; 2009-2010
 Mercedes-Benz; G550; 2011
 Mercedes-Benz; G550; 2012-2013
 Mercedes-Benz; GL; 2010
 Mercedes-Benz; GL; 2011
 Mercedes-Benz; GL; 2012-2013
 Mercedes-Benz; GL350; 2010
 Mercedes-Benz; GL350; 2011
 Mercedes-Benz; GL350; 2012-2013
 Mercedes-Benz; GL63 AMG; 2013
 Mercedes-Benz; GLK350; 2010
 Mercedes-Benz; GLK350; 2011
 Mercedes-Benz; GLK350; 2012
 Mercedes-Benz; GLK350; 2013
 Mercedes-Benz; ML350; 2010
 Mercedes-Benz; ML350; 2011
 Mercedes-Benz; ML350; 2012
 Mercedes-Benz; ML350; 2013
 Mercedes-Benz; ML450; 2010
 Mercedes-Benz; ML450; 2011
 Mercedes-Benz; ML550; 2010
 Mercedes-Benz; ML550; 2011-2012
 Mercedes-Benz; ML63 AMG; 2010
 Mercedes-Benz; ML63 AMG; 2011
 Mercedes-Benz; ML63 AMG; 2012-2013
 Mercedes-Benz; R350; 2010
 Mercedes-Benz; R350; 2011
 Mercedes-Benz; R350; 2012
 Mercedes-Benz; R350; 2013
 Mercedes-Benz; S Series; 2011
 Mercedes-Benz; S Series; 2012
 Mercedes-Benz; S Series; 2013
 Mercedes-Benz; S550; 2011
 Mercedes-Benz; S550; 2012-2013
 Mercedes-Benz; S600; 2011
 Mercedes-Benz; S600; 2012-2013
 Mercedes-Benz; S63 AMG; 2011

Numerical Listing

Mercedes-Benz; S63 AMG; 2012-2013
 Mercedes-Benz; S65 AMG; 2011
 Mercedes-Benz; S65 AMG; 2012-2013
 Mercedes-Benz; SL550; 2012
 Mercedes-Benz; SL550; 2013
 Mercedes-Benz; SL63 AMG; 2012
 Mercedes-Benz; SL63 AMG; 2013
 Mercedes-Benz; SLK250; 2012
 Mercedes-Benz; SLK250; 2013
 Mercedes-Benz; SLK280; 2007; May & Newer
 Mercedes-Benz; SLK280; 2008
 Mercedes-Benz; SLK300; 2009-2011
 Mercedes-Benz; SLK350; 2007; May & Newer
 Mercedes-Benz; SLK350; 2008-2012
 Mercedes-Benz; SLK350; 2013
 Mercedes-Benz; SLK55 AMG; 2007; May & Newer
 Mercedes-Benz; SLK55 AMG; 2008-2010
 Mercedes-Benz; SLS AMG; 2011-2012
 Mercedes-Benz; SLS AMG; 2013
 Mercedes-Benz; Sprinter 2500; 2016
 Mercedes-Benz; Sprinter 2500; 2017-2018
 Smart; Fortwo; 2008-2012
 Smart; Fortwo; 2013
 Smart; Fortwo; 2016-2017

28238



Mercedes-Benz; CLS550; 2017
 Mercedes-Benz; CLS63 AMG S; 2017

28239



Mercedes-Benz; Metris; 2015-2017
 Mercedes-Benz; Vito; 2016-2017

28291 (433 MHz)



Chrysler; 300; 2009-2010
 Dodge; Challenger; 2008; OEM No. 56029400AB
 Dodge; Challenger; 2009
 Dodge; Challenger; 2010-2012; W/Metal Stem Clamp-in Sensor
 Dodge; Charger; 2009
 Dodge; Charger; 2010; W/Metal Stem Clamp-in Sensor
 Dodge; Viper; 2012-2013; W/Metal Stem Clamp-in Sensor
 Dodge; Viper; 2014-2015; W/Metal Stem Clamp-in Sensor
 Dodge; Viper; 2016-2018; W/Metal Stem Clamp-in Sensor

Sensor

28300 (315 MHz)



Toyota; Sequoia; 2004-2007; W/Steel Wheels; W/40 Deg. Angled Valve Sensor
 Toyota; Tacoma; 2005; W/40 Deg. Angled Valve Sensor; Nov. 30 & Older
 Toyota; Tundra; 2005; W/Steel Wheels; W/40 Deg. Angled Valve Sensor
 Toyota; Tundra; 2006; W/Steel Wheels; W/40 Deg. Angled Valve Sensor

28304



Volvo; XC90; 2016

28305 (315 MHz)



Toyota; Sequoia; 2004; W/Alloy Wheels
 Toyota; Sequoia; 2004; W/Steel Wheels; W/20 Deg. Angled Valve Sensor
 Toyota; Sequoia; 2005; W/Alloy Wheels
 Toyota; Sequoia; 2005; W/Steel Wheels; W/20 Deg. Angled Valve Sensor
 Toyota; Sequoia; 2006; W/Alloy Wheels
 Toyota; Sequoia; 2006; W/Steel Wheels; W/20 Deg. Angled Valve Sensor
 Toyota; Sequoia; 2007; W/Alloy Wheels
 Toyota; Sequoia; 2007; W/Steel Wheels; W/20 Deg. Angled Valve Sensor
 Toyota; Tacoma; 2005; W/20 Deg. Angled Valve Sensor; Nov. 30 & Older
 Toyota; Tundra; 2005; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor
 Toyota; Tundra; 2006; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor

Numerical Listing

Sensor 28308 (315 MHz)



Chrysler; 200; 2011
 Chrysler; 200; 2012; Rubber Valve
 Chrysler; 200; 2013-2014
 Chrysler; 300; 2005-2006
 Chrysler; 300; 2007; Use until depleted-superseded by 20066
 Chrysler; Aspen; 2007-2011
 Chrysler; Crossfire; 2005
 Chrysler; Pacifica; 2006-2007
 Chrysler; Pacifica; 2008
 Chrysler; PT Cruiser; 2008-2010
 Chrysler; Sebring; 2007-2009
 Chrysler; Sebring; 2010
 Chrysler; Town & Country; 2006-2007
 Chrysler; Town & Country; 2008; Can also use 20066 until depleted 315 MHz
 Dodge; Avenger; 2008-2009
 Dodge; Avenger; 2010-2012
 Dodge; Avenger; 2013-2014
 Dodge; Caliber; 2007-2010
 Dodge; Caliber; 2011-2012
 Dodge; Caravan; 2006-2007
 Dodge; Charger; 2006-2007
 Dodge; Durango; 2007
 Dodge; Durango; 2008
 Dodge; Durango; 2009
 Dodge; Grand Caravan; 2006-2007
 Dodge; Magnum; 2005-2007
 Dodge; Nitro; 2007-2008
 Dodge; Nitro; 2009-2011
 Jeep; Commander; 2006-2007
 Jeep; Compass; 2007-2010
 Jeep; Compass; 2011
 Jeep; Compass; 2012-2015
 Jeep; Compass; 2016-2017
 Jeep; Grand Cherokee; 2005-2007
 Jeep; Liberty; 2005-2008
 Jeep; Liberty; 2009; W/315 MHz Snap-in Sensor
 Jeep; Liberty; 2010-2012
 Jeep; Patriot; 2007-2010
 Jeep; Patriot; 2011-2012
 Jeep; Patriot; 2013-2015; W/315 MHz
 Jeep; Patriot; 2016-2017; W/315 MHz
 Jeep; Wrangler; 2007-2008
 Jeep; Wrangler; 2011
 Jeep; Wrangler; 2012
 Suzuki; Kizashi; 2010-2012

28310 (315 MHz)



Lexus; SC430; 2002-2005; W/White I.D. Mark
 Lexus; SC430; 2006; W/White I.D. Mark; Jul. & Older

Sensor 28315 (315 MHz)



Lexus; SC430; 2002-2005; W/Blue I.D. Mark
 Lexus; SC430; 2006; W/Blue I.D. Mark; Jul. & Older

28320 (315 MHz)



Lexus; SC430; 2002-2005; W/Red I.D. Mark
 Lexus; SC430; 2006; W/Red I.D. Mark; Jul. & Older

28325 (315 MHz)



Lexus; SC430; 2002-2005; W/Gold I.D. Mark
 Lexus; SC430; 2006; W/Gold I.D. Mark; Jul. & Older

28335 (315 MHz)



Lexus; GS300; 2006
 Lexus; GS430; 2005
 Lexus; GS430; 2006; Jun. & Older
 Lexus; GX470; 2006; Feb. & Newer; W/O Valve Cap
 Lexus; IS250; 2006; Mar. & Older
 Lexus; IS350; 2006; Mar. & Older
 Toyota; 4Runner; 2006; OEM Part No. 4260730030

Numerical Listing

Sensor

28342 (315 MHz)



Nissan; NV; 2012
Nissan; NV; 2013-2015
Nissan; NV; 2016
Nissan; NV; 2017

28345 (315 MHz)



Lexus; GX470; 2004-2005
Lexus; GX470; 2006; Jan. 31 & Older
Lexus; HS250h; 2010-2012
Toyota; 4Runner; 2003-2005
Toyota; 4Runner; 2006; OEM Part No. 4260735010

28355 (315 MHz)



Toyota; Tacoma; 2005; W/20 Deg. Angled Valve Sensor; Dec. 1 & Newer
Toyota; Tacoma; 2006; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor; Jul. & Older

Sensor

28360 (315 MHz)




Pontiac; Vibe; 2008-2010
Scion; FR-S; 2013
Scion; FR-S; 2014-2016
Scion; iM; 2015-2016
Subaru; BRZ; 2013-2014
Subaru; BRZ; 2015-2017
Toyota; Avalon; 2006; Aug. & Newer
Toyota; Avalon; 2007-2014
Toyota; Avalon; 2015
Toyota; Avalon; 2016
Toyota; Camry; 2007-2011; Models made in USA; OEM Part No. 4260706011
Toyota; Camry; 2012-2014
Toyota; Camry; 2015; Lo Line Sensor
Toyota; Corolla; 2007; Models made in USA; OEM Part No. 4260706011; Jun. & Newer
Toyota; Corolla; 2008; Models made in USA; OEM Part No. 4260706011
Toyota; Corolla; 2009-2012; Models made in USA; W/16" Or 17" Wheels
Toyota; Corolla; 2013; Models made in USA; W/16" Or 17" Wheels
Toyota; Corolla; 2014; Models made in USA; W/16" Or 17" Wheels
Toyota; Corolla; 2015-2018; Models made in USA; W/16" Or 17" Wheels
Toyota; Corolla iM; 2018
Toyota; FJ Cruiser; 2015; Models made in USA; W/16" Or 17" Wheels
Toyota; Highlander; 2011-2013
Toyota; Highlander; 2014-2017
Toyota; Matrix; 2007; Models made in USA; OEM Part No. 4260706011; Jun. & Newer
Toyota; Matrix; 2008-2013; Models made in USA; OEM Part No. 4260706011
Toyota; Mirai; 2016-2017; Models made in USA; W/16" Or 17" Wheels
Toyota; Prius; 2013
Toyota; Prius; 2015-2016
Toyota; Prius; 2017
Toyota; Prius Prime; 2017; Models made in USA; W/16" Or 17" Wheels
Toyota; RAV4; 2012; Electric
Toyota; RAV4; 2016-2017; Electric
Toyota; Solara; 2006; May & Newer
Toyota; Solara; 2007-2008
Toyota; Tacoma; 2006; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor; Aug. & Newer
Toyota; Tacoma; 2007-2013; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor
Toyota; Tacoma; 2014; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor
Toyota; Tacoma; 2015; W/Alloy Wheels; W/20 Deg. Angled Valve Sensor
Toyota; Venza; 2009-2014
Toyota; Venza; 2015-2016
Toyota; Yaris; 2013
Toyota; Yaris; 2014-2015
Toyota; Yaris; 2016-2018

28362 (315 MHz)



Volvo; XC90; 2012-2015

Numerical Listing

Sensor 28365 (315 MHz)	Sensor 28370 (315 MHz)
	
<p>Lexus: GX470; 2006; Feb. & Newer; W/Valve Cap Lexus: LX470; 2005 Lexus: LX470; 2006; Jul. & Older Scion: iQ; 2012-2014 Scion: iQ; 2015 Scion: tC; 2006; May & Newer Scion: tC; 2007-2014 Scion: tC; 2015-2016 Scion: xB; 2008-2014 Scion: xB; 2015-2016 Scion: xD; 2008-2014 Toyota: 4Runner; 2006; OEM Part No. 4260733011 Toyota: 4Runner; 2007; W/Valve Cap Toyota: 4Runner; 2008; W/Valve Cap; OEM Part No. 4260733011 Toyota: 4Runner; 2009; W/Valve Cap Toyota: Camry; 2007-2011; Models made in Japan; OEM Part No. 4260733011 Toyota: Corolla; 2007; Models made in Japan; OEM Part No. 4260733011; Jun. & Newer Toyota: Corolla; 2008; Models made in Japan; OEM Part No. 4260733011 Toyota: Corolla; 2009; Models made in Japan; OEM Part No. 4260733011 Toyota: Corolla; 2009; Models made in USA; W/15" Wheels Toyota: Corolla; 2010; Models made in Japan; OEM Part No. 4260733011 Toyota: Corolla; 2010-2011; Models made in USA; W/15" Wheels Toyota: Corolla; 2011; Models made in Japan; OEM Part No. 4260733011 Toyota: Corolla; 2012; Models made in Japan; OEM Part No. 4260733011 Toyota: Corolla; 2012; Models made in USA; W/15" Wheels Toyota: Corolla; 2013; Models made in Japan Toyota: FJ Cruiser; 2008-2014 Toyota: Highlander; 2007; May & Newer Toyota: Highlander; 2008-2010 Toyota: Land Cruiser; 2005; May & Newer Toyota: Land Cruiser; 2006 Toyota: Land Cruiser; 2007-2011 Toyota: Land Cruiser; 2013-2014 Toyota: Land Cruiser; 2015 Toyota: Matrix; 2007; Models made in Japan; OEM Part No. 4260733011; Jun. & Newer Toyota: Matrix; 2008-2013; Models made in Japan; OEM Part No. 4260733011 Toyota: Prius; 2005-2013 Toyota: Prius; 2014-2016 Toyota: RAV4; 2006; exc Electric Toyota: Yaris; 2007; Aug. & Newer Toyota: Yaris; 2008-2012</p>	<p>Lexus: CT200h; 2011 Lexus: CT200h; 2012-2015 Lexus: CT200h; 2016-2017 Lexus: ES300h; 2013 Lexus: ES300h; 2014-2018 Lexus: ES350; 2007-2012 Lexus: ES350; 2013-2016 Lexus: GS F; 2016 Lexus: GS F; 2017-2018 Lexus: GS200t; 2016 Lexus: GS200t; 2017 Lexus: GS350; 2007-2011 Lexus: GS350; 2013; 315 MHz Lexus: GS350; 2014-2017; 315 MHz Lexus: GS430; 2006; Jul. & Newer Lexus: GS430; 2007 Lexus: GS450h; 2007-2011 Lexus: GS450h; 2013-2014 Lexus: GS450h; 2015 Lexus: GS450h; 2016-2017 Lexus: GS460; 2008-2011 Lexus: GS460; 2012-2016 Lexus: GX460; 2010-2015 Lexus: GX460; 2016-2017 Lexus: GX470; 2007-2009 Lexus: IS F; 2008-2013 Lexus: IS F; 2014-2016 Lexus: IS200t; 2016 Lexus: IS200t; 2017 Lexus: IS250; 2006; Apr. 1 & Newer Lexus: IS250; 2007 Lexus: IS250; 2008-2012 Lexus: IS250; 2013-2016 Lexus: IS300; 2016 Lexus: IS300; 2017-2018 Lexus: IS350; 2006; Apr. 1 & Newer Lexus: IS350; 2007-2012 Lexus: IS350; 2013-2018 Lexus: LFA; 2012 Lexus: LFA; 2016 Lexus: LS460; 2007-2016 Lexus: LS460; 2017 Lexus: LS600h; 2008-2012 Lexus: LS600h; 2013-2016 Lexus: LX470; 2006; Aug. & Newer Lexus: LX470; 2007 Lexus: LX570; 2008-2011 Lexus: LX570; 2013-2014 Lexus: LX570; 2016 Lexus: NX200t; 2015-2017 Lexus: NX300; 2018 Lexus: NX300h; 2016-2018 Lexus: RC F; 2015-2017 Lexus: RC200t; 2016-2017 Lexus: RC300; 2016-2017 Lexus: RC350; 2016-2017 Lexus: RX330; 2006; Models made in Japan; Feb. & Newer Lexus: RX350; 2007-2010; Models made in Japan Lexus: RX350; 2011-2012 Lexus: RX350; 2013; exc F Sport</p>

Numerical Listing

Lexus; RX350; 2014-2015; F Sport; Vehicle Made for Canada
 Lexus; RX350; 2016-2017; F Sport; Vehicle Made for Canada
 Lexus; RX400h; 2006
 Lexus; RX400h; 2007-2008; Models made in Japan
 Lexus; RX450h; 2010-2013
 Lexus; RX450h; 2014-2016
 Lexus; SC430; 2006; Aug. & Newer
 Lexus; SC430; 2007-2010
 Toyota; 4Runner; 2006; OEM Part No. 4260733021
 Toyota; 4Runner; 2007; W/O Valve Cap
 Toyota; 4Runner; 2008; W/O Valve Cap; OEM Part No. 4260733021
 Toyota; 4Runner; 2009; W/O Valve Cap
 Toyota; 4Runner; 2010-2016
 Toyota; 4Runner; 2017
 Toyota; Corolla; 2009-2012; Models made in Japan; OEM Part No. 4260733021
 Toyota; RAV4; 2007-2011; exc Electric
 Toyota; RAV4; 2012; exc Electric
 Toyota; RAV4; 2013; exc Electric

28380 (315 MHz)



Toyota; Tacoma; 2005; W/40 Deg. Angled Valve Sensor; Dec. 1 & Newer
 Toyota; Tacoma; 2006; W/Steel Wheels; W/40 Deg. Angled Valve Sensor
 Toyota; Tacoma; 2007-2013; W/Steel Wheels; W/40 Deg. Angled Valve Sensor
 Toyota; Tacoma; 2014; W/Steel Wheels; W/20 Deg. Angled Valve Sensor
 Toyota; Tacoma; 2015; W/Steel Wheels; W/20 Deg. Angled Valve Sensor
 Toyota; Tundra; 2006
 Toyota; Tundra; 2007
 Toyota; Tundra; 2008-2011; W/Steel Wheels; W/TRW Sensor
 Toyota; Tundra; 2012; W/Steel Wheels; W/TRW Sensor
 Toyota; Tundra; 2013; W/Steel Wheels; W/TRW Sensor
 Toyota; Tundra; 2014; W/Steel Wheels
 Toyota; Tundra; 2015; W/Steel Wheels

Sensor

28385 (315 MHz)



Ford; Crown Victoria; 2006-2011
 Ford; Edge; 2007-2008; W/Chrome Plated Almm. Wheels
 Ford; Escape; 2005; Oct. 3, 2005 & Newer
 Ford; Escape; 2006-2008
 Ford; E-Series Van; 2007
 Ford; Explorer; 2006-2010
 Ford; Explorer Sport Trac; 2007-2010
 Ford; F-150; 2007
 Ford; F-150; 2008; W/O H.D. Payload Pkg
 Ford; Focus; 2007
 Ford; Freestar; 2006-2007
 Ford; Fusion; 2007-2009
 Ford; Mustang; 2007-2009
 Ford; Ranger; 2007-2011
 Lincoln; Mark LT; 2007-2008
 Lincoln; MKX; 2007-2008; W/Chrome Plated Almm. Wheels
 Lincoln; MKZ; 2007-2009
 Lincoln; Town Car; 2006-2010
 Lincoln; Zephyr; 2006
 Mazda; B2300; 2007-2009
 Mazda; B3000; 2007-2008
 Mazda; B4000; 2007-2009
 Mazda; Tribute; 2006
 Mazda; Tribute; 2008
 Mercury; Grand Marquis; 2006-2011
 Mercury; Mariner; 2005; Oct. 3, 2005 & Newer
 Mercury; Mariner; 2006-2008
 Mercury; Milan; 2007-2009
 Mercury; Monterey; 2006-2007
 Mercury; Mountaineer; 2006-2010

28390 (315 MHz)



Ford; Edge; 2007-2008; W/O Chrome Plated Almm. Wheels
 Ford; Edge; 2009-2010
 Ford; Expedition; 2007-2010
 Ford; Five Hundred; 2006-2007
 Ford; Flex; 2009-2010
 Ford; Focus; 2008-2009
 Ford; Taurus; 2008-2009
 Ford; Taurus; 2010; Apr. & Older
 Lincoln; MKS; 2009-2010
 Lincoln; MKT; 2010
 Lincoln; MKX; 2007-2008; W/O Chrome Plated Almm. Wheels
 Lincoln; MKX; 2009-2010
 Lincoln; Navigator; 2007-2010
 Mercury; Montego; 2006-2007
 Mercury; Sable; 2008-2009

Numerical Listing

Sensor

28395 (315 MHz)



Ford; E-Series Van; 2007
 Ford; E-Series Van; 2008-2009
 Ford; E-Series Van; 2010
 Ford; E-Series Van; 2010; W/Alloy Wheels
 Ford; F-150; 2008; W/H.D. Payload Pkg
 Ford; F-250 Super Duty; 2008-2010
 Ford; F-350 Super Duty; 2008-2010
 Ford; F-450 Super Duty; 2008
 Ford; F-450 Super Duty; 2009
 Ford; F-450 Super Duty; 2010
 Ford; F-550 Super Duty; 2010

28423 (314.9 MHz)



Cadillac; ATS; 2014; V
 Cadillac; ATS; 2015; V
 Cadillac; ATS-V; 2017-2018
 Cadillac; CTS; 2014-2015; V
 Chevrolet; Camaro; 2012; ZL1
 Chevrolet; Camaro; 2013-2015; ZL1
 Chevrolet; Caprice; 2016
 Chevrolet; SS; 2014-2017

Sensor

28434 (433 MHz)



Chrysler; 300; 2007; Can also use 28155 until depleted 433 MHz sensor
 Chrysler; 300; 2008
 Chrysler; Town & Country; 2008; Can also use 28155 until depleted 433 MHz
 Chrysler; Town & Country; 2009-2010
 Dodge; Challenger; 2008; OEM No. 56029481AB; 433 MHz Sensor; Rubber Valve
 Dodge; Charger; 2008
 Dodge; Grand Caravan; 2008-2010
 Dodge; Journey; 2009
 Dodge; Journey; 2010; Replaces clamp-in Sensor
 Dodge; Magnum; 2008
 Dodge; Ram 4500; 2010; W/Rubber Stem Snap-in Sensor
 Dodge; Ram 5500; 2010; W/Rubber Stem Snap-in Sensor
 Dodge; Ram Series; 2009
 Dodge; Ram Series; 2010; W/Rubber Stem Snap-in Sensor
 Jeep; Commander; 2008-2010
 Jeep; Grand Cherokee; 2008-2010
 Jeep; Liberty; 2009; W/433 MHz Clamp-in Sensor
 Jeep; Wrangler; 2009-2010
 Volkswagen; Routan; 2009-2010

28461 (315 MHz)



Dodge; Dakota; 2008-2010
 Dodge; Ram Series; 2008
 Dodge; Ram Series; 2009
 Mitsubishi; Raider; 2008-2009

28500 (315 MHz)



Hyundai; Tucson; 2014
 Kia; Sportage; 2014-2015

Numerical Listing


Sensor

28505 (315 MHz)



Hyundai; Veloster; 2012-2016

28586 (433 MHz)

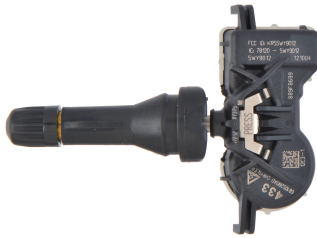

Chrysler; 200; 2015-2017
Dodge; Dart; 2013-2016
Jeep; Renegade; 2015-2016

28670 (315 MHz)



Toyota; Sequoia; 2008-2013
Toyota; Sienna; 2006-2014
Toyota; Tundra; 2006; W/Alloy Wheels; W/TRW Sensor
Toyota; Tundra; 2007; W/Alloy Wheels; W/TRW Sensor
Toyota; Tundra; 2008-2011; W/Alloy Wheels; W/TRW Sensor
Toyota; Tundra; 2012
Toyota; Tundra; 2013; W/Alloy Wheels; W/TRW Sensor
Toyota; Tundra; 2014; W/Alloy Wheels
Toyota; Tundra; 2015; W/Alloy Wheels

28720 (315 MHz)



Acura; CSX; 2008-2011
Honda; Civic; 2008-2014
Honda; CR-Z; 2011-2014
Honda; CR-Z; 2015
Honda; CR-Z; 2016
Honda; Element; 2009-2011
Honda; Fit; 2009-2014
Honda; Insight; 2010-2014
Honda; Odyssey; 2011-2016
Honda; Odyssey; 2017

Sensor

28849 (315 MHz)



Hyundai; Accent; 2008-2011
Hyundai; Equus; 2011-2013
Hyundai; Genesis; 2009-2014
Hyundai; Santa Fe XL; 2013
Hyundai; Sonata; 2008
Hyundai; Sonata; 2009-2010
Hyundai; Tucson; 2010-2013
Kia; Borrego; 2009-2011
Kia; Rio; 2007-2011
Kia; Rio5; 2007-2011
Kia; Spectra; 2006
Kia; Spectra; 2007-2009
Kia; Spectra5; 2006
Kia; Spectra5; 2007-2009
Kia; Sportage; 2009-2012
Kia; Sportage; 2013

28981 (315 MHz)



Acura; MDX, RDX; 2004-2006
Acura; RL; 2005-2013
Acura; TL; 2005
Acura; TL; 2006-2008
Honda; Odyssey; 2005-2007; Touring
Honda; Odyssey; 2008; Touring
Honda; Pilot; 2005; W/Short Stem Valve
Honda; Pilot; 2006-2008
Honda; Ridgeline; 2006; RTL, RTS
Honda; Ridgeline; 2007-2008; RTL, RTS, RTX
Honda; Ridgeline; 2009
Honda; Ridgeline; 2010; W/Alloy Wheels
Honda; Ridgeline; 2010; W/Steel Wheels
Honda; Ridgeline; 2011-2013
Honda; Ridgeline; 2014

28982 (315 MHz)



Honda; Pilot; 2005; LX; W/Long Stem Valve
Honda; Ridgeline; 2006; RT
Honda; Ridgeline; 2007-2008; RT

Numerical Listing

Sensor

28983 (315 MHz)




Honda; Odyssey; 2008
 Honda; Odyssey; 2009-2010
 Hyundai; Accent; 2006-2007
 Hyundai; Sonata; 2007-2008
 Hyundai; Tiburon; 2007-2008
 Hyundai; Tucson; 2006-2009
 Kia; Amanti; 2007-2009
 Kia; Sorento; 2007-2009
 Kia; Sportage; 2005; Jun. 15, 2005 & Newer
 Kia; Sportage; 2006-2008

28984 (315 MHz)



Jeep; Cherokee; 2014
 Jeep; Cherokee; 2015
 Jeep; Cherokee; 2016-2017
 Jeep; Cherokee; 2018
 Ram; Ram Series; 2014-2015
 Ram; Ram Series; 2016-2017

29014

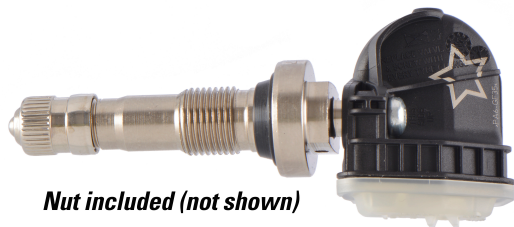

Nut included (not shown)

Ford; Focus; 2016; RS
 Ford; Mustang; 2016; Shelby GT350

Sensor

29015





Buick; Enclave; 2017-2018
 Buick; LaCrosse; 2017-2018; Exc. ZL1
 Buick; Regal; 2018; Exc. ZL1
 Cadillac; CT6; 2017-2018; Exc. ZL1
 Cadillac; XT5; 2017-2018
 Chevrolet; Camaro; 2016-2017; Exc. ZL1
 Chevrolet; Camaro; 2018; Exc. ZL1
 Chevrolet; Cruze; 2017-2018; Exc. ZL1
 GMC; Acadia; 2018

Numerical Listing

Sensor INDIRECT	
	Volkswagen; Golf Alltrack; 2017
	Volkswagen; Golf R; 2015-2017
	Volkswagen; Golf SportWagen; 2015-2017
	Volkswagen; GTI; 2013-2015
	Volkswagen; Jetta; 2013-2017
	Volkswagen; Passat; 2013-2017
	Volkswagen; Routan; 2015
	Volkswagen; Tiguan; 2014-2017
	Volvo; S60 Cross Country; 2017
	Volvo; S60,S80; 2017
	Volvo; S90; 2017-2018
	Volvo; V60; 2017-2018
	Volvo; V60 Cross Country; 2017-2018
	Volvo; V90; 2017
	Volvo; V90; 2018
	Volvo; XC60; 2015
	Volvo; XC60; 2017
	Volvo; XC60; 2018
	Volvo; XC90; 2017-2018
Audi; A3, A4,A5 & Quattro; 2013-2018	
Audi; A4 allroad; 2013-2018	
Audi; A6; 2013-2018	
Audi; A6 Quattro; 2015-2017	
Audi; A7 Quattro; 2013-2018	
Audi; A8; 2013-2018	
Audi; Q3; 2013-2018	
Audi; Q3 Quattro; 2015-2018	
Audi; Q5; 2013-2018	
Audi; Q7; 2013-2018	
Audi; RS5; 2013-2017	
Audi; RS7; 2017-2018; W/48mm Green Insert	
Audi; S3; 2015-2018	
Audi; S4; 2013-2018	
Audi; S5; 2013-2018	
Audi; S6; 2013-2018	
Audi; S7; 2013-2018	
Audi; S8; 2013-2014	
Audi; S8; 2015	
Audi; S8; 2016-2018	
Audi; SQ5; 2013-2014	
Audi; SQ5; 2015	
Audi; SQ5; 2016-2018	
Audi; TT; 2013-2018	
Audi; TT Quattro; 2013-2017	
Audi; TT RS; 2018	
Buick; Allure; 2006	
Buick; Century; 1999-2005	
Buick; LeSabre; 2000-2005	
Buick; Park Avenue; 1998-2005	
Buick; Regal; 1999-2004	
Buick; Rendezvous; 2003-2007	
Chevrolet; Impala; 2000-2005	
Chevrolet; Monte Carlo; 2000-2005	
Fiat; 124 Spider; 2017	
Honda; Accord; 2013-2018	
Honda; Civic; 2016-2018	
Honda; CR-V; 2014-2018	
Honda; Fit; 2015-2018	
Lexus; LS430; 2004-2006	
Lexus; RX330; 2004-2005	
Mazda; 3; 2014-2018	
Mazda; 6; 2014-2017	
Mazda; CX-3; 2016-2018	
Mazda; CX-5; 2013-2016	
Mazda; CX-9; 2016	
Mazda; CX-9; 2017	
Mazda; MX-5 Miata; 2016-2017	
Oldsmobile; Alero; 1999-2000	
Oldsmobile; Aurora; 2001-2003	
Pontiac; Aztek; 2003-2005	
Pontiac; Bonneville; 2000-2005	
Pontiac; Grand Am; 1999-2002	
Pontiac; Grand Prix; 2004-2006	
Pontiac; Vibe; 2005-2007	
Toyota; Sienna; 2005	
Toyota; Yaris; 2015	
Toyota; Yaris iA; 2017	
Volkswagen; Beetle; 2013-2018	
Volkswagen; Golf; 2013-2017	

Numerical Listing

Service Pack 2002	Service Pack 2003
	
<p>Ford; Expedition; 2003-2004 Ford; Expedition; 2005-2006 Ford; Explorer; 2002-2003; Exc. Sport Ford; Explorer; 2004-2005 Ford; Freestar; 2004-2005; W/Aluminium Valve Stem Lincoln; Aviator; 2003-2005 Lincoln; Navigator; 2003-2004 Lincoln; Navigator; 2005-2006 Mercury; Monterey; 2004-2005 Mercury; Mountaineer; 2002-2005</p>	<p>Cadillac; DeVille; 2001-2005 Cadillac; Seville; 2001-2004 Chevrolet; Corvette; 2001-2004 Chrysler; 300M; 2002-2004; W/Schrader Sensor Chrysler; Concorde; 2002-2004; W/Schrader Sensor Chrysler; Crossfire; 2004; W/Schrader Sensor Chrysler; Crossfire; 2005; exc Siemens OE Sensor; Service Pack contains cap, core, grommet, and nut Chrysler; Crossfire; 2006-2008; W/Schrader Sensor Chrysler; Intrepid; 2002-2004; W/Schrader Sensor Chrysler; Pacifica; 2004; W/Schrader Sensor Chrysler; Prowler; 2001; W/Red Sensor Body Chrysler; Prowler; 2002; W/Schrader Sensor Chrysler; Town & Country; 2002-2003 Chrysler; Voyager; 2002-2003 Dodge; Caravan; 2002-2003 Dodge; Grand Caravan; 2002-2003 Dodge; Intrepid; 2002-2004 Dodge; Viper; 2003-2006 Dodge; Viper; 2008-2010 Isuzu; Rodeo; 2004 Jeep; Grand Cherokee; 2002-2004 Jeep; Liberty; 2002-2004 Mitsubishi; Eclipse; 2006-2007; W/Alloy Wheels Mitsubishi; Eclipse; 2008-2010 Mitsubishi; Eclipse; 2011 Mitsubishi; Eclipse; 2012 Mitsubishi; Endeavor; 2004-2005 Mitsubishi; Endeavor; 2006 Mitsubishi; Endeavor; 2007 Mitsubishi; Endeavor; 2008 Mitsubishi; Endeavor; 2010 Mitsubishi; Endeavor; 2011; W/Alloy Wheels Mitsubishi; Galant; 2004-2006 Mitsubishi; Galant; 2007-2009; W/Alloy Wheels Mitsubishi; Galant; 2010-2012; W/Alloy Wheels Mitsubishi; Montero; 2003-2006 Mitsubishi; Montero Sport; 2003-2004 Plymouth; Prowler; 1997; W/Red Sensor Body Plymouth; Prowler; 1999-2001; W/Red Sensor Body</p>

Numerical Listing

Service Pack

2004 (Interchanges with 2002)



Buick; Allure; 2007-2008; W/Schrader Sensor
 Buick; Enclave; 2008; W/Schrader Sensor
 Buick; LaCrosse; 2006; W/Schrader Sensor
 Buick; LaCrosse; 2007-2008; W/Schrader Sensor
 Buick; Rainier; 2006-2007
 Cadillac; ATS; 2014; V
 Cadillac; ATS; 2015; V
 Cadillac; ATS-V; 2017-2018
 Cadillac; CTS; 2004-2007
 Cadillac; CTS; 2009-2011; OEM Part No. 15268606; CTS V; W/315 MHz Sensor
 Cadillac; CTS; 2012; OEM Part No. 15268606; CTS V; W/315 MHz Sensor
 Cadillac; CTS; 2013; OEM Part No. 15268606; CTS V; W/315 MHz Sensor
 Cadillac; CTS; 2014-2015; V
 Cadillac; DTS; 2006
 Cadillac; Escalade; 2004
 Cadillac; Escalade; 2005-2006
 Cadillac; SRX; 2004-2006
 Cadillac; STS; 2005
 Cadillac; STS; 2006-2008
 Cadillac; XLR; 2004
 Cadillac; XLR; 2005-2009
 Chevrolet; Camaro; 2012; ZL1
 Chevrolet; Camaro; 2013-2015; ZL1
 Chevrolet; Caprice; 2011-2013
 Chevrolet; Caprice; 2016
 Chevrolet; Cobalt; 2008; Clamp-In Style Only; W/Aluminium Valve Stem
 Chevrolet; Cobalt; 2009; Clamp-In Style Only; W/Aluminium Valve Stem
 Chevrolet; Corvette; 2005-2009
 Chevrolet; Corvette; 2010-2011
 Chevrolet; Corvette; 2012; Z06; Base
 Chevrolet; Corvette; 2013
 Chevrolet; Equinox; 2007-2009; W/Schrader Sensor
 Chevrolet; Express; 2008-2009; W/Schrader Sensor
 Chevrolet; HHR; 2008-2009; Clamp-In Style Only; W/Aluminium Valve Stem
 Chevrolet; Impala; 2006; W/Alloy Wheels
 Chevrolet; Impala; 2007; Clamp-In Style Only; W/Aluminium Valve Stem
 Chevrolet; Malibu; 2008; Clamp-In Style Only; W/Aluminium Valve Stem
 Chevrolet; Monte Carlo; 2006; W/Alloy Wheels
 Chevrolet; Monte Carlo; 2007; Clamp-In Style Only; W/Aluminium Valve Stem
 Chevrolet; Silverado Series; 2004
 Chevrolet; Silverado Series; 2005-2006
 Chevrolet; Silverado Series; 2007; Classic
 Chevrolet; SS; 2014-2017
 Chevrolet; SSR; 2006
 Chevrolet; Suburban; 2004
 Chevrolet; Suburban; 2005-2006
 Chevrolet; Tahoe; 2004
 Chevrolet; Tahoe; 2005-2006
 Chevrolet; Trailblazer; 2006-2009
 Chevrolet; Uplander; 2008-2009
 Ford; Expedition; 2003-2004
 Ford; Expedition; 2005-2006
 Ford; Explorer; 2002-2003; Exc. Sport
 Ford; Explorer; 2004-2005
 Ford; Freestar; 2004-2005; W/Aluminium Valve Stem
 GMC; Acadia; 2007-2008; W/Schrader Sensor
 GMC; Envoy; 2006
 GMC; Envoy; 2007-2009
 GMC; Savana Series; 2008-2009; W/Schrader Sensor
 GMC; Sierra Series; 2004

GMC; Sierra Series; 2005-2006
 GMC; Sierra Series; 2007; Classic
 GMC; Yukon; 2004
 GMC; Yukon; 2005-2006
 Isuzu; Ascender; 2006-2008
 Lincoln; Aviator; 2003-2005
 Lincoln; Navigator; 2003-2004
 Lincoln; Navigator; 2005-2006
 Mercury; Monterey; 2004-2005
 Mercury; Mountaineer; 2002-2005
 Pontiac; G Series; 2008; W/Schrader Sensor
 Pontiac; Grand Prix; 2007; W/Schrader Sensor
 Pontiac; Grand Prix; 2008; Clamp-In Style Only; W/Aluminium Valve Stem
 Pontiac; Montana; 2008; W/Schrader Sensor
 Pontiac; Solstice; 2008-2009; W/Schrader Sensor
 Pontiac; Torrent; 2007-2009; W/Schrader Sensor
 Saab; 9-7x; 2005-2009
 Saturn; Aura; 2007; W/Schrader Sensor
 Saturn; Outlook; 2007-2008; W/Schrader Sensor
 Saturn; Sky; 2008-2010; W/Schrader Sensor
 Suzuki; XL-7; 2007-2009; W/Schrader Sensor

2005



Infiniti; QX56; 2004
 Infiniti; QX56; 2005-2006; W/Steel Wheels
 Nissan; Armada; 2005-2006; W/Steel Wheels
 Nissan; Frontier; 2005-2007; W/Steel Wheels
 Nissan; Pathfinder; 2004; Armada
 Nissan; Pathfinder; 2004; Exc. Armada; Aug. & Newer
 Nissan; Quest; 2004
 Nissan; Quest; 2005-2006; W/Steel Wheels
 Nissan; Titan; 2004
 Nissan; Titan; 2005; Mar. & Older
 Nissan; Xterra; 2006; Submodel X

2006



Chevrolet; Colorado; 2007-2012
 GMC; Canyon; 2007-2012
 Hummer; H3; 2006-2010
 Hummer; H3T; 2009-2010
 Isuzu; i-290; 2007-2008
 Isuzu; i-370; 2007-2008
 Pontiac; Montana; 2009

Numerical Listing

Service Pack

2007 (Interchanges with 2003, 2011, 2015)



Cadillac; DeVille; 2001-2005
 Cadillac; Escalade; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Cadillac; Seville; 2001-2004
 Chevrolet; Avalanche; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Chevrolet; Corvette; 2001-2004
 Chevrolet; Silverado Series; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic
 Chevrolet; Suburban; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Chevrolet; Tahoe; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Chrysler; 300M; 2002-2004; W/Schrader Sensor
 Chrysler; Concorde; 2002-2004; W/Schrader Sensor
 Chrysler; Crossfire; 2004; W/Schrader Sensor
 Chrysler; Crossfire; 2005; exc Siemens OE Sensor; Service Pack contains cap, core, grommet, and nut
 Chrysler; Crossfire; 2006-2008; W/Schrader Sensor
 Chrysler; Intrepid; 2002-2004; W/Schrader Sensor
 Chrysler; Pacifica; 2004; W/Schrader Sensor
 Chrysler; Prowler; 2001; W/Red Sensor Body
 Chrysler; Prowler; 2002; W/Schrader Sensor
 Chrysler; Town & Country; 2002-2003
 Chrysler; Voyager; 2002-2003
 Dodge; Caravan; 2002-2003
 Dodge; Grand Caravan; 2002-2003
 Dodge; Intrepid; 2002-2004
 Dodge; Viper; 2003-2006
 Dodge; Viper; 2008-2010
 GMC; Sierra Series; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic
 GMC; Yukon; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Infiniti; FX35; 2003-2006
 Infiniti; FX35; 2007; Jun. & Older
 Infiniti; FX45; 2003-2006
 Infiniti; FX45; 2007; Jun. & Older
 Infiniti; G35; 2003; Jun. & Newer
 Infiniti; G35; 2004-2006
 Infiniti; M35; 2006-2007
 Infiniti; M45; 2003-2004
 Infiniti; M45; 2006-2007
 Infiniti; Q45; 2002
 Infiniti; Q45; 2003-2005
 Infiniti; Q45; 2006; Jul. & Older
 Infiniti; QX4; 2003
 Infiniti; QX56; 2005-2006; W/Alloy Wheels
 Infiniti; QX56; 2007; Mar. & Older
 Isuzu; Rodeo; 2004
 Jeep; Grand Cherokee; 2002-2004
 Jeep; Liberty; 2002-2004
 Mitsubishi; Eclipse; 2006-2007; W/Alloy Wheels
 Mitsubishi; Eclipse; 2008-2010
 Mitsubishi; Eclipse; 2011
 Mitsubishi; Eclipse; 2012
 Mitsubishi; Endeavor; 2004-2005
 Mitsubishi; Endeavor; 2006
 Mitsubishi; Endeavor; 2007
 Mitsubishi; Endeavor; 2008
 Mitsubishi; Endeavor; 2010

Mitsubishi; Endeavor; 2011; W/Alloy Wheels
 Mitsubishi; Galant; 2004-2006
 Mitsubishi; Galant; 2007-2009; W/Alloy Wheels
 Mitsubishi; Galant; 2010-2012; W/Alloy Wheels
 Mitsubishi; Montero; 2003-2006
 Mitsubishi; Montero Sport; 2003-2004
 Nissan; 350Z; 2003-2006
 Nissan; Armada; 2005-2006; W/Alloy Wheels
 Nissan; Armada; 2007
 Nissan; Armada; 2008; SE
 Nissan; Frontier; 2003-2004
 Nissan; Frontier; 2005-2007; W/Alloy Wheels
 Nissan; Frontier; 2008; W/Alloy Wheels
 Nissan; Maxima; 2006; Jun. & Newer
 Nissan; Maxima; 2007; Mar. & Older
 Nissan; Murano; 2003-2006
 Nissan; Pathfinder; 2003
 Nissan; Pathfinder; 2004; Exc. Armada; Jul. & Older
 Nissan; Pathfinder; 2005-2006
 Nissan; Quest; 2005-2006; W/Alloy Wheels
 Nissan; Sentra; 2007; W/Alloy Wheels
 Nissan; Titan; 2005; Apr. 1 & Newer
 Nissan; Titan; 2006
 Nissan; Titan; 2007; Mar. & Older
 Nissan; Xterra; 2003-2004
 Nissan; Xterra; 2005
 Nissan; Xterra; 2006; Exc. Submodel X
 Plymouth; Prowler; 1997; W/Red Sensor Body
 Plymouth; Prowler; 1999-2001; W/Red Sensor Body
 Subaru; B9 Tribeca; 2006-2007
 Subaru; Legacy; 2004-2007
 Subaru; Legacy; 2008; W/16" Or 17" Wheels
 Subaru; Outback; 2004-2007
 Subaru; Tribeca; 2008; W/Metal Stem Clamp-in Sensor
 Subaru; Tribeca; 2009; W/Metal Stem Clamp-in Sensor
 Subaru; Tribeca; 2010; W/Metal Stem Clamp-in Sensor
 Subaru; Tribeca; 2011; W/Metal Stem Clamp-in Sensor

Numerical Listing

Service Pack

20008



Buick; Allure; 2009
 Buick; Allure; 2010
 Buick; Cascada; 2016-2017
 Buick; Enclave; 2009-2015
 Buick; Enclave; 2016
 Buick; Enclave; 2017-2018
 Buick; Encore; 2013-2015
 Buick; Encore; 2016-2018
 Buick; Envision; 2016-2018
 Buick; LaCrosse; 2009
 Buick; LaCrosse; 2010-2015
 Buick; LaCrosse; 2016
 Buick; LaCrosse; 2017-2018; Exc. ZL1
 Buick; Lucerne; 2007-2011
 Buick; Regal; 2011-2016
 Buick; Regal; 2017
 Buick; Regal; 2018
 Buick; Verano; 2012-2015
 Buick; Verano; 2016-2018
 Cadillac; ATS; 2013; exc V
 Cadillac; ATS; 2014; exc V
 Cadillac; ATS; 2015; exc V
 Cadillac; ATS; 2016-2018; exc V
 Cadillac; CT6; 2016; Exc. ZL1
 Cadillac; CT6; 2017-2018; Exc. ZL1
 Cadillac; CTS; 2008
 Cadillac; CTS; 2009-2011; OEM Part No. 25920615; Exc. CTS V
 Cadillac; CTS; 2012; OEM Part No. 25920615; Exc. CTS V
 Cadillac; CTS; 2013; OEM Part No. 25920615; Exc. CTS V
 Cadillac; CTS; 2014-2015; exc V
 Cadillac; CTS; 2016-2018; exc V
 Cadillac; DTS; 2007-2011
 Cadillac; ELR; 2014
 Cadillac; ELR; 2015-2017
 Cadillac; Escalade; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
 Cadillac; Escalade; 2008
 Cadillac; Escalade; 2009-2011
 Cadillac; Escalade; 2012-2013
 Cadillac; Escalade; 2014-2015
 Cadillac; Escalade; 2016-2018
 Cadillac; SRX; 2007-2009
 Cadillac; SRX; 2010-2015
 Cadillac; SRX; 2016
 Cadillac; STS; 2009; OEM Part No. 25920615; Exc. STS V
 Cadillac; STS; 2010
 Cadillac; STS; 2011
 Cadillac; XTS; 2013-2015
 Cadillac; XTS; 2016-2018
 Chevrolet; Avalanche; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
 Chevrolet; Avalanche; 2008
 Chevrolet; Avalanche; 2009-2013
 Chevrolet; Aveo; 2007
 Chevrolet; Aveo; 2008-2011
 Chevrolet; Aveo5; 2007
 Chevrolet; Aveo5; 2008-2011
 Chevrolet; Bolt EV; 2017-2018; Exc. ZL1
 Chevrolet; Camaro; 2010-2011
 Chevrolet; Camaro; 2012; Exc. ZL1

Chevrolet; Camaro; 2013-2015; Exc. ZL1
 Chevrolet; Camaro; 2016-2017; Exc. ZL1
 Chevrolet; Camaro; 2018; Exc. ZL1
 Chevrolet; Caprice; 2017
 Chevrolet; Captiva Sport; 2012-2013
 Chevrolet; Captiva Sport; 2017
 Chevrolet; Cobalt; 2008; Snap-In Style Only; W/Rubber Valve Stem
 Chevrolet; Cobalt; 2009; Snap-In Style Only; W/Rubber Valve Stem
 Chevrolet; Cobalt; 2010
 Chevrolet; Colorado; 2015
 Chevrolet; Colorado; 2016-2018
 Chevrolet; Cruze; 2011-2015
 Chevrolet; Cruze; 2016
 Chevrolet; Cruze; 2017-2018; Exc. ZL1
 Chevrolet; Equinox; 2010-2014
 Chevrolet; Equinox; 2015-2018
 Chevrolet; Express; 2010-2015
 Chevrolet; Express; 2016-2018
 Chevrolet; HHR; 2008-2009; Snap-In Style Only; W/Rubber Valve Stem
 Chevrolet; HHR; 2010
 Chevrolet; HHR; 2011
 Chevrolet; Impala; 2007; Snap-In Style Only; W/Rubber Valve Stem
 Chevrolet; Impala; 2008-2013
 Chevrolet; Impala; 2014-2015
 Chevrolet; Impala; 2016-2018
 Chevrolet; Malibu; 2008; Snap-In Style Only; W/Rubber Valve Stem
 Chevrolet; Malibu; 2009
 Chevrolet; Malibu; 2010
 Chevrolet; Malibu; 2011-2012
 Chevrolet; Malibu; 2013-2015
 Chevrolet; Malibu; 2016-2018
 Chevrolet; Malibu Limited; 2015-2018
 Chevrolet; Monte Carlo; 2007; Snap-In Style Only; W/Rubber Valve Stem
 Chevrolet; Orlando; 2012-2014
 Chevrolet; Orlando; 2017
 Chevrolet; Silverado Series; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic
 Chevrolet; Silverado Series; 2008
 Chevrolet; Silverado Series; 2008; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2009
 Chevrolet; Silverado Series; 2009; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2010
 Chevrolet; Silverado Series; 2010; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2011
 Chevrolet; Silverado Series; 2011; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2012
 Chevrolet; Silverado Series; 2012; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2013; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2014-2015; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2016-2018; W/Single Rear Wheels
 Chevrolet; Sonic; 2012-2015
 Chevrolet; Sonic; 2016-2018
 Chevrolet; Spark; 2013-2015
 Chevrolet; Spark; 2016-2017
 Chevrolet; Suburban; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
 Chevrolet; Suburban; 2008-2014
 Chevrolet; Suburban; 2015
 Chevrolet; Suburban; 2016-2018
 Chevrolet; Tahoe; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
 Chevrolet; Tahoe; 2008-2013
 Chevrolet; Tahoe; 2014-2015
 Chevrolet; Tahoe; 2016-2017
 Chevrolet; Traverse; 2009-2015
 Chevrolet; Traverse; 2016-2018
 Chevrolet; Trax; 2013-2015
 Chevrolet; Trax; 2016-2017
 Chevrolet; Trax; 2018
 Chevrolet; Volt; 2011-2015
 Chevrolet; Volt; 2016
 Chevrolet; Volt; 2017-2018; Exc. ZL1
 GMC; Acadia; 2009-2015
 GMC; Acadia; 2016-2017
 GMC; Canyon; 2015-2018

Numerical Listing

GMC; Savana Series; 2010-2015
 GMC; Savana Series; 2016-2018
 GMC; Sierra Series; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic
 GMC; Sierra Series; 2008
 GMC; Sierra Series; 2008; W/Single Rear Wheels
 GMC; Sierra Series; 2009
 GMC; Sierra Series; 2009; W/Single Rear Wheels
 GMC; Sierra Series; 2010
 GMC; Sierra Series; 2010; W/Single Rear Wheels
 GMC; Sierra Series; 2011
 GMC; Sierra Series; 2011; W/Single Rear Wheels
 GMC; Sierra Series; 2012
 GMC; Sierra Series; 2012; W/Single Rear Wheels
 GMC; Sierra Series; 2013; W/Single Rear Wheels
 GMC; Sierra Series; 2014; W/Single Rear Wheels
 GMC; Sierra Series; 2015
 GMC; Sierra Series; 2015; W/Single Rear Wheels
 GMC; Sierra Series; 2016
 GMC; Sierra Series; 2016; W/Single Rear Wheels
 GMC; Sierra Series; 2017
 GMC; Sierra Series; 2017; W/Single Rear Wheels
 GMC; Terrain; 2010-2014
 GMC; Terrain; 2015; Rubber Valve
 GMC; Terrain; 2016-2017; Rubber Valve
 GMC; Yukon; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
 GMC; Yukon; 2008-2013
 GMC; Yukon; 2014-2015
 GMC; Yukon; 2016-2017
 Hummer; H2; 2008-2009
 Hyundai; Veloster; 2012-2016
 Pontiac; G Series; 2008
 Pontiac; G Series; 2009-2010
 Pontiac; Grand Prix; 2008; Snap-In Style Only; W/Rubber Valve Stem
 Pontiac; Wave; 2008
 Saab; 9-4X; 2011
 Saturn; Aura; 2008-2009
 Saturn; Outlook; 2009-2010
 Saturn; Vue; 2007-2010
 Subaru; Forester; 2008-2015
 Subaru; Forester; 2016
 Subaru; Impreza; 2008-2015
 Subaru; Impreza; 2016
 Subaru; Legacy; 2008; W/18" Wheels
 Subaru; Legacy; 2009-2015
 Subaru; Legacy; 2016
 Subaru; Outback; 2008-2015
 Subaru; Outback; 2016-2017
 Subaru; Tribeca; 2008
 Subaru; Tribeca; 2009; Rubber Valve
 Subaru; Tribeca; 2010
 Subaru; Tribeca; 2011; Rubber Valve
 Subaru; Tribeca; 2012-2014
 Subaru; WRX; 2013-2015
 Subaru; WRX; 2016
 Subaru; XV Crosstrek; 2013-2015
 Subaru; XV Crosstrek; 2016
 Suzuki; Forenza; 2007-2008
 Suzuki; Reno; 2007-2008
 Volvo; XC90; 2012-2015

Service Pack

2009 (Interchanges with 2005, 2010)



Infiniti; QX56; 2004
 Infiniti; QX56; 2005-2006; W/Steel Wheels
 Lotus; Elise; 2008-2015
 Lotus; Evora; 2010-2013
 Lotus; Evora; 2014
 Lotus; Evora; 2015
 Lotus; Exige; 2008-2015
 Mitsubishi; Eclipse; 2006-2007; W/Steel Wheels
 Mitsubishi; Endeavor; 2011; W/Steel Wheels
 Mitsubishi; Galant; 2007-2009; W/Steel Wheels
 Mitsubishi; Galant; 2010-2012; W/Steel Wheels
 Nissan; Armada; 2005-2006; W/Steel Wheels
 Nissan; Frontier; 2005-2007; W/Steel Wheels
 Nissan; Pathfinder; 2004; Armada
 Nissan; Pathfinder; 2004; Exc. Armada; Aug. & Newer
 Nissan; Quest; 2004
 Nissan; Quest; 2005-2006; W/Steel Wheels
 Nissan; Titan; 2004
 Nissan; Titan; 2005; Mar. & Older
 Nissan; Xterra; 2006; Submodel X
 Porsche; 911; 2012
 Saab; 9-3; 2003-2007
 Saab; 9-3; 2008-2011
 Saab; 9-3X; 2010-2011
 Saab; 9-5; 2003-2007
 Saab; 9-5; 2008-2011
 Saturn; Astra; 2008-2009
 Suzuki; Grand Vitara; 2007-2013
 Suzuki; SX4; 2007-2013
 Suzuki; SX4 Crossover; 2012
 Suzuki; Verona; 2005-2006
 Suzuki; XL-7; 2005-2006
 Volvo; S60,S80; 2004; W/315 MHz Sensor
 Volvo; S60,S80; 2004-2005
 Volvo; S60,S80; 2005; W/315 MHz Sensor
 Volvo; S60,S80; 2006-2009
 Volvo; V70; 2004-2007; W/315 MHz Sensor
 Volvo; XC70; 2004-2007; W/315 MHz Sensor
 Volvo; XC90; 2004
 Volvo; XC90; 2005-2007; W/315 MHz Sensor
 Volvo; XC90; 2008-2011

Numerical Listing

Service Pack

2010



Mitsubishi; Eclipse; 2006-2007; W/Steel Wheels
 Mitsubishi; Endeavor; 2011; W/Steel Wheels
 Mitsubishi; Galant; 2007-2009; W/Steel Wheels
 Mitsubishi; Galant; 2010-2012; W/Steel Wheels
 Volvo; S60,S80; 2004
 Volvo; S60,S80; 2004; W/315 MHz Sensor
 Volvo; S60,S80; 2005
 Volvo; S60,S80; 2005; W/315 MHz Sensor
 Volvo; S60,S80; 2006-2009
 Volvo; V70; 2004-2007; W/315 MHz Sensor
 Volvo; XC70; 2004-2007; W/315 MHz Sensor
 Volvo; XC90; 2004
 Volvo; XC90; 2005-2007; W/315 MHz Sensor
 Volvo; XC90; 2008-2011

2011



Subaru; B9 Tribeca; 2006-2007
 Subaru; Legacy; 2004-2007
 Subaru; Legacy; 2008; W/16" Or 17" Wheels
 Subaru; Outback; 2004-2007
 Subaru; Tribeca; 2008; W/Metal Stem Clamp-in Sensor
 Subaru; Tribeca; 2009; W/Metal Stem Clamp-in Sensor
 Subaru; Tribeca; 2010; W/Metal Stem Clamp-in Sensor
 Subaru; Tribeca; 2011; W/Metal Stem Clamp-in Sensor


2012



Chevrolet; Corvette; 1997-2000
 Chrysler; Prowler; 2001; W/Black Sensor Body
 Plymouth; Prowler; 1997; W/Black Sensor Body
 Plymouth; Prowler; 1998; W/Black Sensor Body
 Plymouth; Prowler; 1999-2001; W/Black Sensor Body

Service Pack

2013 (Interchanges with 20016)

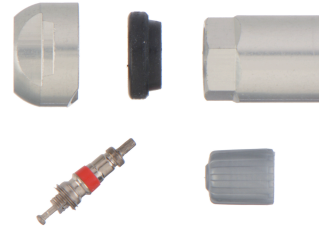

Chrysler; 200; 2011; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; 200; 2012; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; 300; 2005-2006; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; 300; 2007; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; 300; 2008; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; 300; 2009-2010; Does Not Include Stem
 Chrysler; 300; 2012; W/Metal Stem Clamp-in Sensor; Does Not Include Stem
 Chrysler; Aspen; 2007-2011; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; Crossfire; 2005; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; Pacifica; 2006-2007; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; Pacifica; 2008; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; PT Cruiser; 2008-2010; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; Sebring; 2007-2009; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; Sebring; 2010; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; Town & Country; 2006-2007; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; Town & Country; 2008; Fits Schrader Alum stem sensor. Does not include stem.
 Chrysler; Town & Country; 2009-2010; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Avenger; 2008-2009; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Avenger; 2010-2012; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Caliber; 2007-2010; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Caliber; 2011-2012; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Caravan; 2006-2007; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Challenger; 2008; Does Not Include Stem
 Dodge; Challenger; 2009; Does Not Include Stem
 Dodge; Challenger; 2010-2012; W/Metal Stem Clamp-in Sensor; Does Not Include Stem
 Dodge; Charger; 2006-2007; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Charger; 2008; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Charger; 2009; Does Not Include Stem
 Dodge; Charger; 2010; W/Metal Stem Clamp-in Sensor; Does Not Include Stem
 Dodge; Dakota; 2008-2010; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Durango; 2007; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Durango; 2008; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Durango; 2009; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Grand Caravan; 2006-2007; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Grand Caravan; 2008-2010; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Journey; 2009; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Journey; 2010; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Magnum; 2005-2007; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Magnum; 2008; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Nitro; 2007-2008; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Nitro; 2009-2011; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Ram Series; 2008; Fits Schrader Alum stem sensor. Does not include stem.

Numerical Listing

Dodge; Ram Series; 2009; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Ram Series; 2010; Fits Schrader Alum stem sensor. Does not include stem.
 Dodge; Viper; 2012-2013; W/Metal Stem Clamp-in Sensor; Does Not Include Stem
 Dodge; Viper; 2014-2015; W/Metal Stem Clamp-in Sensor; Does Not Include Stem
 Dodge; Viper; 2016-2018; W/Metal Stem Clamp-in Sensor; Does Not Include Stem
 Jeep; Commander; 2006-2007; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Commander; 2008-2010; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Compass; 2007-2010; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Compass; 2011; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Grand Cherokee; 2005-2007; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Grand Cherokee; 2008-2010; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Liberty; 2005-2008; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Liberty; 2009; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Liberty; 2010-2012; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Patriot; 2007-2010; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Patriot; 2011-2012; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Wrangler; 2007-2008; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Wrangler; 2009-2010; Fits Schrader Alum stem sensor. Does not include stem.
 Jeep; Wrangler; 2011; Fits Schrader Alum stem sensor. Does not include stem.
 Mercedes-Benz; 550,63AMG; 2007-2009; Does Not Include Stem
 Mercedes-Benz; C Series; 2007; Jun. & Newer; Does Not Include Stem
 Mercedes-Benz; C Series; 2008-2009; Does Not Include Stem
 Mercedes-Benz; C Series; 2010-2012; Does Not Include Stem
 Mercedes-Benz; C Series; 2013; W/O Valve
 Mercedes-Benz; C250; 2012; Does Not Include Stem
 Mercedes-Benz; C250; 2013; W/O Valve
 Mercedes-Benz; C280; 2007; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; CLK; 2006; Does Not Include Stem
 Mercedes-Benz; CLK350; 2006-2009; Does Not Include Stem
 Mercedes-Benz; CLS550; 2012; Does Not Include Stem
 Mercedes-Benz; CLS550; 2013; W/O Valve
 Mercedes-Benz; E350; 2010-2012; Does Not Include Stem
 Mercedes-Benz; E350; 2013; W/O Valve
 Mercedes-Benz; E550; 2010-2011; Does Not Include Stem
 Mercedes-Benz; E550; 2012-2013; W/O Valve
 Mercedes-Benz; E63 AMG; 2010-2011; Does Not Include Stem
 Mercedes-Benz; E63 AMG; 2012-2013; W/O Valve
 Mercedes-Benz; G500; 2007; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; G500; 2008; Does Not Include Stem
 Mercedes-Benz; G55 AMG; 2007; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; G55 AMG; 2008-2010; Does Not Include Stem
 Mercedes-Benz; G55 AMG; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; G550; 2009-2010; Does Not Include Stem
 Mercedes-Benz; G550; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; G550; 2012-2013; W/O Valve
 Mercedes-Benz; GL; 2010; Does Not Include Stem
 Mercedes-Benz; GL; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; GL; 2012-2013; W/O Valve
 Mercedes-Benz; GL350; 2010; Does Not Include Stem
 Mercedes-Benz; GL350; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; GL350; 2012-2013; W/O Valve
 Mercedes-Benz; GL63 AMG; 2013; W/O Valve
 Mercedes-Benz; GLK350; 2010; Does Not Include Stem
 Mercedes-Benz; GLK350; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; GLK350; 2012; Does Not Include Stem
 Mercedes-Benz; GLK350; 2013; W/O Valve
 Mercedes-Benz; ML350; 2010; Does Not Include Stem
 Mercedes-Benz; ML350; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; ML350; 2012; Does Not Include Stem
 Mercedes-Benz; ML350; 2013; W/O Valve
 Mercedes-Benz; ML450; 2010; Does Not Include Stem
 Mercedes-Benz; ML450; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; ML550; 2010; Does Not Include Stem
 Mercedes-Benz; ML550; 2011-2012; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; ML63 AMG; 2010; Does Not Include Stem
 Mercedes-Benz; ML63 AMG; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; ML63 AMG; 2012-2013; W/O Valve
 Mercedes-Benz; R350; 2010; Does Not Include Stem

Mercedes-Benz; R350; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; R350; 2012; Does Not Include Stem
 Mercedes-Benz; R350; 2013; W/O Valve
 Mercedes-Benz; S Series; 2011; Does Not Include Stem
 Mercedes-Benz; S Series; 2012; W/O Valve
 Mercedes-Benz; S Series; 2013; W/O Valve
 Mercedes-Benz; S550; 2011; Does Not Include Stem
 Mercedes-Benz; S550; 2012-2013; W/O Valve
 Mercedes-Benz; S600; 2011; Does Not Include Stem
 Mercedes-Benz; S600; 2012-2013; W/O Valve
 Mercedes-Benz; S63 AMG; 2011; Does Not Include Stem
 Mercedes-Benz; S63 AMG; 2012-2013; W/O Valve
 Mercedes-Benz; S65 AMG; 2011; Does Not Include Stem
 Mercedes-Benz; S65 AMG; 2012-2013; W/O Valve
 Mercedes-Benz; SL550; 2012; Does Not Include Stem
 Mercedes-Benz; SL550; 2013; W/O Valve
 Mercedes-Benz; SL63 AMG; 2012; Does Not Include Stem
 Mercedes-Benz; SL63 AMG; 2013; W/O Valve
 Mercedes-Benz; SLK250; 2012; Does Not Include Stem
 Mercedes-Benz; SLK250; 2013; W/O Valve
 Mercedes-Benz; SLK280; 2007; May & Newer; Does Not Include Stem
 Mercedes-Benz; SLK280; 2008; Does Not Include Stem
 Mercedes-Benz; SLK300; 2009-2011; Does Not Include Stem
 Mercedes-Benz; SLK350; 2007; May & Newer; Does Not Include Stem
 Mercedes-Benz; SLK350; 2008-2012; Does Not Include Stem
 Mercedes-Benz; SLK350; 2013; W/O Valve
 Mercedes-Benz; SLK55 AMG; 2007; May & Newer; Does Not Include Stem
 Mercedes-Benz; SLK55 AMG; 2008-2010; Does Not Include Stem
 Mercedes-Benz; SLS AMG; 2011-2012; Does Not Include Stem
 Mercedes-Benz; SLS AMG; 2013; W/O Valve
 Mercedes-Benz; Sprinter 2500; 2014-2015; Does Not Include Stem
 Mercedes-Benz; Sprinter 2500; 2016; Does Not Include Stem
 Mercedes-Benz; Sprinter 2500; 2017-2018; Does Not Include Stem
 Mercedes-Benz; Sprinter 3500; 2014-2016; Does Not Include Stem
 Mercedes-Benz; Sprinter 3500; 2017; Does Not Include Stem
 Mercedes-Benz; Sprinter 3500; 2018; Does Not Include Stem
 Mitsubishi; Raider; 2008-2009; Fits Schrader Alum stem sensor. Does not include stem.
 Smart; Fortwo; 2008-2012; Does Not Include Stem
 Smart; Fortwo; 2013; W/O Valve
 Suzuki; Kizashi; 2010-2012; Fits Schrader Alum stem sensor. Does not include stem.

Numerical Listing

Service Pack

2014



Infiniti; EX35; 2008-2010
 Infiniti; FX35; 2007; Jul. & Newer
 Infiniti; FX35; 2008
 Infiniti; FX35; 2009-2010
 Infiniti; FX45; 2007; Jul. & Newer
 Infiniti; FX45; 2008
 Infiniti; FX50; 2009-2010
 Infiniti; G35; 2007
 Infiniti; G35; 2008
 Infiniti; G37; 2008-2010
 Infiniti; M35; 2008-2010
 Infiniti; M35h; 2012
 Infiniti; M37; 2011-2012
 Infiniti; M45; 2008-2009
 Infiniti; M45; 2010
 Infiniti; M56; 2011-2012
 Infiniti; Q45; 2006; Aug. & Newer
 Infiniti; QX56; 2007; Apr. 1 & Newer
 Infiniti; QX56; 2008-2010
 Nissan; 350Z; 2007-2009
 Nissan; 370Z; 2009-2010
 Nissan; Altima; 2006; Oct. 1 & Newer
 Nissan; Altima; 2007-2010
 Nissan; Altima; 2011-2012
 Nissan; Armada; 2008; LE
 Nissan; Armada; 2009-2011
 Nissan; Armada; 2012-2015
 Nissan; Armada; 2016
 Nissan; Cube; 2009-2010
 Nissan; Cube; 2011-2012; non-Ikey
 Nissan; Frontier; 2008; W/Steel Wheels
 Nissan; Frontier; 2009-2011
 Nissan; Frontier; 2012-2015
 Nissan; Frontier; 2016
 Nissan; GT-R; 2009
 Nissan; GT-R; 2010
 Nissan; GT-R; 2011-2016
 Nissan; GT-R; 2017-2018
 Nissan; Juke; 2011
 Nissan; Juke; 2012
 Nissan; Maxima; 2007; Apr. 1 & Newer
 Nissan; Maxima; 2008-2010
 Nissan; Maxima; 2011-2012
 Nissan; Murano; 2007
 Nissan; Murano; 2009
 Nissan; Murano; 2010
 Nissan; Murano; 2011
 Nissan; Murano; 2012-2014
 Nissan; NV; 2012
 Nissan; NV; 2013-2015
 Nissan; NV; 2016
 Nissan; NV; 2017
 Nissan; Pathfinder; 2007
 Nissan; Pathfinder; 2008-2011
 Nissan; Pathfinder; 2012
 Nissan; Quest; 2007-2009
 Nissan; Rogue; 2008-2009
 Nissan; Rogue; 2011
 Nissan; Rogue; 2012
 Nissan; Rogue Select; 2014-2015

Nissan; Sentra; 2007; W/Steel Wheels
 Nissan; Sentra; 2008
 Nissan; Sentra; 2009-2010
 Nissan; Sentra; 2011-2013
 Nissan; Titan; 2007; Apr. 1 & Newer
 Nissan; Titan; 2008-2011
 Nissan; Titan; 2012-2015
 Nissan; Versa; 2007
 Nissan; Versa; 2008-2010
 Nissan; Versa; 2011-2012
 Nissan; Xterra; 2007
 Nissan; Xterra; 2008-2011
 Nissan; Xterra; 2012-2015
 Nissan; Xterra; 2016
 Suzuki; Equator; 2009-2012

2015



Cadillac; Escalade; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Chevrolet; Avalanche; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Chevrolet; Silverado Series; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic
 Chevrolet; Suburban; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 Chevrolet; Tahoe; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem
 GMC; Sierra Series; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem; Exc. Classic
 GMC; Yukon; 2007; Clamp-In Style Only; TRW Sensor; W/Aluminium Valve Stem

Numerical Listing

Service Pack

20016



Chrysler; 300; 2009-2010; Does Not Include Stem
 Chrysler; 300; 2012; W/Metal Stem Clamp-in Sensor; Does Not Include Stem
 Dodge; Challenger; 2008; Does Not Include Stem
 Dodge; Challenger; 2009; Does Not Include Stem
 Dodge; Challenger; 2010-2012; W/Metal Stem Clamp-in Sensor; Does Not Include Stem
 Dodge; Charger; 2009; Does Not Include Stem
 Dodge; Charger; 2010; W/Metal Stem Clamp-in Sensor; Does Not Include Stem
 Dodge; Viper; 2012-2013; W/Metal Stem Clamp-in Sensor; Does Not Include Stem
 Dodge; Viper; 2014-2015; W/Metal Stem Clamp-in Sensor; Does Not Include Stem
 Dodge; Viper; 2016-2018; W/Metal Stem Clamp-in Sensor; Does Not Include Stem
 Mercedes-Benz; 550,63AMG; 2007-2009; Does Not Include Stem
 Mercedes-Benz; C Series; 2007; Jun. & Newer; Does Not Include Stem
 Mercedes-Benz; C Series; 2008-2009; Does Not Include Stem
 Mercedes-Benz; C Series; 2010-2012; Does Not Include Stem
 Mercedes-Benz; C Series; 2013; W/O Valve
 Mercedes-Benz; C250; 2012; Does Not Include Stem
 Mercedes-Benz; C250; 2013; W/O Valve
 Mercedes-Benz; C280; 2007; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; CLK; 2006; Does Not Include Stem
 Mercedes-Benz; CLK350; 2006-2009; Does Not Include Stem
 Mercedes-Benz; CLS550; 2012; Does Not Include Stem
 Mercedes-Benz; CLS550; 2013; W/O Valve
 Mercedes-Benz; E350; 2010-2012; Does Not Include Stem
 Mercedes-Benz; E350; 2013; W/O Valve
 Mercedes-Benz; E550; 2010-2011; Does Not Include Stem
 Mercedes-Benz; E550; 2012-2013; W/O Valve
 Mercedes-Benz; E63 AMG; 2010-2011; Does Not Include Stem
 Mercedes-Benz; E63 AMG; 2012-2013; W/O Valve
 Mercedes-Benz; G500; 2007; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; G500; 2008; Does Not Include Stem
 Mercedes-Benz; G55 AMG; 2007; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; G55 AMG; 2008-2010; Does Not Include Stem
 Mercedes-Benz; G55 AMG; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; G550; 2009-2010; Does Not Include Stem
 Mercedes-Benz; G550; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; G550; 2012-2013; W/O Valve
 Mercedes-Benz; GL; 2010; Does Not Include Stem
 Mercedes-Benz; GL; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; GL; 2012-2013; W/O Valve
 Mercedes-Benz; GL350; 2010; Does Not Include Stem
 Mercedes-Benz; GL350; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; GL350; 2012-2013; W/O Valve
 Mercedes-Benz; GL63 AMG; 2013; W/O Valve
 Mercedes-Benz; GLK350; 2010; Does Not Include Stem
 Mercedes-Benz; GLK350; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; GLK350; 2012; Does Not Include Stem
 Mercedes-Benz; GLK350; 2013; W/O Valve
 Mercedes-Benz; ML350; 2010; Does Not Include Stem
 Mercedes-Benz; ML350; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; ML350; 2012; Does Not Include Stem
 Mercedes-Benz; ML350; 2013; W/O Valve
 Mercedes-Benz; ML450; 2010; Does Not Include Stem
 Mercedes-Benz; ML450; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; ML550; 2010; Does Not Include Stem
 Mercedes-Benz; ML550; 2011-2012; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; ML63 AMG; 2010; Does Not Include Stem
 Mercedes-Benz; ML63 AMG; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; ML63 AMG; 2012-2013; W/O Valve
 Mercedes-Benz; R350; 2010; Does Not Include Stem

Mercedes-Benz; R350; 2011; Mar. & Newer; Does Not Include Stem
 Mercedes-Benz; R350; 2012; Does Not Include Stem
 Mercedes-Benz; R350; 2013; W/O Valve
 Mercedes-Benz; S Series; 2011; Does Not Include Stem
 Mercedes-Benz; S Series; 2012; W/O Valve
 Mercedes-Benz; S Series; 2013; W/O Valve
 Mercedes-Benz; S550; 2011; Does Not Include Stem
 Mercedes-Benz; S550; 2012-2013; W/O Valve
 Mercedes-Benz; S600; 2011; Does Not Include Stem
 Mercedes-Benz; S600; 2012-2013; W/O Valve
 Mercedes-Benz; S63 AMG; 2011; Does Not Include Stem
 Mercedes-Benz; S63 AMG; 2012-2013; W/O Valve
 Mercedes-Benz; S65 AMG; 2011; Does Not Include Stem
 Mercedes-Benz; S65 AMG; 2012-2013; W/O Valve
 Mercedes-Benz; SL550; 2012; Does Not Include Stem
 Mercedes-Benz; SL550; 2013; W/O Valve
 Mercedes-Benz; SL63 AMG; 2012; Does Not Include Stem
 Mercedes-Benz; SL63 AMG; 2013; W/O Valve
 Mercedes-Benz; SLK250; 2012; Does Not Include Stem
 Mercedes-Benz; SLK250; 2013; W/O Valve
 Mercedes-Benz; SLK280; 2007; May & Newer; Does Not Include Stem
 Mercedes-Benz; SLK280; 2008; Does Not Include Stem
 Mercedes-Benz; SLK300; 2009-2011; Does Not Include Stem
 Mercedes-Benz; SLK350; 2007; May & Newer; Does Not Include Stem
 Mercedes-Benz; SLK350; 2008-2012; Does Not Include Stem
 Mercedes-Benz; SLK350; 2013; W/O Valve
 Mercedes-Benz; SLK55 AMG; 2007; May & Newer; Does Not Include Stem
 Mercedes-Benz; SLK55 AMG; 2008-2010; Does Not Include Stem
 Mercedes-Benz; SLS AMG; 2011-2012; Does Not Include Stem
 Mercedes-Benz; SLS AMG; 2013; W/O Valve
 Mercedes-Benz; Sprinter 2500; 2014-2015; Does Not Include Stem
 Mercedes-Benz; Sprinter 2500; 2016; Does Not Include Stem
 Mercedes-Benz; Sprinter 2500; 2017-2018; Does Not Include Stem
 Mercedes-Benz; Sprinter 3500; 2014-2016; Does Not Include Stem
 Mercedes-Benz; Sprinter 3500; 2017; Does Not Include Stem
 Mercedes-Benz; Sprinter 3500; 2018; Does Not Include Stem
 Smart; Fortwo; 2008-2012; Does Not Include Stem
 Smart; Fortwo; 2013; W/O Valve

20017



Audi; A3, A4, A5 & Quattro; 2008
 Audi; A3, A4, A5 & Quattro; 2009-2012
 Audi; Q5; 2009-2012
 Audi; S4; 2010-2011
 Audi; S5; 2008-2012
 Audi; TT; 2008-2009
 Audi; TT Quattro; 2008-2009
 Volkswagen; Beetle; 2007-2010
 Volkswagen; CC; 2009-2014
 Volkswagen; Eos; 2007-2016
 Volkswagen; Golf; 2006-2007
 Volkswagen; Golf; 2010
 Volkswagen; GTI; 2006-2007; W/16" Or 17" Wheels
 Volkswagen; GTI; 2008-2010
 Volkswagen; Jetta; 2006-2007
 Volkswagen; Jetta; 2008-2009
 Volkswagen; Jetta; 2010
 Volkswagen; Passat; 2006-2008; W/16" Or 17" Wheels
 Volkswagen; Passat; 2009-2011
 Volkswagen; R32; 2008-2011
 Volkswagen; Rabbit; 2006-2007; W/15" Wheels
 Volkswagen; Rabbit; 2008-2009
 Volkswagen; Tiguan; 2008-2012

Numerical Listing

Service Pack

2018 (Interchanges with 20008)



Alfa Romeo; 4C; 2012-2016; Rubber Valve
 Buick; Allure; 2009
 Buick; Allure; 2010
 Buick; Cascada; 2016-2017
 Buick; Enclave; 2009-2015
 Buick; Enclave; 2016
 Buick; Enclave; 2017-2018
 Buick; Encore; 2013-2015
 Buick; Encore; 2016-2018
 Buick; Envision; 2016-2018
 Buick; LaCrosse; 2009
 Buick; LaCrosse; 2010-2015
 Buick; LaCrosse; 2016
 Buick; LaCrosse; 2017-2018; Exc. ZL1
 Buick; Lucerne; 2007-2011
 Buick; Regal; 2011-2016
 Buick; Regal; 2017
 Buick; Regal; 2018
 Buick; Verano; 2012-2015
 Buick; Verano; 2016-2018
 Cadillac; ATS; 2013; exc V
 Cadillac; ATS; 2014; exc V
 Cadillac; ATS; 2015; exc V
 Cadillac; ATS; 2016-2018; exc V
 Cadillac; CT6; 2016; Exc. ZL1
 Cadillac; CT6; 2017-2018; Exc. ZL1
 Cadillac; CTS; 2008
 Cadillac; CTS; 2009-2011; OEM Part No. 25920615; Exc. CTS V
 Cadillac; CTS; 2012; OEM Part No. 25920615; Exc. CTS V
 Cadillac; CTS; 2013; OEM Part No. 25920615; Exc. CTS V
 Cadillac; CTS; 2014-2015; exc V
 Cadillac; CTS; 2016-2018; exc V
 Cadillac; DTS; 2007-2011
 Cadillac; ELR; 2014
 Cadillac; ELR; 2015-2017
 Cadillac; Escalade; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
 Cadillac; Escalade; 2008
 Cadillac; Escalade; 2009-2011
 Cadillac; Escalade; 2012-2013
 Cadillac; Escalade; 2014-2015
 Cadillac; Escalade; 2016-2018
 Cadillac; SRX; 2007-2009
 Cadillac; SRX; 2010-2015
 Cadillac; SRX; 2016
 Cadillac; STS; 2009; OEM Part No. 25920615; Exc. STS V
 Cadillac; STS; 2010
 Cadillac; STS; 2011
 Cadillac; XT5; 2017-2018
 Cadillac; XTS; 2013-2015
 Cadillac; XTS; 2016-2018
 Chevrolet; Avalanche; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
 Chevrolet; Avalanche; 2008
 Chevrolet; Avalanche; 2009-2013
 Chevrolet; Aveo; 2007
 Chevrolet; Aveo; 2008-2011
 Chevrolet; Aveo5; 2007
 Chevrolet; Aveo5; 2008-2011
 Chevrolet; Bolt EV; 2017-2018; Exc. ZL1

Chevrolet; Camaro; 2010-2011
 Chevrolet; Camaro; 2012; Exc. ZL1
 Chevrolet; Camaro; 2013-2015; Exc. ZL1
 Chevrolet; Camaro; 2016-2017; Exc. ZL1
 Chevrolet; Camaro; 2018; Exc. ZL1
 Chevrolet; Caprice; 2017
 Chevrolet; Captiva Sport; 2012-2013
 Chevrolet; Captiva Sport; 2017
 Chevrolet; Cobalt; 2008; Snap-In Style Only; W/Rubber Valve Stem
 Chevrolet; Cobalt; 2009; Snap-In Style Only; W/Rubber Valve Stem
 Chevrolet; Cobalt; 2010
 Chevrolet; Colorado; 2015
 Chevrolet; Colorado; 2016-2018
 Chevrolet; Cruze; 2011-2015
 Chevrolet; Cruze; 2016
 Chevrolet; Cruze; 2017-2018; Exc. ZL1
 Chevrolet; Equinox; 2010-2014
 Chevrolet; Equinox; 2015-2018
 Chevrolet; Express; 2010-2015
 Chevrolet; Express; 2016-2018
 Chevrolet; HHR; 2008-2009; Snap-In Style Only; W/Rubber Valve Stem
 Chevrolet; HHR; 2010
 Chevrolet; HHR; 2011
 Chevrolet; Impala; 2007; Snap-In Style Only; W/Rubber Valve Stem
 Chevrolet; Impala; 2008-2013
 Chevrolet; Impala; 2014-2015
 Chevrolet; Impala; 2016-2018
 Chevrolet; Malibu; 2008; Snap-In Style Only; W/Rubber Valve Stem
 Chevrolet; Malibu; 2009
 Chevrolet; Malibu; 2010
 Chevrolet; Malibu; 2011-2012
 Chevrolet; Malibu; 2013-2015
 Chevrolet; Malibu; 2016-2018
 Chevrolet; Malibu Limited; 2015-2018
 Chevrolet; Monte Carlo; 2007; Snap-In Style Only; W/Rubber Valve Stem
 Chevrolet; Orlando; 2012-2014
 Chevrolet; Orlando; 2017
 Chevrolet; Silverado Series; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic
 Chevrolet; Silverado Series; 2008; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2008-2009
 Chevrolet; Silverado Series; 2009-2010; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2010-2011
 Chevrolet; Silverado Series; 2011-2012; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2012
 Chevrolet; Silverado Series; 2013; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2014-2015; W/Single Rear Wheels
 Chevrolet; Silverado Series; 2016-2018; W/Single Rear Wheels
 Chevrolet; Sonic; 2012-2015
 Chevrolet; Sonic; 2016-2018
 Chevrolet; Spark; 2013-2015
 Chevrolet; Spark; 2016-2017
 Chevrolet; Suburban; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
 Chevrolet; Suburban; 2008-2014
 Chevrolet; Suburban; 2015
 Chevrolet; Suburban; 2016-2018
 Chevrolet; Tahoe; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
 Chevrolet; Tahoe; 2008-2013
 Chevrolet; Tahoe; 2014-2015
 Chevrolet; Tahoe; 2016-2017
 Chevrolet; Traverse; 2009-2015
 Chevrolet; Traverse; 2016-2018
 Chevrolet; Trax; 2013-2015
 Chevrolet; Trax; 2016
 Chevrolet; Trax; 2016; Rubber Valve
 Chevrolet; Trax; 2017
 Chevrolet; Trax; 2017; Rubber Valve
 Chevrolet; Trax; 2018
 Chevrolet; Volt; 2011-2015
 Chevrolet; Volt; 2016
 Chevrolet; Volt; 2017-2018; Exc. ZL1
 Chrysler; 200; 2011; Rubber Valve
 Chrysler; 200; 2012; Rubber Valve

Numerical Listing

Chrysler; 200; 2013-2014; Rubber Valve	Ford; Escape; 2016-2018; Rubber Valve
Chrysler; 300; 2005-2006; Rubber Valve	Ford; E-Series Van; 2010; Rubber Valve
Chrysler; 300; 2007; Rubber Valve	Ford; E-Series Van; 2010; W/Steel Wheels
Chrysler; 300; 2008; Rubber Valve	Ford; E-Series Van; 2011-2013; Rubber Valve
Chrysler; 300; 2009-2010; Rubber Valve	Ford; E-Series Van; 2014-2015; Rubber Valve
Chrysler; 300; 2011; Rubber Valve	Ford; E-Series Van; 2016-2018; Rubber Valve
Chrysler; 300; 2012; Rubber Valve	Ford; Expedition; 2011-2015; Rubber Valve
Chrysler; 300; 2012; W/Rubber Stem Snap-in Sensor	Ford; Expedition; 2016-2017; Rubber Valve
Chrysler; 300; 2013-2015; Rubber Valve	Ford; Expedition; 2018; Rubber Valve
Chrysler; 300; 2016-2018; Rubber Valve	Ford; Explorer; 2011-2014; Rubber Valve
Chrysler; Aspen; 2007-2011; Rubber Valve	Ford; Explorer; 2015; Rubber Valve
Chrysler; Aspen; 2012-2015; Rubber Valve	Ford; Explorer; 2016-2017; Rubber Valve
Chrysler; Crossfire; 2005; Rubber Valve	Ford; Explorer; 2018; Rubber Valve
Chrysler; Pacifica; 2006-2007; Rubber Valve	Ford; F-150; 2009-2014; Rubber Valve
Chrysler; Pacifica; 2008; Rubber Valve	Ford; F-150; 2015-2018; Rubber Valve
Chrysler; PT Cruiser; 2008-2010; Rubber Valve	Ford; F-250 Super Duty; 2011-2015; Rubber Valve
Chrysler; Sebring; 2007-2009; Rubber Valve	Ford; F-250 Super Duty; 2016; Rubber Valve
Chrysler; Sebring; 2010; Rubber Valve	Ford; F-350 Super Duty; 2011-2015; Rubber Valve
Chrysler; Town & Country; 2006-2007; Rubber Valve	Ford; F-350 Super Duty; 2016; Rubber Valve
Chrysler; Town & Country; 2008; Rubber Valve	Ford; F-450 Super Duty; 2014-2016; Rubber Valve
Chrysler; Town & Country; 2009-2010; Rubber Valve	Ford; Fiesta; 2011-2015; Rubber Valve
Chrysler; Town & Country; 2011-2015; Rubber Valve	Ford; Fiesta; 2016-2018; Rubber Valve
Chrysler; Town & Country; 2016-2018; Rubber Valve	Ford; Flex; 2011-2015; Rubber Valve
Dodge; Avenger; 2008-2009; Rubber Valve	Ford; Flex; 2016-2018; Rubber Valve
Dodge; Avenger; 2010-2012; Rubber Valve	Ford; Focus; 2010; Rubber Valve
Dodge; Avenger; 2013-2014; Rubber Valve	Ford; Focus; 2011; Rubber Valve
Dodge; Caliber; 2007-2010; Rubber Valve	Ford; Focus; 2012-2015; Rubber Valve
Dodge; Caliber; 2011-2012; Rubber Valve	Ford; Focus; 2016; Rubber Valve
Dodge; Caravan; 2006-2007; Rubber Valve	Ford; Focus; 2017-2018; Rubber Valve
Dodge; Challenger; 2008; Rubber Valve	Ford; Fusion; 2010-2015; Rubber Valve
Dodge; Challenger; 2010-2012; Rubber Valve	Ford; Fusion; 2016; Rubber Valve
Dodge; Challenger; 2013-2015; W/Rubber Stem Snap-in Sensor	Ford; Mustang; 2010-2011; Rubber Valve
Dodge; Challenger; 2016-2018; W/Rubber Stem Snap-in Sensor	Ford; Mustang; 2012; exc Shelby GT500
Dodge; Charger; 2006-2007; Rubber Valve	Ford; Mustang; 2013; exc Shelby GT500
Dodge; Charger; 2008; Rubber Valve	Ford; Mustang; 2014; exc Shelby GT500
Dodge; Charger; 2010; Rubber Valve	Ford; Mustang; 2015; Rubber Valve
Dodge; Charger; 2011; Rubber Valve	Ford; Mustang; 2016; Rubber Valve
Dodge; Charger; 2012-2015; Rubber Valve	Ford; Mustang; 2017; Rubber Valve
Dodge; Charger; 2016-2018; Rubber Valve	Ford; Taurus; 2010; May & Newer
Dodge; Dakota; 2008-2010; Rubber Valve	Ford; Taurus; 2011-2015; Rubber Valve
Dodge; Durango; 2007; Rubber Valve	Ford; Taurus; 2016-2018; Rubber Valve
Dodge; Durango; 2008; Rubber Valve	Ford; Transit; 2014-2015; Rubber Valve
Dodge; Durango; 2009; Rubber Valve	Ford; Transit; 2016-2018; Rubber Valve
Dodge; Durango; 2011-2015; Rubber Valve	Ford; Transit Connect; 2010-2015; Rubber Valve
Dodge; Grand Caravan; 2006-2007; Rubber Valve	Ford; Transit Connect; 2016-2018; Rubber Valve
Dodge; Grand Caravan; 2008-2010; Rubber Valve	GMC; Acadia; 2009-2015
Dodge; Grand Caravan; 2011-2015; Rubber Valve	GMC; Acadia; 2016-2017
Dodge; Grand Caravan; 2016-2018; Rubber Valve	GMC; Acadia; 2018; Rubber Valve
Dodge; Journey; 2009; Rubber Valve	GMC; Canyon; 2015-2018
Dodge; Journey; 2010; Rubber Valve	GMC; Savana Series; 2010-2015
Dodge; Journey; 2011-2015; Rubber Valve	GMC; Savana Series; 2016-2018
Dodge; Journey; 2016-2018; Rubber Valve	GMC; Sierra Series; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem; Exc. Classic
Dodge; Magnum; 2005-2007; Rubber Valve	GMC; Sierra Series; 2008
Dodge; Magnum; 2008; Rubber Valve	GMC; Sierra Series; 2008-2009; W/Single Rear Wheels
Dodge; Magnum; 2009-2011; Rubber Valve	GMC; Sierra Series; 2009-2010
Dodge; Nitro; 2007-2008; Rubber Valve	GMC; Sierra Series; 2010-2011; W/Single Rear Wheels
Dodge; Nitro; 2009-2011; Rubber Valve	GMC; Sierra Series; 2011-2012
Dodge; Ram 4500; 2010; W/Rubber Stem Snap-in Sensor	GMC; Sierra Series; 2012; W/Single Rear Wheels
Dodge; Ram 5500; 2010; W/Rubber Stem Snap-in Sensor	GMC; Sierra Series; 2013; W/Single Rear Wheels
Dodge; Ram Series; 2008; Rubber Valve	GMC; Sierra Series; 2014; W/Single Rear Wheels
Dodge; Ram Series; 2009; Rubber Valve	GMC; Sierra Series; 2015
Dodge; Ram Series; 2010; Rubber Valve	GMC; Sierra Series; 2015; W/Single Rear Wheels
Dodge; Ram Series; 2010; W/Rubber Stem Snap-in Sensor	GMC; Sierra Series; 2016
Dodge; Ram Series; 2011-2013; Rubber Valve	GMC; Sierra Series; 2016-2017; W/Single Rear Wheels
Fiat; 500; 2012-2015; Rubber Valve	GMC; Sierra Series; 2017
Fiat; 500; 2016-2018; Rubber Valve	GMC; Sierra Series; 2018; Rubber Valve
Fiat; 500X; 2017; Rubber Valve	GMC; Terrain; 2010-2014
Fiat; 500X; 2018; Rubber Valve	GMC; Terrain; 2015; Rubber Valve
Ford; C-Max; 2012-2015; Rubber Valve	GMC; Terrain; 2016-2017; Rubber Valve
Ford; C-Max; 2016-2018; Rubber Valve	GMC; Terrain; 2018; Rubber Valve
Ford; Edge; 2011-2014; Rubber Valve	GMC; Yukon; 2007; Snap-In Style Only; Schrader Sensor; W/Rubber Valve Stem
Ford; Edge; 2015-2017; Rubber Valve	GMC; Yukon; 2008-2013
Ford; Edge; 2018; Rubber Valve	GMC; Yukon; 2014-2015
Ford; Escape; 2009-2010; Rubber Valve	GMC; Yukon; 2016-2017
Ford; Escape; 2012-2015; Rubber Valve	

Numerical Listing

GMC; Yukon; 2018; Rubber Valve
 GMC; Yukon XL; 2017-2018; Rubber Valve
 Hummer; H2; 2008-2009
 Hyundai; Veloster; 2012-2016
 Jeep; Cherokee; 2014; Rubber Valve
 Jeep; Cherokee; 2015; Rubber Valve
 Jeep; Commander; 2006-2007; Rubber Valve
 Jeep; Commander; 2008-2010; Rubber Valve
 Jeep; Compass; 2007-2010; Rubber Valve
 Jeep; Compass; 2011; Rubber Valve
 Jeep; Compass; 2012-2015; Rubber Valve
 Jeep; Compass; 2016-2017; Rubber Valve
 Jeep; Grand Cherokee; 2005-2007; Rubber Valve
 Jeep; Grand Cherokee; 2008-2010; Rubber Valve
 Jeep; Grand Cherokee; 2011-2015; Rubber Valve
 Jeep; Liberty; 2005-2008; Rubber Valve
 Jeep; Liberty; 2009; Rubber Valve
 Jeep; Liberty; 2010-2012; Rubber Valve
 Jeep; Patriot; 2007-2008; Rubber Valve
 Jeep; Patriot; 2011-2012; Rubber Valve
 Jeep; Patriot; 2013-2015; Rubber Valve
 Jeep; Patriot; 2016-2017; Rubber Valve
 Jeep; Wrangler; 2007-2008; Rubber Valve
 Jeep; Wrangler; 2009-2010; Rubber Valve
 Jeep; Wrangler; 2011; Rubber Valve
 Jeep; Wrangler; 2012; Rubber Valve
 Jeep; Wrangler; 2013-2015; Rubber Valve
 Jeep; Wrangler; 2016-2018; Rubber Valve
 Lincoln; Continental; 2017; Rubber Valve
 Lincoln; Cuv; 2014-2016; Rubber Valve
 Lincoln; Cuv; 2017; Rubber Valve
 Lincoln; Mark LT; 2013-2014; Rubber Valve
 Lincoln; Mark LT; 2015-2016; Rubber Valve
 Lincoln; MKC; 2015; Rubber Valve
 Lincoln; MKC; 2016-2017; Rubber Valve
 Lincoln; MKS; 2011-2015; Rubber Valve
 Lincoln; MKS; 2016; Rubber Valve
 Lincoln; MKT; 2011-2016; Rubber Valve
 Lincoln; MKT; 2017-2018; Rubber Valve
 Lincoln; MKX; 2011-2014; Rubber Valve
 Lincoln; MKX; 2015-2017; Rubber Valve
 Lincoln; MKZ; 2010-2015; Rubber Valve
 Lincoln; MKZ; 2016; Rubber Valve
 Lincoln; Navigator; 2011-2015; Rubber Valve
 Lincoln; Navigator; 2016-2017; Rubber Valve
 Lincoln; Town Car; 2011; Rubber Valve
 Mazda; Tribute; 2009-2011; Rubber Valve
 Mercedes-Benz; CLS550; 2017; Rubber Valve
 Mercedes-Benz; CLS63 AMG S; 2017; Rubber Valve
 Mercedes-Benz; Metris; 2015-2017
 Mercedes-Benz; Vito; 2016-2017
 Mercury; Mariner; 2009-2011; Rubber Valve
 Mercury; Milan; 2010-2011; Rubber Valve
 Mitsubishi; Lancer; 2012; Rubber Valve
 Pontiac; G Series; 2008
 Pontiac; G Series; 2009-2010
 Pontiac; Grand Prix; 2008; Snap-In Style Only; W/Rubber Valve Stem
 Pontiac; Wave; 2008
 Ram; 4500; 2012; Rubber Valve
 Ram; 5500; 2012; Rubber Valve
 Ram; C/V; 2012; Rubber Valve
 Ram; C/V; 2013-2015; Rubber Valve
 Ram; ProMaster; 2014-2015; Rubber Valve
 Ram; ProMaster; 2016-2018; Rubber Valve
 Ram; Promaster City; 2015-2016; Rubber Valve
 Ram; Promaster City; 2017-2018; Rubber Valve
 Ram; Ram Series; 2011; W/Rubber Stem Snap-in Sensor
 Ram; Ram Series; 2012-2013; Rubber Valve
 Ram; Ram Series; 2014-2015; Rubber Valve
 Rolls Royce; Dawn; 2017; Rubber Valve
 Rolls Royce; Ghost; 2011-2016; Rubber Valve
 Rolls Royce; Phantom; 2012-2015; Rubber Valve
 Rolls Royce; Silver Dawn; 2016; Rubber Valve
 Rolls Royce; Wraith; 2014-2015; Rubber Valve
 Saab; 9-4X; 2011

Saturn; Aura; 2008-2009
 Saturn; Outlook; 2009-2010
 Saturn; Vue; 2007-2010
 Subaru; Crosstrek; 2017
 Subaru; Crosstrek; 2018
 Subaru; Forester; 2008-2015
 Subaru; Forester; 2016
 Subaru; Forester; 2017-2018
 Subaru; Impreza; 2008-2015
 Subaru; Impreza; 2016
 Subaru; Impreza; 2017-2018
 Subaru; Legacy; 2008; W/18" Wheels
 Subaru; Legacy; 2009-2015
 Subaru; Legacy; 2016
 Subaru; Legacy; 2017-2018
 Subaru; Outback; 2008-2015
 Subaru; Outback; 2016-2017
 Subaru; Outback; 2018; Rubber Valve
 Subaru; Tribeca; 2008
 Subaru; Tribeca; 2009; Rubber Valve
 Subaru; Tribeca; 2010
 Subaru; Tribeca; 2011; Rubber Valve
 Subaru; Tribeca; 2012-2014
 Subaru; WRX; 2013-2015
 Subaru; WRX; 2016
 Subaru; WRX; 2017-2018; Rubber Valve
 Subaru; XV Crosstrek; 2013-2015
 Subaru; XV Crosstrek; 2016
 Suzuki; Forenza; 2007-2008
 Suzuki; Reno; 2007-2008
 Volkswagen; Routan; 2009-2010; Rubber Valve
 Volkswagen; Routan; 2011-2013; Rubber Valve
 Volvo; XC90; 2012-2015
 VPG; MV-1; 2011; Rubber Valve
 VPG; MV-1; 2012; Rubber Valve
 VPG; MV-1; 2013-2016; Rubber Valve

2019



Acura; CSX; 2008-2011
 Acura; TL; 2009-2013
 Acura; ZDX; 2010-2013
 Honda; Civic; 2008-2014
 Honda; CR-Z; 2011-2014
 Honda; CR-Z; 2015
 Honda; Element; 2009-2011
 Honda; Fit; 2009-2014
 Honda; Insight; 2010-2014
 Honda; Odyssey; 2011-2016
 Honda; Odyssey; 2017
 Hyundai; Elantra; 2010
 Hyundai; Elantra; 2011
 Hyundai; Elantra; 2012
 Hyundai; Elantra; 2013

Numerical Listing

Mercedes-Benz; SLK350; 2013; Fits Schrader Sensor; Includes Stem Only
 Mercedes-Benz; SLK55 AMG; 2007; Fits Schrader Sensor; Includes Stem Only
 Mercedes-Benz; SLK55 AMG; 2008-2010; Fits Schrader Sensor; Includes Stem Only
 Mercedes-Benz; SLS AMG; 2011-2012; Fits Schrader Sensor; Includes Stem Only
 Mercedes-Benz; SLS AMG; 2013; Fits Schrader Sensor; Includes Stem Only
 Mitsubishi; Raider; 2008-2009; Fits Schrader Sensor; Includes Stem Only
 Smart; Fortwo; 2008-2012; Fits Schrader Sensor; Includes Stem Only
 Smart; Fortwo; 2013; Fits Schrader Sensor; Includes Stem Only
 Suzuki; Kizashi; 2010-2012; Fits Schrader Sensor; Includes Stem Only

20022



Hyundai; Accent; 2008-2011
 Hyundai; Equus; 2011-2013
 Hyundai; Genesis; 2009-2014
 Hyundai; Santa Fe; 2013
 Hyundai; Santa Fe XL; 2013
 Hyundai; Sonata; 2009-2010
 Hyundai; Tucson; 2010-2013
 Kia; Borrego; 2009-2011
 Kia; Rio; 2007-2011
 Kia; Rio; 2012-2016
 Kia; Rio; 2017
 Kia; Rio; 2018
 Kia; Rio5; 2007-2011
 Kia; Spectra; 2006
 Kia; Spectra; 2007-2009
 Kia; Spectra5; 2006
 Kia; Spectra5; 2007-2009
 Kia; Sportage; 2009-2012
 Kia; Sportage; 2013
 Toyota; Sequoia; 2008-2013
 Toyota; Sienna; 2006-2014
 Toyota; Tundra; 2006; Nov. 1 & Newer
 Toyota; Tundra; 2007; W/Alloy Wheels; W/TRW Sensor
 Toyota; Tundra; 2008-2011
 Toyota; Tundra; 2012
 Toyota; Tundra; 2013
 Toyota; Tundra; 2014
 Toyota; Tundra; 2015

Service Pack

20023



Audi; A3, A4,A5 & Quattro; 2002-2005; Does Not Include Valve
 Audi; A3, A4,A5 & Quattro; 2006-2007; Does Not Include Valve
 Audi; A3, A4,A5 & Quattro; 2008; Does Not Include Valve
 Audi; A6; 2002-2004; Does Not Include Valve
 Audi; A6; 2006-2008; Does Not Include Valve
 Audi; A6; 2009; Does Not Include Valve
 Audi; A6; 2010; Does Not Include Valve
 Audi; A6; 2011; Does Not Include Valve
 Audi; A6 Quattro; 2006-2008; Does Not Include Valve
 Audi; A6 Quattro; 2010; Does Not Include Valve
 Audi; A6 Quattro; 2011; Does Not Include Valve
 Audi; A8; 2000; Does Not Include Valve
 Audi; A8 Quattro; 2000-2002; Does Not Include Valve
 Audi; A8 Quattro; 2003; Does Not Include Valve
 Audi; A8 Quattro; 2004-2011; Does Not Include Valve
 Audi; Allroad Quattro; 2001-2005; Does Not Include Valve
 Audi; Q7; 2007-2009; Does Not Include Valve
 Audi; Q7; 2010; Does Not Include Valve
 Audi; Q7; 2011; Does Not Include Valve
 Audi; Q7; 2012; Does Not Include Valve
 Audi; R8; 2008-2009; Does Not Include Valve
 Audi; R8; 2010; Does Not Include Valve
 Audi; R8; 2011; Does Not Include Valve
 Audi; R8; 2012; Does Not Include Valve
 Audi; R8; 2014-2015; Does Not Include Valve
 Audi; R8; 2017-2018; Does Not Include Valve
 Audi; RS4; 2007-2008; Does Not Include Valve
 Audi; RS6; 2003; Does Not Include Valve
 Audi; RS7; 2014-2016; Does Not Include Valve
 Audi; RS7; 2017-2018; Does Not Include Valve
 Audi; S4; 2002; Does Not Include Valve
 Audi; S4; 2003; Does Not Include Valve
 Audi; S4; 2004-2009; Does Not Include Valve
 Audi; S6; 2007-2009; Does Not Include Valve
 Audi; S6; 2010; Does Not Include Valve
 Audi; S6; 2011; Does Not Include Valve
 Audi; S8; 2001-2002; Does Not Include Valve
 Audi; S8; 2003; Does Not Include Valve
 Audi; S8; 2004-2006; Does Not Include Valve
 Audi; S8; 2007-2008; Does Not Include Valve
 Audi; S8; 2009; Does Not Include Valve
 Audi; S8; 2015; Does Not Include Valve
 Audi; TT RS; 2018; Does Not Include Valve
 Bentley; Azure; 2007-2009; Does Not Include Valve
 Bentley; Bentayga; 2017-2018; Does Not Include Valve
 Bentley; Continental; 2003-2005; Does Not Include Valve
 Bentley; Continental; 2006-2010; Does Not Include Valve
 Bentley; Continental; 2012-2017; Does Not Include Valve
 Bentley; Continental; 2018; Does Not Include Valve
 Bentley; Flying Spur; 2014-2018; Does Not Include Valve
 Bentley; Mulsanne; 2011-2017; Does Not Include Valve
 BMW; 1 Series; 2008; Does Not Include Valve
 BMW; 1 Series; 2009-2010; Does Not Include Valve
 BMW; 1 Series; 2011-2013; Does Not Include Valve
 BMW; 228i; 2015
 BMW; 228i; 2016
 BMW; 320i; 2001-2002; Does Not Include Valve
 BMW; 320i; 2003-2005; Does Not Include Valve
 BMW; 323Ci; 2000; Does Not Include Valve
 BMW; 323i; 2000; Does Not Include Valve

Numerical Listing

BMW; 323i; 2003; Does Not Include Valve
 BMW; 323i; 2006; Does Not Include Valve; Jun. & Newer
 BMW; 323i; 2007-2010; Does Not Include Valve
 BMW; 325; 2001-2002; Does Not Include Valve
 BMW; 325; 2003-2006; Does Not Include Valve
 BMW; 325; 2007; Does Not Include Valve
 BMW; 328Ci; 2000; Does Not Include Valve
 BMW; 328i; 2000; Does Not Include Valve
 BMW; 328i; 2007-2008; Does Not Include Valve
 BMW; 328i; 2009; Does Not Include Valve
 BMW; 328i; 2010-2013; Does Not Include Valve
 BMW; 328i; 2014-2016; Does Not Include Valve
 BMW; 328i GT xDrive; 2014-2016; Does Not Include Valve
 BMW; 328i xDrive; 2009; Does Not Include Valve
 BMW; 328i xDrive; 2010-2013; Does Not Include Valve
 BMW; 328i xDrive; 2014-2015; Does Not Include Valve
 BMW; 328xi; 2007-2008; Does Not Include Valve
 BMW; 330; 2001-2002; Does Not Include Valve
 BMW; 330; 2003-2006; Does Not Include Valve
 BMW; 335d; 2009; Does Not Include Valve
 BMW; 335d; 2010-2011; Does Not Include Valve
 BMW; 335i; 2007-2008; Does Not Include Valve
 BMW; 335i; 2009; Does Not Include Valve
 BMW; 335i; 2010-2012; Does Not Include Valve
 BMW; 335i; 2013-2014; Does Not Include Valve
 BMW; 335i GT xDrive; 2014-2015; Does Not Include Valve
 BMW; 335i xDrive; 2009; Does Not Include Valve
 BMW; 335i xDrive; 2010-2012; Does Not Include Valve
 BMW; 335i xDrive; 2013-2015; Does Not Include Valve
 BMW; 335is; 2012-2013; Does Not Include Valve
 BMW; 335xi; 2007-2008; Does Not Include Valve
 BMW; 428i; 2014; Does Not Include Valve
 BMW; 428i; 2015; Does not include valve
 BMW; 428i xDrive; 2014; Does Not Include Valve
 BMW; 428i xDrive; 2015; Does not include valve
 BMW; 435i; 2014; Does Not Include Valve
 BMW; 435i; 2015; Does not include valve
 BMW; 435i; 2016; Does not include valve
 BMW; 435i xDrive; 2014; Does Not Include Valve
 BMW; 435i xDrive; 2015; Does not include valve
 BMW; 525i; 2001; Does Not Include Valve
 BMW; 525i; 2002; Does Not Include Valve
 BMW; 525i; 2003-2005; Does Not Include Valve
 BMW; 525i; 2006-2007; Does Not Include Valve
 BMW; 525xi; 2006-2007; Does Not Include Valve
 BMW; 528; 1997-1998; Does Not Include Valve
 BMW; 528; 1999-2000; Does Not Include Valve
 BMW; 528; 2008; Does Not Include Valve
 BMW; 528; 2009-2011; Does Not Include Valve
 BMW; 528; 2012-2014; Does Not Include Valve
 BMW; 528; 2015-2016; Does Not Include Valve
 BMW; 528xi; 2008; Does Not Include Valve
 BMW; 530; 2001; Does Not Include Valve
 BMW; 530; 2002; Does Not Include Valve
 BMW; 530; 2003-2005; Does Not Include Valve
 BMW; 530; 2006-2007; Does Not Include Valve
 BMW; 535; 2008-2010; Does Not Include Valve
 BMW; 535; 2011; Does Not Include Valve
 BMW; 535; 2012-2014; Does Not Include Valve
 BMW; 535; 2015-2016; Does Not Include Valve
 BMW; 535d; 2014; Does Not Include Valve
 BMW; 535d; 2015-2016; Does Not Include Valve
 BMW; 535d xDrive; 2014; Does Not Include Valve
 BMW; 535d xDrive; 2015-2016; Does Not Include Valve
 BMW; 535xi; 2008; Does Not Include Valve
 BMW; 540i; 1997-1998; Does Not Include Valve
 BMW; 540i; 1999-2000; Does Not Include Valve
 BMW; 540i; 2001; Does Not Include Valve
 BMW; 540i; 2002; Does Not Include Valve
 BMW; 540i; 2003; Does Not Include Valve
 BMW; 540i; 2008-2011; Does Not Include Valve
 BMW; 540i; 2012-2016; Does Not Include Valve
 BMW; 545i; 2004-2005; Does Not Include Valve
 BMW; 550; 2006-2010; Does Not Include Valve
 BMW; 550; 2011; Does Not Include Valve

BMW; 550; 2012-2014; Does Not Include Valve
 BMW; 550; 2015-2016; Does Not Include Valve
 BMW; 640; 2012-2015; Does Not Include Valve
 BMW; 640; 2016; Does Not Include Valve
 BMW; 645Ci; 2004-2005; Does Not Include Valve
 BMW; 650; 2006-2010; Does Not Include Valve
 BMW; 650; 2012-2015; Does Not Include Valve
 BMW; 650; 2016; Does Not Include Valve
 BMW; 650i Gran Coupe xDrive; 2016; Does Not Include Valve
 BMW; 740i; 1997-1998; Does Not Include Valve
 BMW; 740i; 1999-2001; Does Not Include Valve
 BMW; 740i; 2011; Does Not Include Valve
 BMW; 740i; 2012-2014; Does Not Include Valve
 BMW; 740i; 2015-2016; Does Not Include Valve
 BMW; 740iL; 1997-1998; Does Not Include Valve
 BMW; 740iL; 1999-2000; Does Not Include Valve
 BMW; 740iL; 2001; Does Not Include Valve
 BMW; 740Li; 2011; Does Not Include Valve
 BMW; 740Li; 2012-2016; Does Not Include Valve
 BMW; 740Li xDrive; 2013-2016; Does Not Include Valve
 BMW; 745; 2002; Does Not Include Valve
 BMW; 745; 2003; Does Not Include Valve
 BMW; 745; 2004-2005; Does Not Include Valve
 BMW; 750; 2006-2010; Does Not Include Valve
 BMW; 750; 2011; Does Not Include Valve
 BMW; 750; 2012-2016; Does Not Include Valve
 BMW; 750iL; 1997-1998; Does Not Include Valve
 BMW; 750iL; 1999-2000; Does Not Include Valve
 BMW; 750iL; 2001; Does Not Include Valve
 BMW; 760i; 2004-2005; Does Not Include Valve
 BMW; 760i; 2006; Does Not Include Valve
 BMW; 760Li; 2003; Does Not Include Valve
 BMW; 760Li; 2004-2008; Does Not Include Valve
 BMW; 760Li; 2010; Does Not Include Valve
 BMW; 760Li; 2011; Does Not Include Valve
 BMW; 760Li; 2012-2014; Does Not Include Valve
 BMW; 760Li; 2015; Does Not Include Valve
 BMW; 760Li; 2016; Does Not Include Valve
 BMW; ActiveHybrid 3; 2013-2014; Does Not Include Valve
 BMW; ActiveHybrid 5; 2012-2014; Does Not Include Valve
 BMW; ActiveHybrid 5; 2015; Does Not Include Valve
 BMW; ActiveHybrid 7; 2013-2015; Does Not Include Valve
 BMW; Alpina B7; 2007-2008; Does Not Include Valve
 BMW; Alpina B7; 2011-2015; Does Not Include Valve
 BMW; Alpina B7 xDrive; 2011; Does Not Include Valve
 BMW; Alpina B7L; 2011; Does Not Include Valve
 BMW; Alpina B7L xDrive; 2011; Does Not Include Valve
 BMW; M; 2000-2001; Does Not Include Valve
 BMW; M; 2002; Does Not Include Valve
 BMW; M; 2003; Does Not Include Valve
 BMW; M; 2004-2010; Does Not Include Valve
 BMW; M; 2011-2012; Does Not Include Valve
 BMW; M; 2013; Does Not Include Valve
 BMW; M; 2014; Does Not Include Valve
 BMW; M; 2015-2016; Does Not Include Valve
 BMW; X; 1999-2004; Does Not Include Valve
 BMW; X; 2005-2007; Does Not Include Valve
 BMW; X; 2008-2010; Does Not Include Valve
 BMW; X; 2011; Does Not Include Valve
 BMW; X; 2012-2014; Does Not Include Valve
 BMW; X; 2015; Does Not Include Valve
 BMW; X; 2016; Does Not Include Valve
 BMW; Z3; 2000-2002; Does Not Include Valve
 BMW; Z4; 2003-2010; Does Not Include Valve
 BMW; Z4; 2011; Does Not Include Valve
 BMW; Z4; 2012-2015; Does Not Include Valve
 BMW; Z4; 2016; Does Not Include Valve
 BMW; Z8; 2000-2002; Does Not Include Valve
 BMW; Z8; 2003; Does Not Include Valve
 Bugatti; Veyron 16.4; 2006; Does Not Include Valve
 Ferrari; 488 GTB; 2017; Does Not Include Valve
 Ferrari; 488 Spider; 2017; Does Not Include Valve
 Ferrari; 612 Scaglietti; 2004-2011; Does Not Include Valve
 Ferrari; California T; 2017; Does Not Include Valve
 Ferrari; Enzo; 2003-2004; Does Not Include Valve

Numerical Listing

Ferrari; F12 Berlinetta; 2017; Does Not Include Valve
 Ferrari; F430; 2006-2007; Does Not Include Valve
 Ferrari; F430; 2008-2009; Does Not Include Valve
 Ferrari; GTC4Lusso; 2017; Does Not Include Valve
 Ferrari; Maranello; 1998-2006; Does Not Include Valve
 Land Rover; LR3; 2002-2004; Does Not Include Valve
 Land Rover; LR3; 2005; Does Not Include Valve
 Land Rover; Range Rover; 2002; Does Not Include Valve
 Land Rover; Range Rover; 2003-2005; Does Not Include Valve
 Maserati; Coupe; 2004-2006; Does Not Include Valve
 Maserati; Quattroporte; 2004-2008; Does Not Include Valve
 Maserati; Spyder; 2004-2006; Does Not Include Valve
 Mercedes-Benz; C Series; 2001-2006; Does Not Include Valve
 Mercedes-Benz; CL; 2000-2006; Does Not Include Valve
 Mercedes-Benz; E320; 2001-2005; Does Not Include Valve
 Mercedes-Benz; E430; 2001-2002; Does Not Include Valve
 Mercedes-Benz; E500; 2003-2005; Does Not Include Valve
 Mercedes-Benz; E55 AMG; 1999; Does Not Include Valve; Jul. & Newer
 Mercedes-Benz; E55 AMG; 2000-2005; Does Not Include Valve
 Mercedes-Benz; S Series; 2006; Does Not Include Valve
 Mercedes-Benz; S430; 2000-2006; Does Not Include Valve
 Mercedes-Benz; S500; 2000; Does Not Include Valve
 Mercedes-Benz; S500; 2001; Does Not Include Valve
 Mercedes-Benz; S500; 2002-2006; Does Not Include Valve
 Mercedes-Benz; S55 AMG; 2001-2006; Does Not Include Valve
 Mercedes-Benz; S600; 2001-2006; Does Not Include Valve
 Mercedes-Benz; S65 AMG; 2006; Does Not Include Valve
 Mercedes-Benz; SL500; 2000-2005; Does Not Include Valve
 Mercedes-Benz; SL55 AMG; 2003; Does Not Include Valve
 Mercedes-Benz; SL55 AMG; 2005; Does Not Include Valve
 Mercedes-Benz; SL600; 2001-2002; Does Not Include Valve
 Mercedes-Benz; SL600; 2004-2005; Does Not Include Valve
 Mercedes-Benz; SL65 AMG; 2005; Does Not Include Valve
 Mercedes-Benz; SLR McLaren; 2004-2006; Does Not Include Valve
 Mercedes-Benz; SLR McLaren; 2007; Does Not Include Valve
 Mini; Cooper; 2008-2009; Does Not Include Valve
 Mini; Cooper; 2010-2013; Does Not Include Valve
 Mini; Cooper; 2014; Does Not Include Valve
 Mini; Cooper; 2015-2016; Does Not Include Valve
 Porsche; 911; 2005-2006; Does Not Include Valve
 Porsche; 911; 2007-2009; Does Not Include Valve
 Porsche; 911; 2010; Does Not Include Valve
 Porsche; 911; 2011; Does Not Include Valve
 Porsche; 911; 2012; Does Not Include Valve
 Porsche; 911; 2013-2014; Does Not Include Valve
 Porsche; 911; 2015; Does Not Include Valve
 Porsche; 911; 2016; Does Not Include Valve
 Porsche; 918 Spyder; 2015-2016; Does Not Include Valve
 Porsche; Boxster; 2005-2007; Does Not Include Valve
 Porsche; Boxster; 2008-2010; Does Not Include Valve
 Porsche; Boxster; 2011; Does Not Include Valve
 Porsche; Boxster; 2012-2013; Does Not Include Valve
 Porsche; Boxster; 2014-2016; Does Not Include Valve
 Porsche; Carrera GT; 2004-2005; Does Not Include Valve
 Porsche; Cayenne; 2003-2006; Does Not Include Valve
 Porsche; Cayenne; 2008-2010; Does Not Include Valve
 Porsche; Cayenne; 2011-2013; Does Not Include Valve
 Porsche; Cayenne; 2014-2016; Does Not Include Valve
 Porsche; Cayenne; 2017; Does Not Include Valve
 Porsche; Cayman; 2005-2007; Does Not Include Valve
 Porsche; Cayman; 2008; Does Not Include Valve
 Porsche; Cayman; 2009-2010; Does Not Include Valve
 Porsche; Cayman; 2011; Does Not Include Valve
 Porsche; Cayman; 2012-2016; Does Not Include Valve
 Porsche; Macan; 2016-2017; Does Not Include Valve
 Porsche; Panamera; 2010; Does Not Include Valve
 Porsche; Panamera; 2014; Does Not Include Valve
 Rolls Royce; Ghost; 2011-2016; Does Not Include Valve
 Rolls Royce; Ghost; 2017; Does Not Include Valve
 Rolls Royce; Phantom; 2007-2011; Does Not Include Valve
 Rolls Royce; Phantom; 2012-2015; Does Not Include Valve
 Rolls Royce; Phantom; 2016-2017; Does Not Include Valve
 Rolls Royce; Silver Dawn; 2016; Does Not Include Valve
 Rolls Royce; Wraith; 2014-2015; Does Not Include Valve
 Rolls Royce; Wraith; 2016-2017; Does Not Include Valve

Volkswagen; Phaeton; 2004-2006; Does Not Include Valve
 Volkswagen; Touareg; 2004-2006; Does Not Include Valve
 Volkswagen; Touareg; 2007; Does Not Include Valve
 Volkswagen; Touareg; 2008-2009; Does Not Include Valve
 Volkswagen; Touareg; 2010; Does Not Include Valve
 Volkswagen; Touareg; 2011-2013; Does Not Include Valve
 Volkswagen; Touareg; 2014-2017; Does Not Include Valve

Numerical Listing

Service Pack

20030



Buick; Allure; 2007-2008; W/Siemens Sensor
 Buick; Enclave; 2008; W/Siemens Sensor
 Buick; LaCrosse; 2007-2008; W/Siemens Sensor
 Chevrolet; Equinox; 2007-2009; W/Siemens Sensor
 Chevrolet; Express; 2008-2009; W/Siemens Sensor
 Chrysler; 300; 2005-2006; W/Siemens Sensor
 Chrysler; 300; 2007; W/Siemens Sensor
 Chrysler; 300; 2008; W/Siemens Sensor
 Chrysler; 300M; 2002-2004; W/Siemens Sensor
 Chrysler; Aspen; 2007-2011; W/Siemens Sensor
 Chrysler; Concorde; 2002-2004; W/Siemens Sensor
 Chrysler; Crossfire; 2004; W/Siemens Sensor
 Chrysler; Crossfire; 2006-2008; W/Siemens Sensor
 Chrysler; Intrepid; 2002-2004; W/Siemens Sensor
 Chrysler; Pacifica; 2004; W/Siemens Sensor
 Chrysler; Pacifica; 2005
 Chrysler; Pacifica; 2006-2007; W/Siemens Sensor
 Chrysler; Pacifica; 2008; W/Siemens Sensor
 Chrysler; Prowler; 2002; W/Siemens Sensor
 Chrysler; PT Cruiser; 2008-2010; W/Siemens Sensor
 Chrysler; Sebring; 2007-2009; W/Siemens Sensor
 Chrysler; Town & Country; 2004-2005
 Chrysler; Town & Country; 2006-2007; W/Siemens Sensor
 Chrysler; Town & Country; 2008; W/Siemens Sensor
 Chrysler; Town & Country; 2009-2010; W/Siemens Sensor
 Dodge; Avenger; 2008-2009; W/Siemens Sensor
 Dodge; Caliber; 2007-2010; W/Siemens Sensor
 Dodge; Caravan; 2004-2005
 Dodge; Caravan; 2006-2007; W/Siemens Sensor
 Dodge; Charger; 2006-2007; W/Siemens Sensor
 Dodge; Charger; 2008; W/Siemens Sensor
 Dodge; Durango; 2007; W/Siemens Sensor
 Dodge; Durango; 2008; W/Siemens Sensor
 Dodge; Grand Caravan; 2004-2005
 Dodge; Grand Caravan; 2006-2007; W/Siemens Sensor
 Dodge; Grand Caravan; 2008-2010; W/Siemens Sensor
 Dodge; Journey; 2009; W/Siemens Sensor
 Dodge; Journey; 2010; W/Siemens Sensor
 Dodge; Magnum; 2005-2007; W/Siemens Sensor
 Dodge; Magnum; 2008; W/Siemens Sensor
 Dodge; Nitro; 2007-2008; W/Siemens Sensor
 GMC; Acadia; 2007-2008; W/Siemens Sensor
 GMC; Savana Series; 2008-2009; W/Siemens Sensor
 Jaguar; Jaguar; 2004-2012
 Jeep; Commander; 2006-2007; W/Siemens Sensor
 Jeep; Compass; 2007-2010; W/Siemens Sensor
 Jeep; Grand Cherokee; 2005-2007; W/Siemens Sensor
 Jeep; Liberty; 2005-2008; W/Siemens Sensor
 Jeep; Patriot; 2007-2010; W/Siemens Sensor
 Jeep; Wrangler; 2007-2008; W/Siemens Sensor
 Land Rover; LR2; 2008-2015
 Land Rover; LR3; 2006-2009
 Land Rover; LR4; 2010-2011
 Land Rover; LR4; 2012-2014
 Land Rover; Range Rover; 2006-2009
 Land Rover; Range Rover; 2010-2011
 Land Rover; Range Rover; 2012-2014
 Land Rover; Range Rover Evoque; 2012-2015
 Land Rover; Range Rover Sport; 2006-2009
 Land Rover; Range Rover Sport; 2010-2011

Land Rover; Range Rover Sport; 2012-2014
 Mitsubishi; i-MiEV; 2012-2016
 Mitsubishi; i-MiEV; 2017
 Mitsubishi; Lancer; 2008-2010
 Mitsubishi; Lancer; 2011
 Mitsubishi; Lancer; 2012
 Mitsubishi; Lancer; 2013-2014
 Mitsubishi; Lancer; 2015-2017
 Mitsubishi; Mirage; 2014
 Mitsubishi; Outlander; 2007-2010
 Mitsubishi; Outlander; 2011-2015
 Mitsubishi; Outlander; 2016-2017
 Mitsubishi; Outlander Sport; 2011-2015
 Mitsubishi; Outlander Sport; 2016-2018
 Mitsubishi; RVR; 2011-2014
 Mitsubishi; RVR; 2015
 Mitsubishi; RVR; 2016-2017
 Pontiac; G Series; 2008; W/Siemens Sensor
 Pontiac; Grand Prix; 2007; W/Siemens Sensor
 Pontiac; Montana; 2008; W/Siemens Sensor
 Pontiac; Solstice; 2008-2009; W/Siemens Sensor
 Pontiac; Torrent; 2007-2009; W/Siemens Sensor
 Saturn; Aura; 2007; W/Siemens Sensor
 Saturn; Outlook; 2007-2008; W/Siemens Sensor
 Saturn; Sky; 2008-2010; W/Siemens Sensor
 Suzuki; Kizashi; 2010-2012; W/Siemens Sensor
 Suzuki; XL-7; 2007-2009; W/Siemens Sensor

20031



Lexus; GS300; 2006
 Lexus; GS430; 2005
 Lexus; GS430; 2006; Jun. & Older
 Lexus; GX470; 2004-2005
 Lexus; GX470; 2006; Jan. 31 & Older
 Lexus; IS250; 2006; Mar. & Older
 Lexus; IS350; 2006; Mar. & Older
 Lexus; LX470; 2005
 Lexus; LX470; 2006; Jul. & Older
 Lexus; RX330; 2006; Jan. 31 & Older
 Toyota; 4Runner; 2003-2005
 Toyota; 4Runner; 2006; May & Older
 Toyota; Land Cruiser; 2005; May & Older
 Toyota; Land Cruiser; 2006; Mar. & Older
 Toyota; Sequoia; 2004-2007
 Toyota; Tacoma; 2005
 Toyota; Tacoma; 2006; Jul. & Older
 Toyota; Tundra; 2005
 Toyota; Tundra; 2006; Oct. 31 & Older

Numerical Listing

Service Pack

20032



Honda; Accord; 2008-2012
 Honda; CR-V; 2007-2011
 Honda; Fit; 2008
 Honda; Pilot; 2009; W/Alloy Wheels
 Honda; Pilot; 2010-2011; Exc. LX
 Honda; Pilot; 2012-2014; W/Alloy Wheels
 Honda; Pilot; 2015; W/Alloy Wheels
 Honda; S2000; 2008-2009
 Lexus; CT200h; 2011
 Lexus; CT200h; 2012-2015
 Lexus; CT200h; 2016-2017
 Lexus; ES300h; 2013
 Lexus; ES300h; 2014-2018
 Lexus; ES350; 2007-2012
 Lexus; ES350; 2013-2016
 Lexus; GS F; 2016
 Lexus; GS F; 2017-2018
 Lexus; GS200t; 2016
 Lexus; GS200t; 2017
 Lexus; GS350; 2007-2011
 Lexus; GS350; 2013
 Lexus; GS350; 2014-2017
 Lexus; GS430; 2006; Jul. & Newer
 Lexus; GS430; 2007
 Lexus; GS450h; 2007-2011
 Lexus; GS450h; 2013-2014
 Lexus; GS450h; 2015
 Lexus; GS450h; 2016-2017
 Lexus; GS460; 2008-2011
 Lexus; GS460; 2012-2016
 Lexus; GX460; 2010-2015
 Lexus; GX460; 2016-2017
 Lexus; GX470; 2006; Feb. & Newer
 Lexus; GX470; 2007-2009
 Lexus; HS250h; 2010-2012
 Lexus; IS F; 2008-2013
 Lexus; IS F; 2014-2016
 Lexus; IS200t; 2016
 Lexus; IS200t; 2017
 Lexus; IS250; 2006; Apr. 1 & Newer
 Lexus; IS250; 2007
 Lexus; IS250; 2008-2012
 Lexus; IS250; 2013-2016
 Lexus; IS300; 2016
 Lexus; IS300; 2017-2018
 Lexus; IS350; 2006; Apr. 1 & Newer
 Lexus; IS350; 2007-2012
 Lexus; IS350; 2013-2018
 Lexus; LFA; 2012
 Lexus; LFA; 2016
 Lexus; LS460; 2007-2016
 Lexus; LS460; 2017
 Lexus; LS600h; 2008-2012
 Lexus; LS600h; 2013-2016
 Lexus; LX470; 2006; Aug. & Newer
 Lexus; LX470; 2007
 Lexus; LX570; 2008-2011
 Lexus; LX570; 2013-2014
 Lexus; LX570; 2016
 Lexus; NX200t; 2015-2017

Lexus; NX300; 2018
 Lexus; NX300h; 2016-2018
 Lexus; RC F; 2015-2017
 Lexus; RC200t; 2016-2017
 Lexus; RC300; 2016-2017
 Lexus; RC350; 2016-2017
 Lexus; RX330; 2006; Feb. & Newer
 Lexus; RX350; 2007-2010
 Lexus; RX350; 2011-2012
 Lexus; RX350; 2013; exc F Sport
 Lexus; RX350; 2014-2015
 Lexus; RX350; 2016-2017
 Lexus; RX400h; 2006
 Lexus; RX400h; 2007-2008
 Lexus; RX450h; 2010-2013
 Lexus; RX450h; 2014-2016
 Lexus; SC430; 2006; Aug. & Newer
 Lexus; SC430; 2007-2010
 Nissan; 370Z; 2010
 Nissan; 370Z; 2011-2013
 Pontiac; Vibe; 2008-2010
 Scion; FR-S; 2013
 Scion; FR-S; 2014-2016
 Scion; iM; 2015-2016
 Scion; iQ; 2012-2014
 Scion; iQ; 2015
 Scion; tC; 2006; May & Newer
 Scion; tC; 2007-2014
 Scion; tC; 2015-2016
 Scion; xB; 2008-2014
 Scion; xB; 2015-2016
 Scion; xD; 2008-2014
 Subaru; BRZ; 2013-2014
 Subaru; BRZ; 2015-2017
 Toyota; 4Runner; 2006; Jun. & Newer
 Toyota; 4Runner; 2007
 Toyota; 4Runner; 2008
 Toyota; 4Runner; 2009
 Toyota; 4Runner; 2010-2016
 Toyota; 4Runner; 2017
 Toyota; Avalon; 2006; Aug. & Newer
 Toyota; Avalon; 2007-2014
 Toyota; Avalon; 2015
 Toyota; Avalon; 2016
 Toyota; Camry; 2007-2011
 Toyota; Camry; 2012-2014
 Toyota; Camry; 2015
 Toyota; Corolla; 2007; Jun. & Newer
 Toyota; Corolla; 2008
 Toyota; Corolla; 2009-2012
 Toyota; Corolla; 2013
 Toyota; Corolla; 2014
 Toyota; Corolla; 2015-2018
 Toyota; FJ Cruiser; 2008-2014
 Toyota; FJ Cruiser; 2015
 Toyota; Highlander; 2007; May & Newer
 Toyota; Highlander; 2008-2010
 Toyota; Highlander; 2011-2013
 Toyota; Highlander; 2014-2017
 Toyota; Land Cruiser; 2006; Apr. 1 & Newer
 Toyota; Land Cruiser; 2007-2011
 Toyota; Land Cruiser; 2013-2014
 Toyota; Land Cruiser; 2015
 Toyota; Matrix; 2007; Jun. & Newer
 Toyota; Matrix; 2008-2013
 Toyota; Mirai; 2016-2017
 Toyota; Prius; 2005-2013
 Toyota; Prius; 2014-2016
 Toyota; Prius; 2017
 Toyota; Prius Prime; 2017
 Toyota; RAV4; 2006; exc Electric
 Toyota; RAV4; 2007-2011; exc Electric
 Toyota; RAV4; 2012
 Toyota; RAV4; 2013; exc Electric
 Toyota; RAV4; 2016-2017

Numerical Listing

Toyota; Solara; 2006; May & Newer
 Toyota; Solara; 2007-2008
 Toyota; Tacoma; 2006; Aug. & Newer
 Toyota; Tacoma; 2007-2013
 Toyota; Tacoma; 2014
 Toyota; Tacoma; 2015
 Toyota; Venza; 2009-2014
 Toyota; Venza; 2015-2016
 Toyota; Yaris; 2007; Aug. & Newer
 Toyota; Yaris; 2008-2012
 Toyota; Yaris; 2013
 Toyota; Yaris; 2014-2015
 Toyota; Yaris; 2016-2018

20035



Honda; Pilot; 2005; LX; W/Long Stem Valve; Includes Valve
 Honda; Ridgeline; 2006; RT; Includes Valve
 Honda; Ridgeline; 2007-2008; RT; Includes Valve

Service Pack

20036



Acura; MDX, RDX; 2004-2006; Includes Valve
 Acura; RL; 2005-2013; Includes Valve
 Acura; TL; 2005; Includes Valve
 Acura; TL; 2006-2008; Includes Valve
 Dodge; Sprinter; 2007-2009; Includes Valve
 Freightliner; Sprinter; 2007-2008; Includes Valve
 Freightliner; Sprinter; 2013; Includes Valve
 Honda; Element; 2007-2008; Includes Valve
 Honda; Odyssey; 2005-2007; Touring; Includes Valve
 Honda; Odyssey; 2008; Includes Valve
 Honda; Odyssey; 2008; Touring; Includes Valve
 Honda; Odyssey; 2009-2010; Includes Valve
 Honda; Pilot; 2005; EX; Includes Valve
 Honda; Pilot; 2005; LX; W/Short Stem Valve; Includes Valve
 Honda; Pilot; 2006-2008; Includes Valve
 Honda; Ridgeline; 2006; RTL, RTS; Includes Valve
 Honda; Ridgeline; 2007-2008; RTL, RTS, RTX; Includes Valve
 Honda; Ridgeline; 2009; Includes Valve
 Honda; Ridgeline; 2010; RT; Includes Valve
 Honda; Ridgeline; 2011-2013; RT; Includes Valve
 Honda; Ridgeline; 2014; RT; Includes Valve
 Hyundai; Accent; 2006-2007; Includes Valve
 Hyundai; Azera; 2006; Includes Valve
 Hyundai; Azera; 2007-2012; Includes Valve
 Hyundai; Azera; 2013; Includes Valve
 Hyundai; Elantra; 2007-2009; Includes Valve
 Hyundai; Elantra; 2010; exc Touring; Includes Valve
 Hyundai; Elantra; 2011; exc Touring; Includes Valve
 Hyundai; Elantra; 2012; exc Touring; Includes Valve
 Hyundai; Elantra; 2013; Includes Valve
 Hyundai; Elantra Coupe; 2013; Includes Valve
 Hyundai; Entourage; 2007-2009; Includes Valve
 Hyundai; Santa Fe; 2007; Includes Valve
 Hyundai; Santa Fe; 2008; Includes Valve
 Hyundai; Santa Fe; 2009; Includes Valve
 Hyundai; Sonata; 2007-2008; Includes Valve
 Hyundai; Tiburon; 2007-2008; Includes Valve
 Hyundai; Tucson; 2006-2009; Includes Valve
 Hyundai; Veracruz; 2006-2007; Includes Valve
 Hyundai; Veracruz; 2008; Includes Valve
 Hyundai; Veracruz; 2009-2012; Includes Valve
 Kia; Amanti; 2007-2009; Includes Valve
 Kia; Magentis; 2008; Includes Valve
 Kia; Magentis; 2009; Includes Valve
 Kia; Magentis; 2010; Includes Valve
 Kia; Optima; 2006-2010; Includes Valve
 Kia; Rondo; 2007-2011; Includes Valve
 Kia; Sedona; 2006-2008; Includes Valve
 Kia; Sedona; 2009-2012; Includes Valve
 Kia; Sorento; 2007-2009; Includes Valve
 Kia; Sportage; 2005; Jun. 15, 2005 & Newer; Includes Valve
 Kia; Sportage; 2006-2008; Includes Valve
 Mercedes-Benz; C Series; 2007; Includes Valve
 Mercedes-Benz; C Series; 2008-2009; Includes Valve
 Mercedes-Benz; CL; 2008-2009; Includes Valve
 Mercedes-Benz; CLS; 2006; Includes Valve
 Mercedes-Benz; CLS550; 2007-2011; Includes Valve
 Mercedes-Benz; E320; 2006-2009; Includes Valve
 Mercedes-Benz; E350; 2006-2009; Includes Valve
 Mercedes-Benz; E500; 2006; Includes Valve

Numerical Listing

Mercedes-Benz; E55 AMG; 2006; Includes Valve
 Mercedes-Benz; E550; 2007-2009; Includes Valve
 Mercedes-Benz; E63 AMG; 2007-2009; Includes Valve
 Mercedes-Benz; GL; 2007-2009; Includes Valve
 Mercedes-Benz; GL320; 2007-2009; Includes Valve
 Mercedes-Benz; ML320; 2007-2009; Includes Valve
 Mercedes-Benz; ML350; 2006-2009; Includes Valve
 Mercedes-Benz; ML500; 2006-2007; Includes Valve
 Mercedes-Benz; ML550; 2008-2009; Includes Valve
 Mercedes-Benz; ML63 AMG; 2007-2009; Includes Valve
 Mercedes-Benz; R320; 2007-2009; Includes Valve
 Mercedes-Benz; R350; 2006-2009; Includes Valve
 Mercedes-Benz; R500; 2006-2007; Includes Valve
 Mercedes-Benz; R63 AMG; 2007; Includes Valve
 Mercedes-Benz; S Series; 2010; Includes Valve
 Mercedes-Benz; S550; 2007-2010; Includes Valve
 Mercedes-Benz; S600; 2007-2010; Includes Valve
 Mercedes-Benz; S63 AMG; 2008-2010; Includes Valve
 Mercedes-Benz; S65 AMG; 2007-2010; Includes Valve
 Mercedes-Benz; SL500; 2006; Includes Valve
 Mercedes-Benz; SL55 AMG; 2006-2008; Includes Valve
 Mercedes-Benz; SL550; 2007-2009; Includes Valve
 Mercedes-Benz; SL600; 2006-2009; Includes Valve
 Mercedes-Benz; SL63 AMG; 2009; Includes Valve
 Mercedes-Benz; SL65 AMG; 2006-2009; Includes Valve
 Mercedes-Benz; SLR McLaren; 2008-2009; Includes Valve
 Mercedes-Benz; Sprinter 2500; 2010; Includes Valve
 Mercedes-Benz; Sprinter 2500; 2011-2012; Includes Valve
 Mercedes-Benz; Sprinter 3500; 2010-2012; Includes Valve

Service Pack

20037 (W/43mm Silver Insert)



20040 (W/51mm Orange Insert)



20038 (W/48mm Green Insert)



20039 (W/49mm Black Insert)



Numerical Listing

Audi; A3, A4,A5 & Quattro; 2002-2005
 Audi; A3, A4,A5 & Quattro; 2006-2007
 Audi; A3, A4,A5 & Quattro; 2008
 Audi; A6; 2002-2004
 Audi; A6; 2006-2008
 Audi; A6; 2009
 Audi; A6; 2010
 Audi; A6; 2011
 Audi; A6 Quattro; 2006-2008
 Audi; A6 Quattro; 2010
 Audi; A6 Quattro; 2011
 Audi; A8; 2000
 Audi; A8 Quattro; 2000-2002
 Audi; A8 Quattro; 2003
 Audi; A8 Quattro; 2004-2011
 Audi; Allroad Quattro; 2001-2005
 Audi; Q7; 2007-2009
 Audi; Q7; 2010
 Audi; Q7; 2011
 Audi; Q7; 2012
 Audi; R8; 2008-2009
 Audi; R8; 2010
 Audi; R8; 2011
 Audi; R8; 2012
 Audi; R8; 2014-2015
 Audi; R8; 2017-2018
 Audi; RS4; 2007-2008
 Audi; RS6; 2003
 Audi; RS7; 2014-2016
 Audi; RS7; 2017-2018
 Audi; S4; 2002
 Audi; S4; 2004-2009
 Audi; S6; 2007-2009
 Audi; S6; 2010
 Audi; S6; 2011
 Audi; S8; 2003
 Audi; S8; 2004-2006
 Audi; S8; 2007-2008
 Audi; S8; 2009
 Audi; S8; 2015
 Audi; TT RS; 2018
 Bentley; Azure; 2007-2009
 Bentley; Bentayga; 2017-2018
 Bentley; Continental; 2003-2005
 Bentley; Continental; 2006-2010
 Bentley; Continental; 2012-2017
 Bentley; Flying Spur; 2014-2018
 Bentley; Mulsanne; 2011-2017
 BMW; 1 Series; 2008
 BMW; 1 Series; 2009-2010
 BMW; 1 Series; 2011-2013
 BMW; 228i; 2014
 BMW; 228i; 2015
 BMW; 228i; 2016
 BMW; 320i; 2001-2002
 BMW; 320i; 2003-2005
 BMW; 320i; 2014
 BMW; 320i xDrive; 2014
 BMW; 323Ci; 2000
 BMW; 323i; 2000
 BMW; 323i; 2003
 BMW; 323i; 2006
 BMW; 323i; 2007-2010
 BMW; 325; 2001-2002
 BMW; 325; 2003-2006
 BMW; 325; 2007
 BMW; 328Ci; 2000
 BMW; 328d; 2014
 BMW; 328d xDrive; 2014 328i; 2000
 BMW; 328i; 2007-2008
 BMW; 328i; 2009
 BMW; 328i; 2010-2013
 BMW; 328i; 2014-2016
 BMW; 328i GT xDrive; 2014-2016

BMW; 328i xDrive; 2009
 BMW; 328i xDrive; 2010-2013
 BMW; 328i xDrive; 2014-2015
 BMW; 328xi; 2007-2008
 BMW; 330; 2001-2002
 BMW; 330; 2003-2006
 BMW; 335d; 2009
 BMW; 335d; 2010-2011
 BMW; 335i; 2007-2008
 BMW; 335i; 2009
 BMW; 335i; 2010-2012
 BMW; 335i; 2013-2014
 BMW; 335i GT xDrive; 2014-2015
 BMW; 335i xDrive; 2009
 BMW; 335i xDrive; 2010-2012
 BMW; 335i xDrive; 2013-2015
 BMW; 335is; 2012-2013
 BMW; 335xi; 2007-2008
 BMW; 428i; 2014
 BMW; 428i xDrive; 2014
 BMW; 428i xDrive; 2015
 BMW; 435i; 2014
 BMW; 435i; 2015
 BMW; 435i; 2016
 BMW; 435i xDrive; 2014
 BMW; 435i xDrive; 2015
 BMW; 525i; 2001
 BMW; 525i; 2002
 BMW; 525i; 2003-2005
 BMW; 525i; 2006-2007
 BMW; 525xi; 2006-2007
 BMW; 528; 1997-1998
 BMW; 528; 1999-2000
 BMW; 528; 2008
 BMW; 528; 2009-2011
 BMW; 528; 2012-2014
 BMW; 528; 2015-2016
 BMW; 528xi; 2008
 BMW; 530; 2001
 BMW; 530; 2002
 BMW; 530; 2003-2005
 BMW; 530; 2006-2007
 BMW; 535; 2008-2010
 BMW; 535; 2011
 BMW; 535; 2012-2014
 BMW; 535; 2015-2016
 BMW; 535d; 2014
 BMW; 535d; 2015-2016
 BMW; 535d xDrive; 2014
 BMW; 535d xDrive; 2015-2016
 BMW; 535xi; 2008
 BMW; 540i; 1997-1998
 BMW; 540i; 1999-2000
 BMW; 540i; 2001
 BMW; 540i; 2002
 BMW; 540i; 2003
 BMW; 540i; 2008-2011
 BMW; 540i; 2012-2016
 BMW; 545i; 2004-2005
 BMW; 550; 2006-2010
 BMW; 550; 2011
 BMW; 550; 2012-2014
 BMW; 550; 2015-2016
 BMW; 640; 2012-2015
 BMW; 640; 2016
 BMW; 645Ci; 2004-2005
 BMW; 650; 2006-2010
 BMW; 650; 2012-2015
 BMW; 650; 2016
 BMW; 650i Gran Coupe xDrive; 2016
 BMW; 740i; 1997-1998
 BMW; 740i; 1999-2001
 BMW; 740i; 2011
 BMW; 740i; 2012-2014
 BMW; 740i; 2015-2016

Numerical Listing

BMW; 740iL; 1997-1998
 BMW; 740iL; 1999-2000
 BMW; 740iL; 2001
 BMW; 740Li; 2011
 BMW; 740Li; 2012-2016
 BMW; 740Li xDrive; 2013-2016
 BMW; 745; 2002
 BMW; 745; 2003
 BMW; 745; 2004-2005
 BMW; 750; 2006-2010
 BMW; 750; 2011
 BMW; 750; 2012-2016
 BMW; 750iL; 1997-1998
 BMW; 750iL; 1999-2000
 BMW; 750iL; 2001
 BMW; 760i; 2004-2005
 BMW; 760i; 2006
 BMW; 760Li; 2003
 BMW; 760Li; 2004-2008
 BMW; 760Li; 2010
 BMW; 760Li; 2011
 BMW; 760Li; 2012-2014
 BMW; 760Li; 2015
 BMW; 760Li; 2016
 BMW; ActiveHybrid 3; 2013-2014
 BMW; ActiveHybrid 5; 2012-2014
 BMW; ActiveHybrid 5; 2015
 BMW; ActiveHybrid 7; 2013-2015
 BMW; Alpina B7; 2007-2008
 BMW; Alpina B7; 2011-2015
 BMW; Alpina B7 xDrive; 2011
 BMW; Alpina B7L; 2011
 BMW; Alpina B7L xDrive; 2011
 BMW; M; 2000-2001
 BMW; M; 2002
 BMW; M; 2003
 BMW; M; 2004-2010
 BMW; M; 2011-2012
 BMW; M; 2013
 BMW; M; 2014
 BMW; M; 2015-2016
 BMW; X; 1999-2004
 BMW; X; 2005-2007
 BMW; X; 2008-2010
 BMW; X; 2011
 BMW; X; 2012-2014
 BMW; X; 2015
 BMW; X; 2016
 BMW; Z3; 2000-2002
 BMW; Z4; 2003-2010
 BMW; Z4; 2011
 BMW; Z4; 2012-2015
 BMW; Z4; 2016
 BMW; Z8; 2000-2002
 BMW; Z8; 2003
 Bugatti; Veyron 16.4; 2006
 Ferrari; 488 GTB; 2017
 Ferrari; 488 Spider; 2017
 Ferrari; 612 Scaglietti; 2004-2011
 Ferrari; California T; 2017
 Ferrari; Enzo; 2003-2004
 Ferrari; F12 Berlinetta; 2017
 Ferrari; F430; 2006-2007
 Ferrari; F430; 2008-2009
 Ferrari; GTC4Lusso; 2017
 Ferrari; Maranello; 1998-2006
 Land Rover; LR3; 2002-2004
 Land Rover; LR3; 2005
 Land Rover; Range Rover; 2002
 Land Rover; Range Rover; 2003-2005
 Maserati; Coupe; 2004-2006
 Maserati; GranTurismo; 2014
 Maserati; GranTurismo; 2015
 Maserati; GranTurismo; 2016-2017

Maserati; Quattroporte; 2004-2008
 Maserati; Spyder; 2004-2006
 Mercedes-Benz; C Series; 2001-2006
 Mercedes-Benz; CL; 2000-2006
 Mercedes-Benz; E320; 2001-2005
 Mercedes-Benz; E430; 2001-2002
 Mercedes-Benz; E500; 2003-2005
 Mercedes-Benz; E55 AMG; 1999
 Mercedes-Benz; E55 AMG; 2000-2005
 Mercedes-Benz; S Series; 2006
 Mercedes-Benz; S430; 2000-2006
 Mercedes-Benz; S500; 2000
 Mercedes-Benz; S500; 2001
 Mercedes-Benz; S500; 2002-2006
 Mercedes-Benz; S55 AMG; 2001-2006
 Mercedes-Benz; S600; 2001-2006
 Mercedes-Benz; S65 AMG; 2006
 Mercedes-Benz; SL500; 2000-2005
 Mercedes-Benz; SL55 AMG; 2003
 Mercedes-Benz; SL55 AMG; 2004
 Mercedes-Benz; SL55 AMG; 2005
 Mercedes-Benz; SL600; 2001-2002
 Mercedes-Benz; SL600; 2004-2005
 Mercedes-Benz; SL65 AMG; 2005
 Mercedes-Benz; SLR McLaren; 2004-2006
 Mercedes-Benz; SLR McLaren; 2007
 Mini; Cooper; 2008-2009
 Mini; Cooper; 2010-2013
 Mini; Cooper; 2014
 Mini; Cooper; 2015-2016
 Porsche; 911; 2005-2006
 Porsche; 911; 2007-2009
 Porsche; 911; 2010
 Porsche; 911; 2011
 Porsche; 911; 2012
 Porsche; 911; 2013-2014
 Porsche; 911; 2015
 Porsche; 911; 2016
 Porsche; 918 Spyder; 2015-2016
 Porsche; Boxster; 2005-2007
 Porsche; Boxster; 2008-2010
 Porsche; Boxster; 2011
 Porsche; Boxster; 2012-2013
 Porsche; Boxster; 2014-2016
 Porsche; Carrera GT; 2004-2005
 Porsche; Cayenne; 2003-2006
 Porsche; Cayenne; 2008-2010
 Porsche; Cayenne; 2011-2013
 Porsche; Cayenne; 2014-2016
 Porsche; Cayenne; 2017
 Porsche; Cayman; 2005-2007
 Porsche; Cayman; 2008
 Porsche; Cayman; 2009-2010
 Porsche; Cayman; 2011
 Porsche; Cayman; 2012-2016
 Porsche; Macan; 2016-2017
 Porsche; Panamera; 2010
 Porsche; Panamera; 2011
 Porsche; Panamera; 2014
 Rolls Royce; Ghost; 2011-2016
 Rolls Royce; Ghost; 2017
 Rolls Royce; Phantom; 2007-2011
 Rolls Royce; Phantom; 2012-2015
 Rolls Royce; Phantom; 2016-2017
 Rolls Royce; Silver Dawn; 2016
 Rolls Royce; Wraith; 2014-2015
 Rolls Royce; Wraith; 2016-2017
 Volkswagen; Phaeton; 2004-2006
 Volkswagen; Touareg; 2004-2006
 Volkswagen; Touareg; 2007
 Volkswagen; Touareg; 2008-2009
 Volkswagen; Touareg; 2010
 Volkswagen; Touareg; 2011-2013
 Volkswagen; Touareg; 2014-2017

Numerical Listing

20043



Chrysler; 200; 2015-2017
 Dodge; Dart; 2013-2016
 Jeep; Renegade; 2015-2016

20046



Hyundai; Sonata; 2015-2017; Rubber Valve
 Hyundai; Sonata; 2018; Rubber Valve
 Hyundai; Tucson; 2015-2017; Rubber Valve
 Hyundai; Tucson; 2018; Rubber Valve
 Kia; Sedona; 2015-2017; Rubber Valve
 Kia; Sedona; 2018; Rubber Valve
 Kia; Soul; 2014
 Kia; Soul; 2015-2016; Rubber Valve
 Kia; Soul; 2017-2018; Rubber Valve
 Kia; Soul EV; 2017; Rubber Valve

20047



Alfa Romeo; 4C; 2017
 Buick; Cascada; 2018
 Chevrolet; Caprice; 2014
 Chevrolet; Caprice; 2015
 Chevrolet; Corvette; 2014-2015
 Chevrolet; Corvette; 2016-2018
 Maserati; Ghibli; 2014-2016
 Maserati; Quattroporte; 2014-2016

Service Pack

20049 (Interchanges with 20047)



Alfa Romeo; 4C; 2017
 Buick; Cascada; 2018
 Chevrolet; Caprice; 2014
 Chevrolet; Caprice; 2015
 Chevrolet; Corvette; 2014-2015
 Chevrolet; Corvette; 2016-2018
 Infiniti; Q30; 2016
 Infiniti; QX30; 2016
 Maserati; Ghibli; 2014-2016
 Maserati; Quattroporte; 2014-2016
 Mercedes-Benz; B200; 2014
 Mercedes-Benz; B200; 2015-2016
 Mercedes-Benz; B200; 2017-2018
 Mercedes-Benz; B250; 2015
 Mercedes-Benz; B250; 2016
 Mercedes-Benz; B250; 2017-2018
 Mercedes-Benz; B250e; 2016-2018
 Mercedes-Benz; C Series; 2014-2015
 Mercedes-Benz; C Series; 2016-2018
 Mercedes-Benz; C250; 2014-2018
 Mercedes-Benz; C350e; 2016-2018
 Mercedes-Benz; C63 AMG S; 2015-2018
 Mercedes-Benz; CLA250; 2014-2016
 Mercedes-Benz; CLA250; 2017-2018
 Mercedes-Benz; CLA45 AMG; 2014-2016
 Mercedes-Benz; CLA45 AMG; 2017-2018
 Mercedes-Benz; CLS550; 2014-2016
 Mercedes-Benz; CLS63 AMG S; 2014-2016
 Mercedes-Benz; E250; 2014-2016
 Mercedes-Benz; E250; 2017
 Mercedes-Benz; E350; 2014-2016
 Mercedes-Benz; E350; 2017
 Mercedes-Benz; E400; 2014-2016
 Mercedes-Benz; E400; 2017
 Mercedes-Benz; E550; 2014-2016
 Mercedes-Benz; E550; 2017
 Mercedes-Benz; E63 AMG; 2014-2016
 Mercedes-Benz; E63 AMG; 2017
 Mercedes-Benz; E63 AMG S; 2014-2016
 Mercedes-Benz; E63 AMG S; 2017
 Mercedes-Benz; G550; 2014-2016
 Mercedes-Benz; G550; 2017-2018
 Mercedes-Benz; G63 AMG; 2014-2016
 Mercedes-Benz; G63 AMG; 2017-2018
 Mercedes-Benz; G65 AMG; 2016-2018
 Mercedes-Benz; GL; 2014-2016
 Mercedes-Benz; GL; 2017-2018
 Mercedes-Benz; GL350; 2014-2015
 Mercedes-Benz; GL350; 2016-2018
 Mercedes-Benz; GL63 AMG; 2014-2016
 Mercedes-Benz; GL63 AMG; 2017-2018
 Mercedes-Benz; GLA250; 2015-2018
 Mercedes-Benz; GLA45 AMG; 2015-2018
 Mercedes-Benz; GLC300; 2016-2018
 Mercedes-Benz; GLC43 AMG; 2017-2018
 Mercedes-Benz; GLE300d; 2016-2018
 Mercedes-Benz; GLE350; 2016-2018
 Mercedes-Benz; GLE350d; 2016-2018
 Mercedes-Benz; GLE400; 2016-2018
 Mercedes-Benz; GLE43 AMG; 2017-2018

Numerical Listing

Mercedes-Benz; GLE450 AMG; 2016-2018
 Mercedes-Benz; GLE550; 2016-2018
 Mercedes-Benz; GLE550e; 2016-2018
 Mercedes-Benz; GLE63 AMG; 2016-2018
 Mercedes-Benz; GLE63 AMG S; 2016-2018
 Mercedes-Benz; GLK250; 2014-2016
 Mercedes-Benz; GLK250; 2017
 Mercedes-Benz; GLK350; 2014-2016
 Mercedes-Benz; GLK350; 2017
 Mercedes-Benz; GLS350d; 2017
 Mercedes-Benz; GLS450; 2017
 Mercedes-Benz; ML250; 2015-2018
 Mercedes-Benz; ML350; 2015
 Mercedes-Benz; ML350; 2016-2018
 Mercedes-Benz; ML400; 2015-2018
 Mercedes-Benz; ML550; 2015-2016
 Mercedes-Benz; ML550; 2017-2018
 Mercedes-Benz; ML63 AMG; 2014-2016
 Mercedes-Benz; ML63 AMG; 2017-2018
 Mercedes-Benz; S Series; 2013
 Mercedes-Benz; S Series; 2014-2016
 Mercedes-Benz; S Series; 2017-2018
 Mercedes-Benz; S550; 2014-2016
 Mercedes-Benz; S550; 2017-2018
 Mercedes-Benz; S550e; 2017-2018
 Mercedes-Benz; S600; 2014-2016
 Mercedes-Benz; S600; 2017-2018
 Mercedes-Benz; S63 AMG; 2014-2016
 Mercedes-Benz; S63 AMG; 2017-2018
 Mercedes-Benz; S65 AMG; 2017-2018
 Mercedes-Benz; SL400; 2017-2018
 Mercedes-Benz; SL450; 2017-2018
 Mercedes-Benz; SL550; 2014-2016
 Mercedes-Benz; SL550; 2017-2018
 Mercedes-Benz; SL63 AMG; 2014-2016
 Mercedes-Benz; SL63 AMG; 2017-2018
 Mercedes-Benz; SL65 AMG; 2014-2018
 Mercedes-Benz; SLC300; 2017-2018
 Mercedes-Benz; SLC43 AMG; 2017-2018
 Mercedes-Benz; SLK250; 2014-2016
 Mercedes-Benz; SLK250; 2017
 Mercedes-Benz; SLK350; 2014-2016
 Mercedes-Benz; SLK350; 2017
 Mercedes-Benz; SLK55 AMG; 2014
 Mercedes-Benz; SLK55 AMG; 2015-2017
 Mercedes-Benz; SLS AMG; 2014-2015
 Smart; Fortwo; 2014
 Smart; Fortwo; 2015
 Smart; Fortwo; 2016-2017

Service Pack

20050



Acura; ILX; 2016-2017
 Acura; MDX, RDX; 2016-2017
 Acura; NSX; 2016
 Acura; RLX; 2014-2017
 Acura; RLX; 2018
 Acura; TL; 2014-2015
 Alfa Romeo; Giulia; 2016-2017
 BMW; 428i; 2014
 BMW; 428i; 2015
 BMW; 428i; 2016
 BMW; 428i; 2017
 BMW; 428i xDrive; 2014
 BMW; 428i xDrive; 2015
 BMW; 428i xDrive; 2016-2017
 BMW; 435i; 2015
 BMW; 435i; 2016
 BMW; 435i; 2017
 BMW; 435i xDrive; 2015
 BMW; 435i xDrive; 2016-2017
 Fiat; 124 Spider; 2017
 Genesis; G80; 2017
 Genesis; G80; 2018
 Genesis; G90; 2017
 Honda; Accord Crosstour; 2010-2015
 Honda; Crosstour; 2010-2015
 Honda; CR-V; 2012-2013
 Honda; Odyssey; 2018
 Honda; Ridgeline; 2016-2017
 Hyundai; Accent; 2012-2014
 Hyundai; Accent; 2015
 Hyundai; Elantra; 2010
 Hyundai; Elantra; 2010; Touring; Includes Transmitter Only
 Hyundai; Elantra; 2011
 Hyundai; Elantra; 2011; Touring; Includes Transmitter Only
 Hyundai; Elantra; 2012
 Hyundai; Elantra; 2012; Touring; W/Transmitter Only
 Hyundai; Elantra; 2014
 Hyundai; Elantra GT; 2013-2015
 Hyundai; Elantra GT; 2016-2017
 Hyundai; Equus; 2014-2015
 Hyundai; Equus; 2016
 Hyundai; Genesis; 2014
 Hyundai; Genesis; 2015-2016
 Hyundai; Genesis Coupe; 2010-2012
 Hyundai; Genesis Coupe; 2013
 Hyundai; Genesis Coupe; 2014-2015
 Hyundai; Genesis Coupe; 2016
 Hyundai; Santa Fe; 2013
 Hyundai; Santa Fe; 2014-2016
 Hyundai; Sonata; 2011-2013
 Hyundai; Sonata; 2014
 Hyundai; Veloster; 2017
 Jaguar; Jaguar; 2016-2017
 Jaguar; XE; 2015-2017
 Kia; Cadenza; 2014-2015
 Kia; Cadenza; 2016
 Kia; Forte; 2010-2013
 Kia; Forte Koup; 2010-2013
 Kia; Forte Koup; 2014
 Kia; Forte5; 2012-2013

Numerical Listing

Kia; Optima; 2011-2015
 Kia; Rio; 2017
 Kia; Rio5; 2012
 Kia; Sorento; 2011-2014
 Kia; Sorento; 2015
 Kia; Sorento; 2016-2017
 Kia; Soul; 2010-2013
 Lamborghini; Aventador; 2017
 Lamborghini; Huracan; 2017
 Land Rover; Discovery; 2014-2016
 Land Rover; Discovery Sport; 2015-2017
 Land Rover; LR3; 2005
 Land Rover; LR3; 2006-2009
 Land Rover; Range Rover; 2002
 Land Rover; Range Rover; 2003-2005
 Land Rover; Range Rover; 2006-2009
 Land Rover; Range Rover; 2015-2017
 Land Rover; Range Rover Evoque; 2016-2017
 Land Rover; Range Rover Sport; 2005
 Land Rover; Range Rover Sport; 2006-2009
 Land Rover; Range Rover Sport; 2015-2017
 Mazda; 2; 2011-2013
 Mazda; 3; 2004
 Mazda; 3; 2005-2012
 Mazda; 3; 2013
 Mazda; 5; 2006-2010
 Mazda; 5; 2012-2013
 Mazda; 6; 2008-2013
 Mazda; CX-5; 2017
 Mazda; CX-7; 2007-2011
 Mazda; CX-9; 2007-2013
 Mazda; MX-5 Miata; 2006-2015
 Mazda; RX-8; 2004
 Mazda; RX-8; 2005-2011
 Volvo; C30,C70,S40; 2007-2013
 Volvo; S60,S80; 2007-2009
 Volvo; S60,S80; 2010
 Volvo; S60,S80; 2011-2013
 Volvo; S60,S80; 2014
 Volvo; V50; 2005-2011
 Volvo; V70; 2008-2010
 Volvo; XC60; 2010-2014
 Volvo; XC70; 2008-2014

Service Pack

20050V



Acura; ILX; 2013-2015; Hybrid
 Acura; ILX; 2016-2017
 Acura; MDX, RDX; 2013
 Acura; MDX, RDX; 2014-2015
 Acura; MDX, RDX; 2016-2017
 Acura; NSX; 2016
 Acura; RLX; 2014-2017
 Acura; RLX; 2018
 Acura; TL; 2014-2015
 Alfa Romeo; Giulia; 2016-2017
 BMW; 428i; 2014
 BMW; 428i; 2015
 BMW; 428i; 2016
 BMW; 428i; 2017
 BMW; 428i xDrive; 2014
 BMW; 428i xDrive; 2015
 BMW; 428i xDrive; 2016-2017
 BMW; 435i; 2015
 BMW; 435i; 2016
 BMW; 435i; 2017
 BMW; 435i xDrive; 2015
 BMW; 435i xDrive; 2016-2017
 Fiat; 124 Spider; 2017
 Genesis; G80; 2017
 Genesis; G80; 2018
 Honda; Accord Crosstour; 2010-2015
 Honda; Crosstour; 2010-2015
 Honda; CR-V; 2012-2013
 Honda; Odyssey; 2018
 Honda; Ridgeline; 2016-2017
 Hyundai; Accent; 2012-2014
 Hyundai; Accent; 2015
 Hyundai; Elantra; 2010
 Hyundai; Elantra; 2010; Touring; Includes Transmitter Only
 Hyundai; Elantra; 2011
 Hyundai; Elantra; 2011; Touring; Includes Transmitter Only
 Hyundai; Elantra; 2012
 Hyundai; Elantra; 2012; Touring; W/Transmitter Only
 Hyundai; Elantra; 2014
 Hyundai; Elantra GT; 2013-2015
 Hyundai; Elantra GT; 2016-2017
 Hyundai; Equus; 2014-2015
 Hyundai; Equus; 2016
 Hyundai; Genesis; 2014
 Hyundai; Genesis; 2015-2016
 Hyundai; Genesis Coupe; 2010-2012
 Hyundai; Genesis Coupe; 2013
 Hyundai; Genesis Coupe; 2014-2015
 Hyundai; Genesis Coupe; 2016
 Hyundai; Santa Fe; 2013
 Hyundai; Santa Fe; 2014-2016
 Hyundai; Sonata; 2011-2013
 Hyundai; Sonata; 2014
 Hyundai; Veloster; 2017
 Infiniti; QX60; 2014-2015
 Jaguar; Jaguar; 2016-2017
 Jaguar; XE; 2015-2017
 Kia; Cadenza; 2014-2015
 Kia; Cadenza; 2016
 Kia; Forte; 2010-2013

Numerical Listing

Kia; Forte Koup; 2010-2013
 Kia; Forte Koup; 2014
 Kia; Forte5; 2012-2013
 Kia; Optima; 2011-2015
 Kia; Rio; 2017
 Kia; Rio5; 2012
 Kia; Sorento; 2011-2014
 Kia; Sorento; 2015
 Kia; Sorento; 2016-2017
 Kia; Soul; 2010-2013
 Lamborghini; Aventador; 2017
 Lamborghini; Huracan; 2017
 Land Rover; Discovery; 2014-2016
 Land Rover; Discovery Sport; 2015-2017
 Land Rover; LR3; 2005
 Land Rover; LR3; 2006-2009
 Land Rover; Range Rover; 2002
 Land Rover; Range Rover; 2003-2005
 Land Rover; Range Rover; 2006-2009
 Land Rover; Range Rover; 2015-2017
 Land Rover; Range Rover Evoque; 2016-2017
 Land Rover; Range Rover Sport; 2005
 Land Rover; Range Rover Sport; 2006-2009
 Land Rover; Range Rover Sport; 2015-2017
 Mazda; 2; 2011-2013
 Mazda; 3; 2004
 Mazda; 3; 2005-2012
 Mazda; 3; 2013
 Mazda; 5; 2006-2010
 Mazda; 5; 2012-2013
 Mazda; 6; 2008-2013
 Mazda; CX-5; 2017
 Mazda; CX-7; 2007-2011
 Mazda; CX-9; 2007-2013
 Mazda; MX-5 Miata; 2006-2015
 Mazda; RX-8; 2004
 Mazda; RX-8; 2005-2011
 Nissan; Altima; 2013-2015
 Nissan; Altima; 2016-2017
 Nissan; Cube; 2014
 Nissan; Leaf; 2013
 Nissan; Leaf; 2014-2017
 Nissan; Maxima; 2013
 Nissan; Maxima; 2014-2015
 Nissan; Maxima; 2016
 Nissan; Murano; 2013-2014
 Nissan; Murano; 2015-2017
 Nissan; Pathfinder; 2013-2015
 Nissan; Rogue; 2014-2016
 Nissan; Sentra; 2014-2017
 Nissan; Versa; 2014-2017
 Nissan; Versa Note; 2014-2017
 Volvo; C30,C70,S40; 2007-2013
 Volvo; S60,S80; 2007-2009
 Volvo; S60,S80; 2010
 Volvo; S60,S80; 2011-2013
 Volvo; S60,S80; 2014
 Volvo; V50; 2005-2011
 Volvo; V70; 2008-2010
 Volvo; XC60; 2010-2014
 Volvo; XC70; 2008-2014

Service Pack

20051



Acura; ILX; 2013-2015; exc Hybrid
 Acura; MDX, RDX; 2013
 Acura; MDX, RDX; 2014-2015
 Acura; RLX; 2014-2017
 Acura; RLX; 2018
 Infiniti; QX60; 2014-2015
 Nissan; Altima; 2013-2015
 Nissan; Altima; 2016-2017
 Nissan; Cube; 2014
 Nissan; Leaf; 2013
 Nissan; Leaf; 2014-2017
 Nissan; Maxima; 2013
 Nissan; Maxima; 2014-2015
 Nissan; Maxima; 2016
 Nissan; Murano; 2013-2014
 Nissan; Murano; 2015-2017
 Nissan; Pathfinder; 2013-2015
 Nissan; Rogue; 2014-2016
 Nissan; Sentra; 2014-2017
 Nissan; Versa; 2014-2017
 Nissan; Versa Note; 2014-2017

20052



Hyundai; Azera; 2014-2015
 Hyundai; Elantra; 2011
 Hyundai; Elantra; 2012
 Hyundai; Elantra; 2013
 Hyundai; Elantra; 2014
 Hyundai; Elantra; 2015
 Hyundai; Elantra Coupe; 2013
 Hyundai; Elantra Coupe; 2014
 Kia; Forte; 2016-2017
 Kia; Forte; 2018
 Kia; Rio; 2012-2016
 Kia; Rio; 2017
 Kia; Rio5; 2015-2016
 Kia; Sportage; 2016

Numerical Listing

Service Pack

20635



Jeep; Cherokee; 2014
 Jeep; Cherokee; 2015; Rubber Valve
 Jeep; Cherokee; 2016-2017; Rubber Valve
 Jeep; Cherokee; 2018; Rubber Valve
 Ram; Ram Series; 2014-2015
 Ram; Ram Series; 2016-2017

INDIRECT

Audi; A3, A4, A5 & Quattro; 2013-2018
 Audi; A4 allroad; 2013-2018
 Audi; A6; 2013-2018
 Audi; A6 Quattro; 2015-2017
 Audi; A7 Quattro; 2013-2018
 Audi; A8; 2013-2018
 Audi; Q3; 2013-2018
 Audi; Q3 Quattro; 2015-2018
 Audi; Q5; 2013-2018
 Audi; Q7; 2013-2018
 Audi; RS5; 2013-2017
 Audi; RS7; 2017-2018; W/48mm Green Insert
 Audi; S3; 2015-2018
 Audi; S4; 2013-2018
 Audi; S5; 2013-2018
 Audi; S6; 2013-2018
 Audi; S7; 2013-2018
 Audi; S8; 2013-2014
 Audi; S8; 2015
 Audi; S8; 2016-2018
 Audi; SQ5; 2013-2014
 Audi; SQ5; 2015
 Audi; SQ5; 2016-2018
 Audi; TT; 2013-2018
 Audi; TT Quattro; 2013-2017
 Audi; TT RS; 2018
 Buick; Allure; 2006
 Buick; Century; 1999-2005
 Buick; LeSabre; 2000-2005
 Buick; Park Avenue; 1998-2005
 Buick; Regal; 1999-2004
 Buick; Rendezvous; 2003-2007
 Chevrolet; Impala; 2000-2005
 Chevrolet; Monte Carlo; 2000-2005
 Fiat; 124 Spider; 2017
 Honda; Accord; 2013-2018
 Honda; Civic; 2016-2018
 Honda; CR-V; 2014-2018
 Honda; Fit; 2015-2018
 Lexus; LS430; 2004-2006
 Lexus; RX330; 2004-2005
 Mazda; 3; 2014-2018
 Mazda; 6; 2014-2017
 Mazda; CX-3; 2016-2018 Mazda; CX-5; 2013-2016 Mazda; CX-9; 2016
 Mazda; CX-9; 2017
 Mazda; MX-5
 Miata; 2016-2017
 Oldsmobile; Alero; 1999-2000
 Oldsmobile; Aurora; 2001-2003
 Pontiac; Aztek; 2003-2005

Pontiac; Bonneville; 2000-2005
 Pontiac; Grand Am; 1999-2002
 Pontiac; Grand Prix; 2004-2006
 Pontiac; Vibe; 2005-2007
 Toyota; Sienna; 2005
 Toyota; Yaris; 2015
 Toyota; Yaris iA; 2017
 Volkswagen; Beetle; 2013-2018
 Volkswagen; Golf; 2013-2017
 Volkswagen; Golf Alltrack; 2017
 Volkswagen; Golf R; 2015-2017
 Volkswagen; Golf SportWagen; 2015-2017
 Volkswagen; GTI; 2013-2015
 Volkswagen; Jetta; 2013-2017
 Volkswagen; Passat; 2013-2017
 Volkswagen; Routan; 2015
 Volkswagen; Tiguan; 2014-2017
 Volvo; S60 Cross Country; 2017
 Volvo; S60, S80; 2017
 Volvo; S90; 2017-2018
 Volvo; V60; 2017-2018
 Volvo; V60 Cross Country; 2017-2018
 Volvo; V90; 2017
 Volvo; V90; 2018
 Volvo; XC60; 2015
 Volvo; XC60; 2017
 Volvo; XC60; 2018
 Volvo; XC90; 2017-2018

NHTSA TREAD Act

The Transportation Recall Enhancement, Accountability and Documentation (TREAD) Act was passed in the fall of 2000. The TREAD Act mandated that every new car manufactured for sale in the U.S. after September 1, 2007 must be equipped with sensors that monitor the pressure in all four tires. Sensors installed in the vehicle's wheels send a signal via RF to the vehicle's computer. The computer then processes the sensor data to alert the driver if pressure drops 25% below the specified cold placard pressure for the tire.





Schrader Performance Sensors

Tech Hotline: 1.800.288.1804
SchraderNA@Sensata.com

Visit our NEW website!
www.SchraderSensors.com

Follow us on social:



TPMS-CAT 040118



Schrader is a brand of  Sensata Technologies